



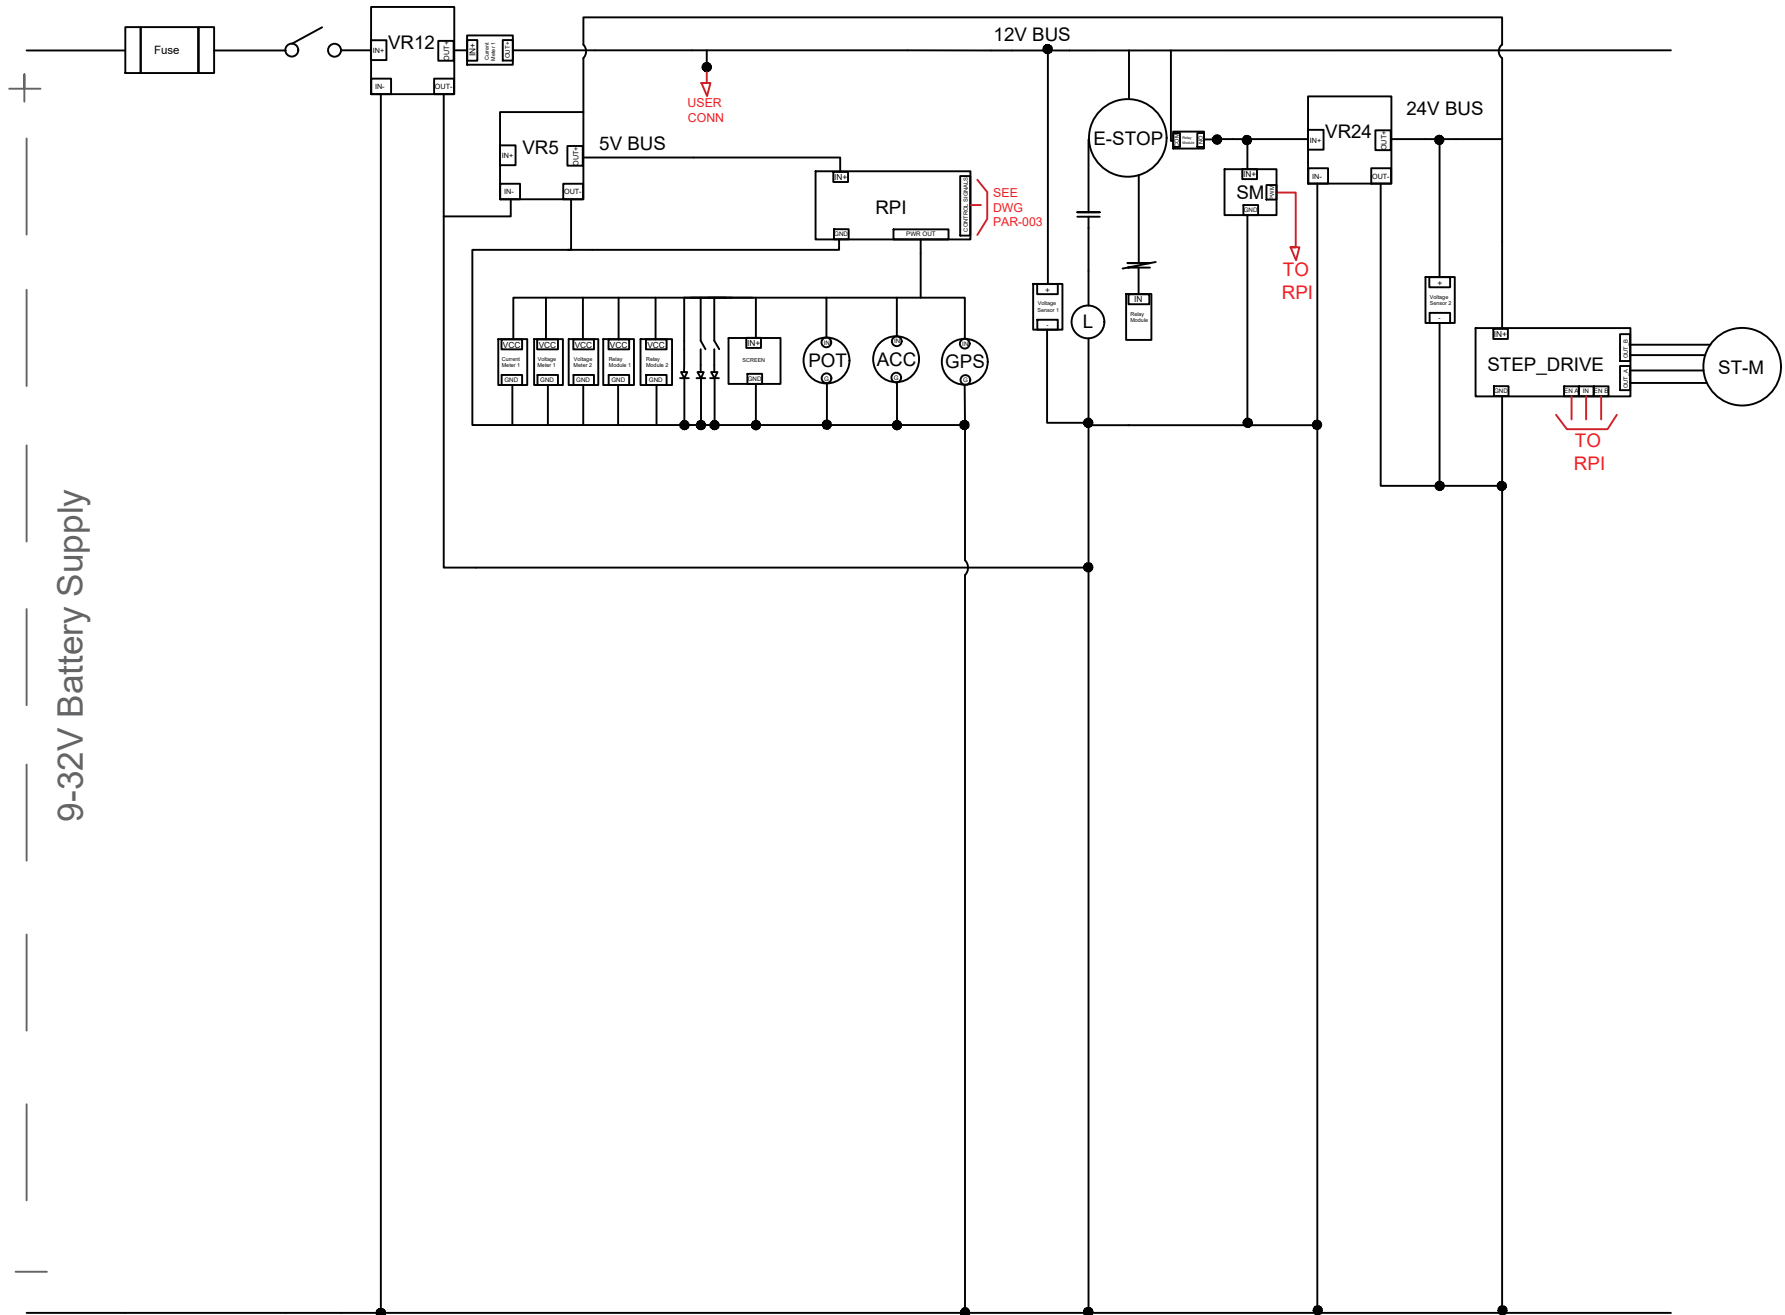


Notes:
1. Taken From Kicad Drawing

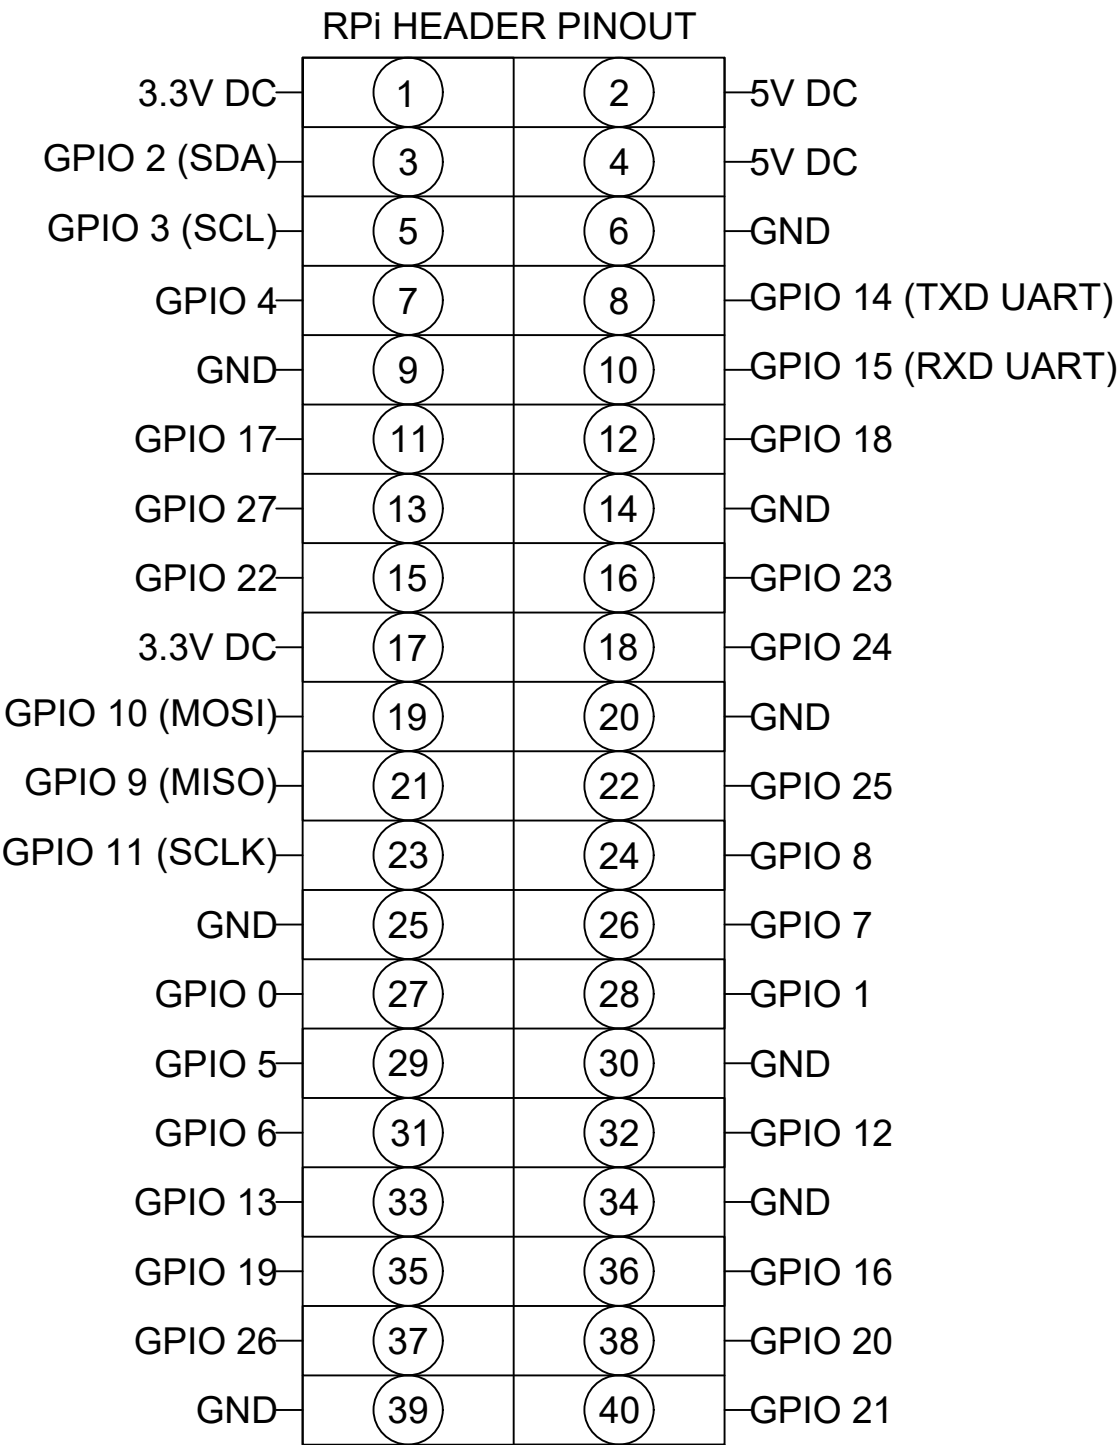


RPI Header Pinout Connections			
#	Connection	#	Connection
1	PWR GPS, MAG	2	PWR ADC1, ADC2, VOLT1, VOLT2, POT
3	I2C For MAG, ADC1, ADC2	4	PWR 2-Channel Relay
5	I2C For MAG, ADC1, ADC2	6	GND
7		8	UART For GPS
9	GND	10	UART For GPS
11		12	
13		14	GND
15		16	
17		18	
19		20	GND
21		22	Stepper Driver ENA
23		24	Stepper Driver DIR
25	GND	26	Stepper Driver PUL
27		28	
29		30	GND
31		32	
33		34	GND
35		36	SERVO PWM
37		38	2-Channel Relay IN0
39	GND	40	2-Channel Relay IN1

MALE SIDE REAR VIEW

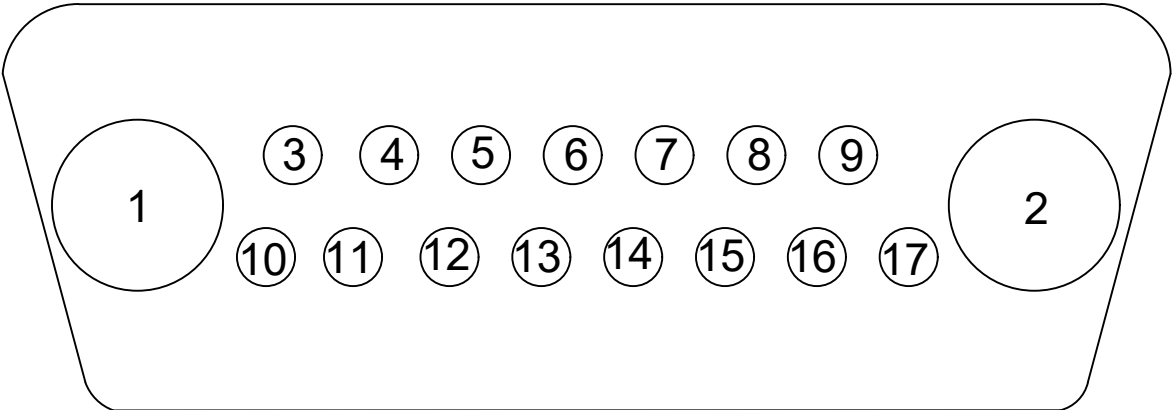

- | | | | |
|-------------|--------------|----------|----------|
| 1:SERVO PWR | 6:MAG GND | 11:SPARE | 16:SPARE |
| 2:SERVO GND | 7:POT + | 12:A+ | 17:SPARE |
| 3:MAG PWR | 8:POT SLIDE | 13:A- | |
| 4:MAG SDA | 9:POT - | 14:B+ | |
| 5:MAG SDL | 10:SERVO SIG | 15:B- | |


FEMALE SIDE REAR VIEW

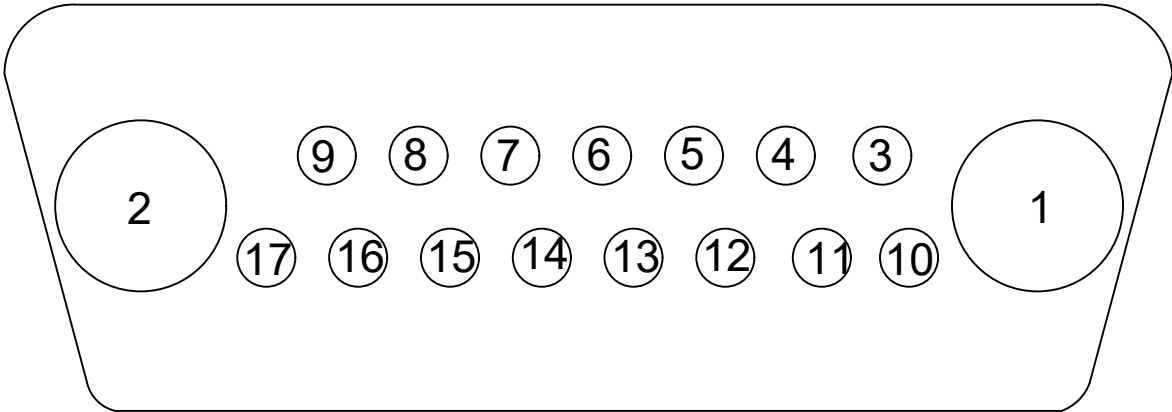


- | | | | |
|-------------|--------------|----------|----------|
| 1:SERVO PWR | 6:MAG GND | 11:SPARE | 16:SPARE |
| 2:SERVO GND | 7:POT + | 12:A+ | 17:SPARE |
| 3:MAG PWR | 8:POT SLIDE | 13:A- | |
| 4:MAG SDA | 9:POT - | 14:B+ | |
| 5:MAG SDL | 10:SERVO SIG | 15:B- | |

REV 0	Initial Drawing Creation	REV 1	D-Sub Layout	Drawn By: Isaac Newton		Portable Antenna Rotator Fairbanks Alaska
REV 1	Added Servo Signal Connection		PAR-004			

- Notes:
1. This circuit is the proposed design
 2. Real wiring powers AE from 24V terminal to avoid unintentional resets

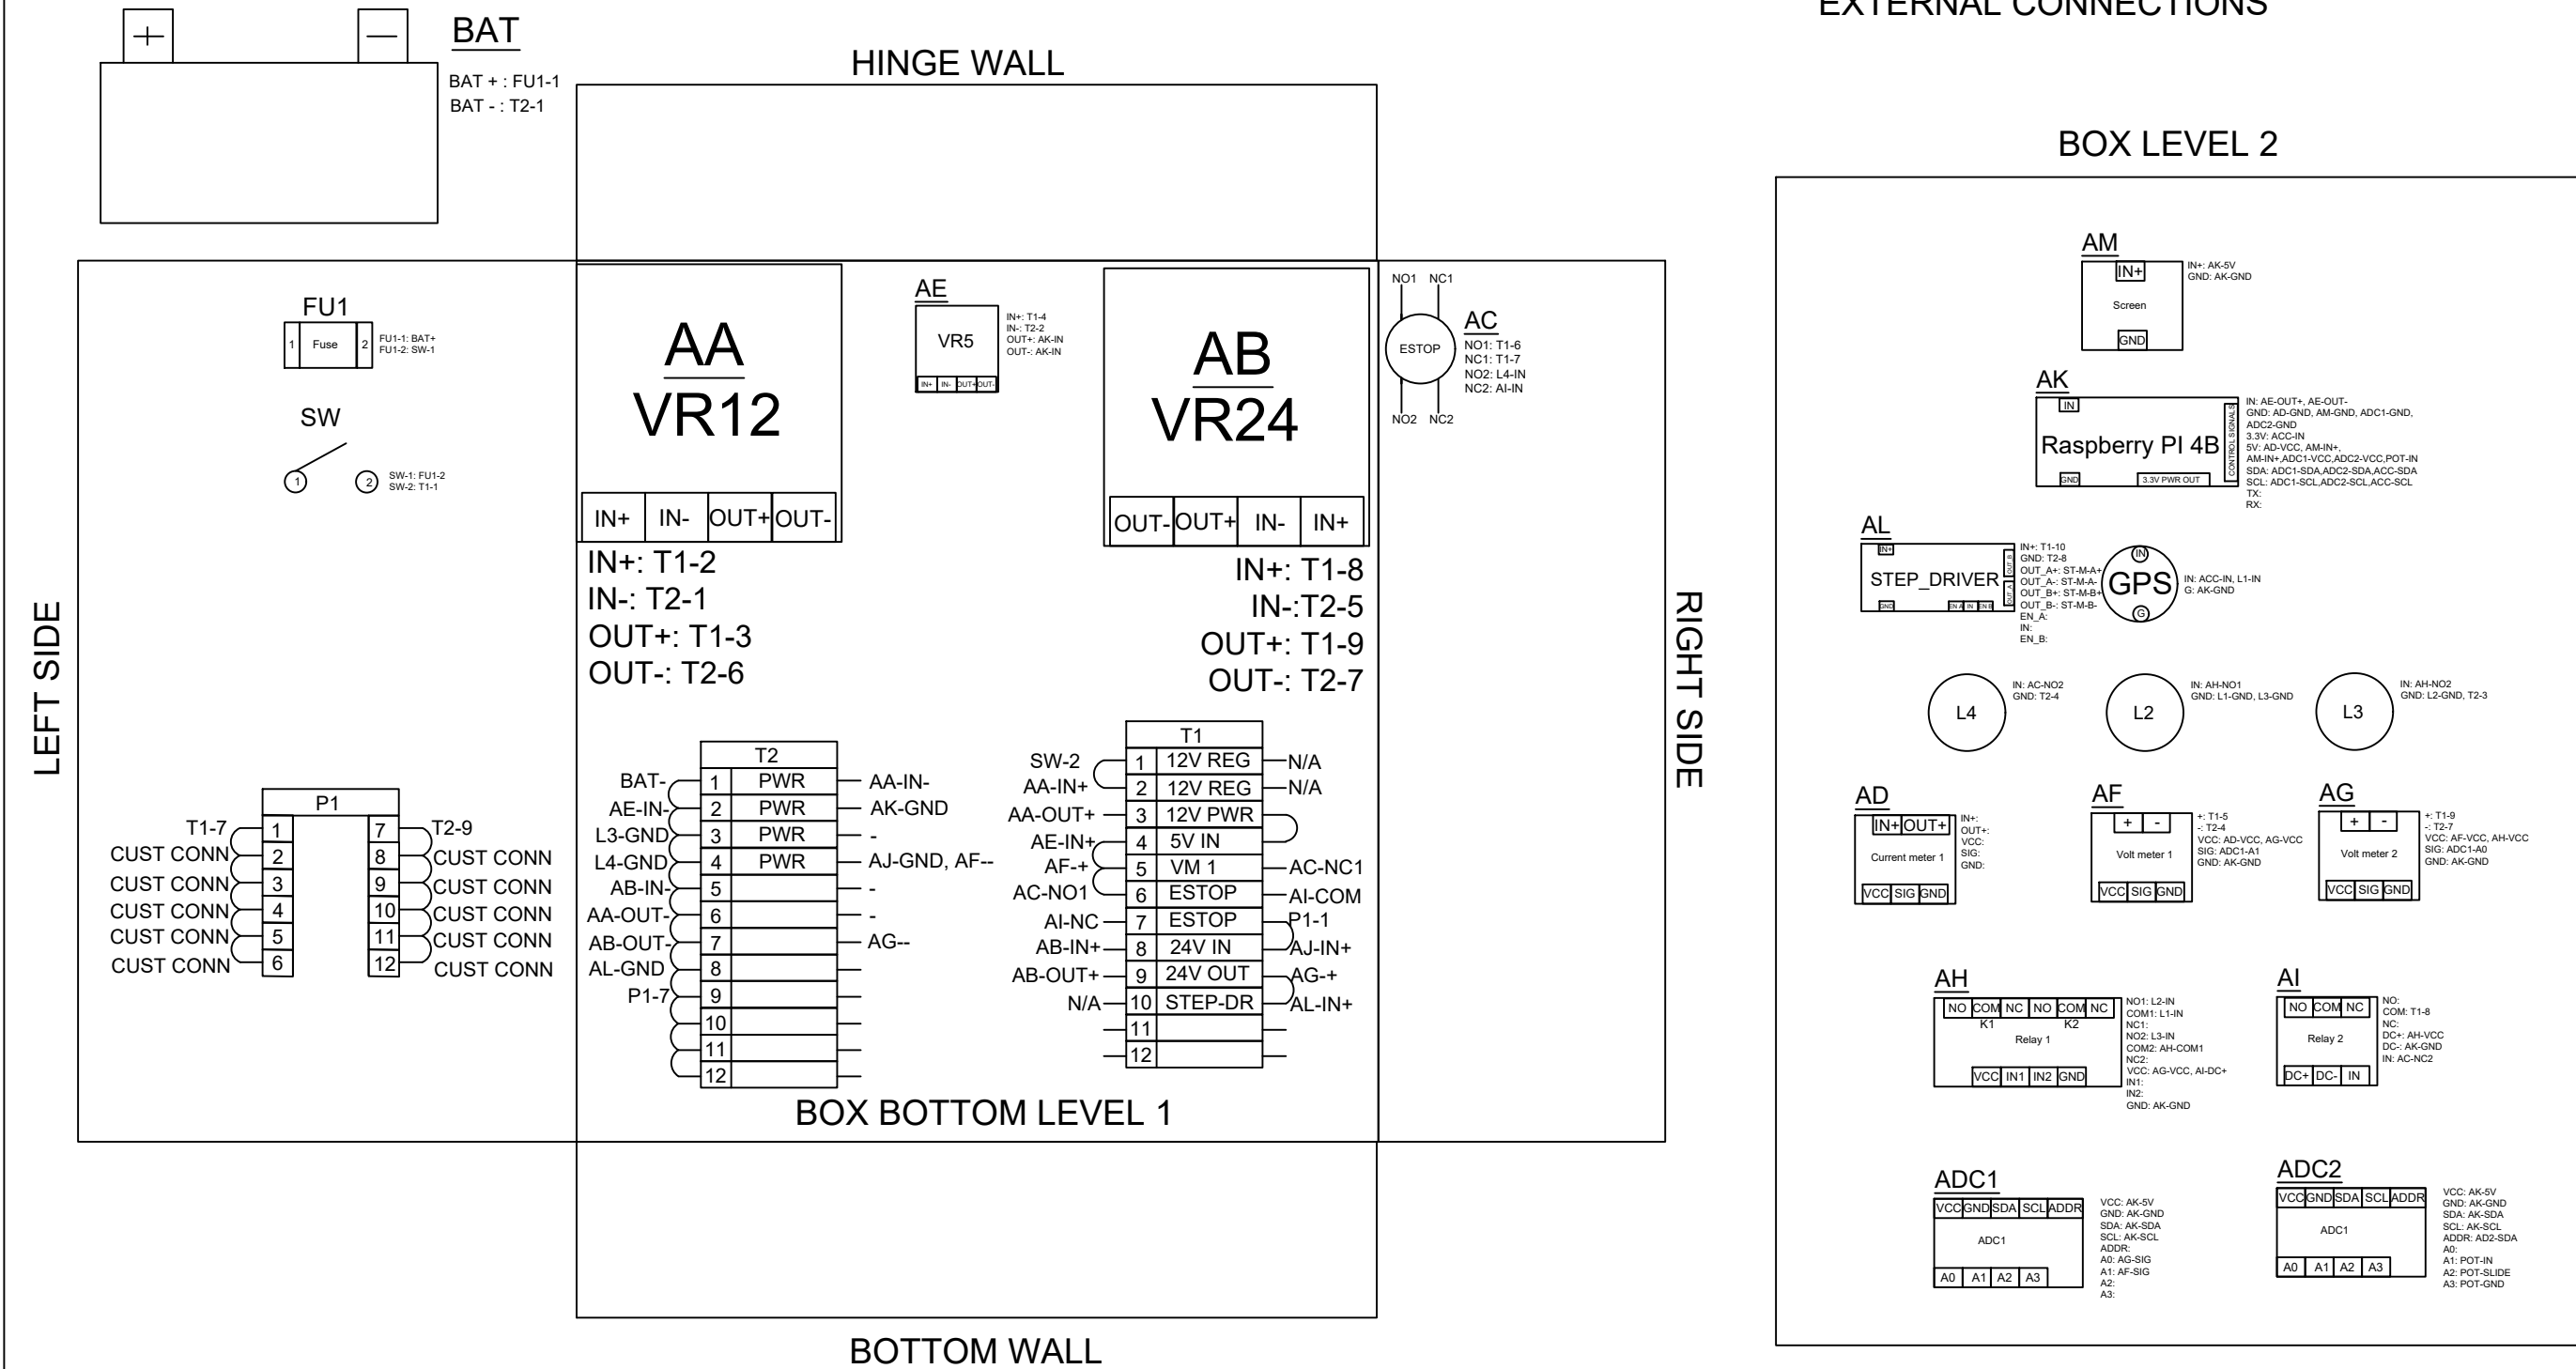

REV 0	Initial Drawing Creation	REV 1	Electrical Box Wiring	Drawn By: Isaac Newton		Portable Antenna Rotator Fairbanks Alaska
REV 1	Added Component plate					
			PAR-006			

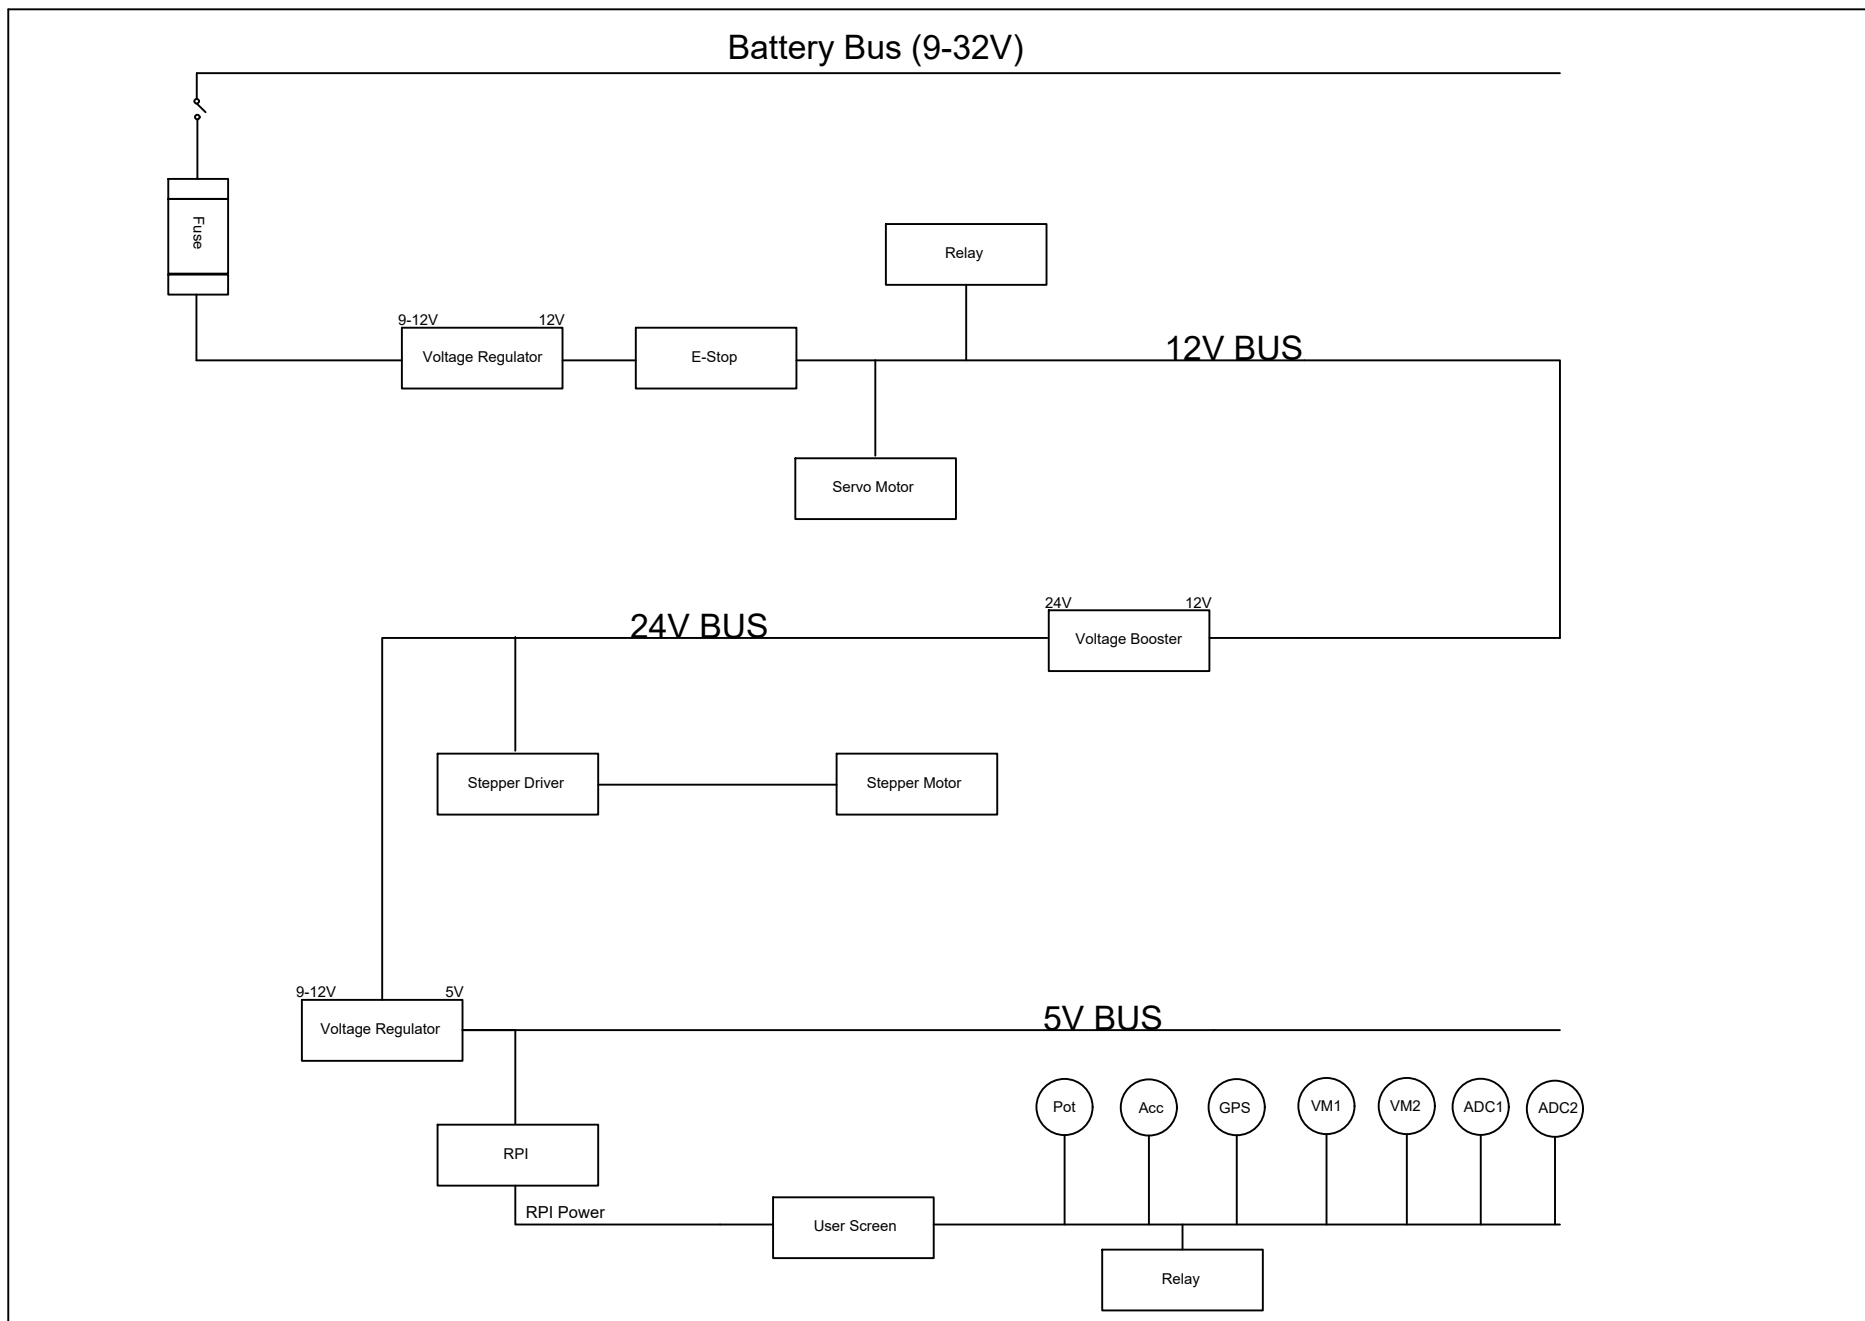

REV 0	Initial Drawing Creation	REV 0	PAR One-Line	Drawn By: Isaac Newton	 Portable Antenna Rotator Fairbanks Alaska
			PAR-001		