
Barcelona Gardens Condominium

Typical elevations by building · Concrete and stucco repair locations

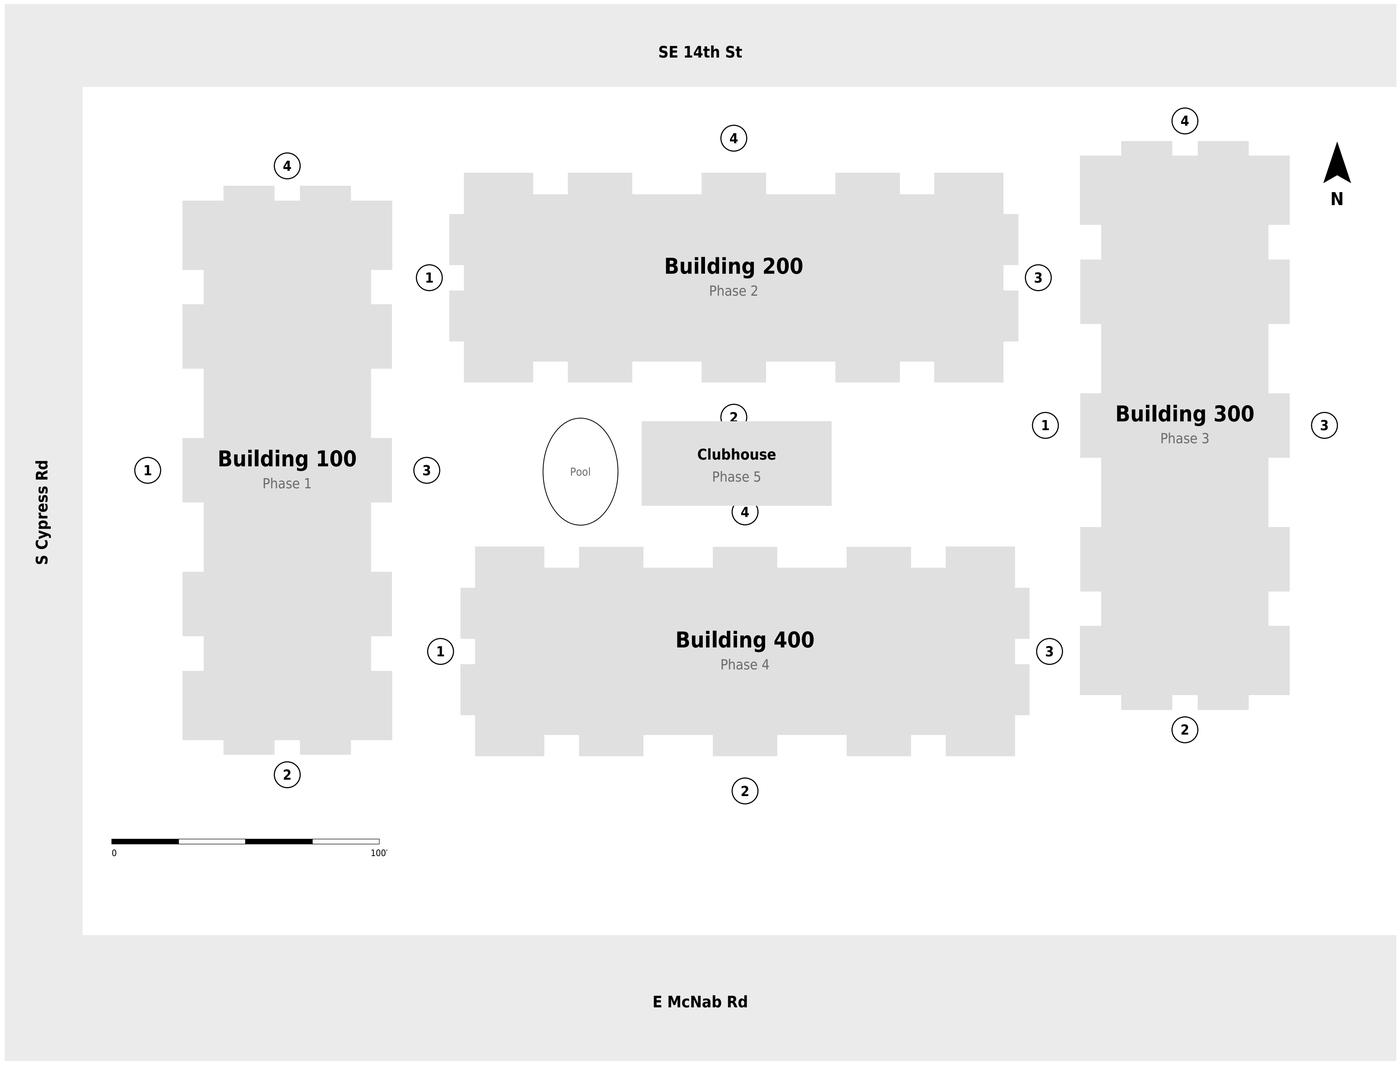

Site plan. Circled numbers show the elevation number of each face per the MTD phasing plan: 1 West, 2 South, 3 East, 4 North.

How to read these sheets

Each sheet shows two orthographic elevations of one building. Each repair has a circled number with a leader line pointing to its location on the face. The table on the same sheet gives the code, description, floor and plan distance to the nearest corridor door.

- ◯ Repair
- ● 15′-0″ or less from an exit
- ◌ Between 15′-0″ and 20′-0″ from an exit

NV5 drawing codes

B	Beam crack	**OH**	Overhead
B/E	Beam edge	**RS**	Rust spot
BL	Block crack	**FL**	Balcony floor (waterproofing)
BR	Cracked brick	**C**	Code not in NV5 legend
ST	Stucco	**CC**	Corner cracked
W	Wall	**Hatch**	Unlabeled spalling hatch
E	Edge		

To verify

- Building 400: NV5 sheet 2/4 labels the west-end units as 301 and 317.
- Buildings 300 and 400: sheets 4/4 have identical marks; Building 200 repeats the same ST.
- Building 400: waterproofing note at ground-floor balcony 409.
- Stairs: no drawing shows them.

Sheet index

E-000	Cover and index
E-101	Building 100 · elevations 1 West and 3 East
E-102	Building 100 · elevations 2 South and 4 North
E-201	Building 200 · elevations 2 South and 4 North
E-202	Building 200 · elevations 1 West and 3 East
E-301	Building 300 · elevations 1 West and 3 East
E-302	Building 300 · elevations 2 South and 4 North
E-401	Building 400 · elevations 2 South and 4 North
E-402	Building 400 · elevations 1 West and 3 East
E-501	Clubhouse · elevations 2 South and 4 North

MTD Painting & Construction Corp.
CGC 1534015
PH: 833-350-9300
info@MTDcgc.com
12296 Wiles Rd, Coral Springs, FL 33076
10600 Chevrolet Way, Suite 220,
Estero, FL 33928

Project
Barcelona Gardens Condominium
101 E McNab Rd,
Pompano Beach, FL 33060

Sheet title
Cover and index
Typical elevations by building
Concrete and stucco repairs per NV5

Legend
- ◯ Repair
- ● 15′-0″ or less from an exit
- ◌ Between 15′-0″ and 20′-0″ from an exit

Notes
1. Plan geometry measured from NV5 CAD drawings (3/16″ = 1′-0″).
2. Repair locations per NV5 drawings.
3. Floor-to-floor, eave and roof heights estimated from site photos; the height of each repair is approximate.
4. Distances to exit measured in plan from the corridor door.
5. Scales valid on a 36×24″ sheet; at any other size use the graphic scale.
6. Reference document for coordination. Does not replace the signed NV5 drawings.


MTD Job No.
2025-016-12

Date
11/11/2026

Scale
As noted


Basis
NV5 drawings

Sheet
E-000

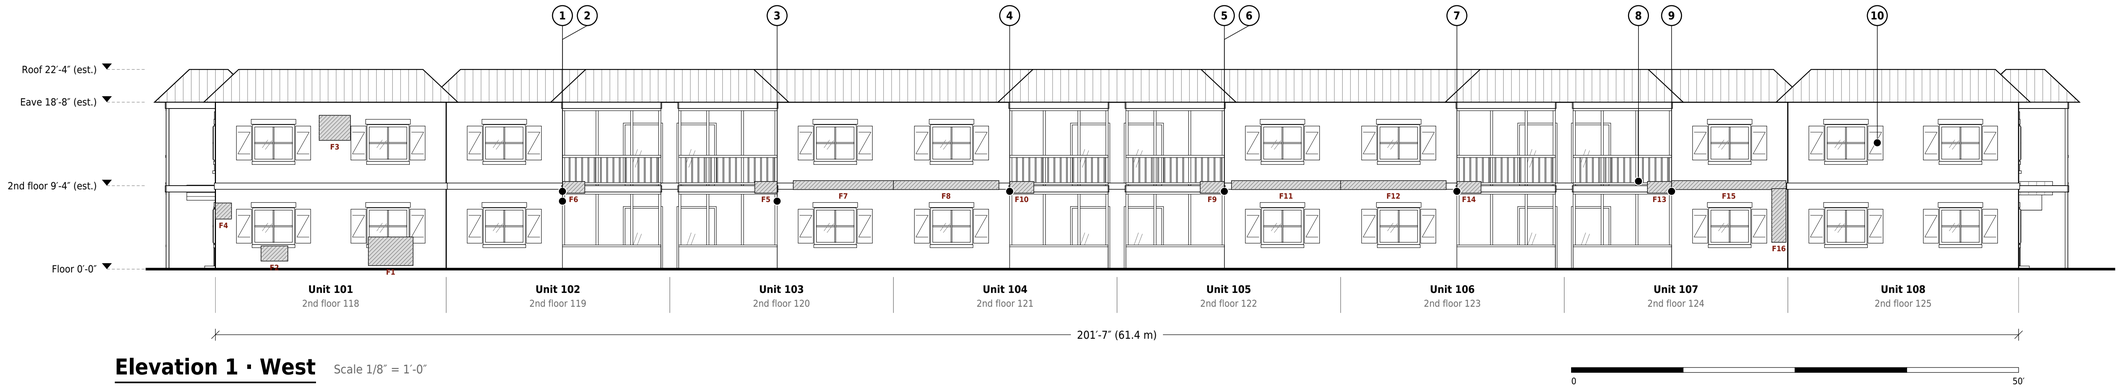

Elevation 1 · West

Scale 1/8″ = 1′-0″

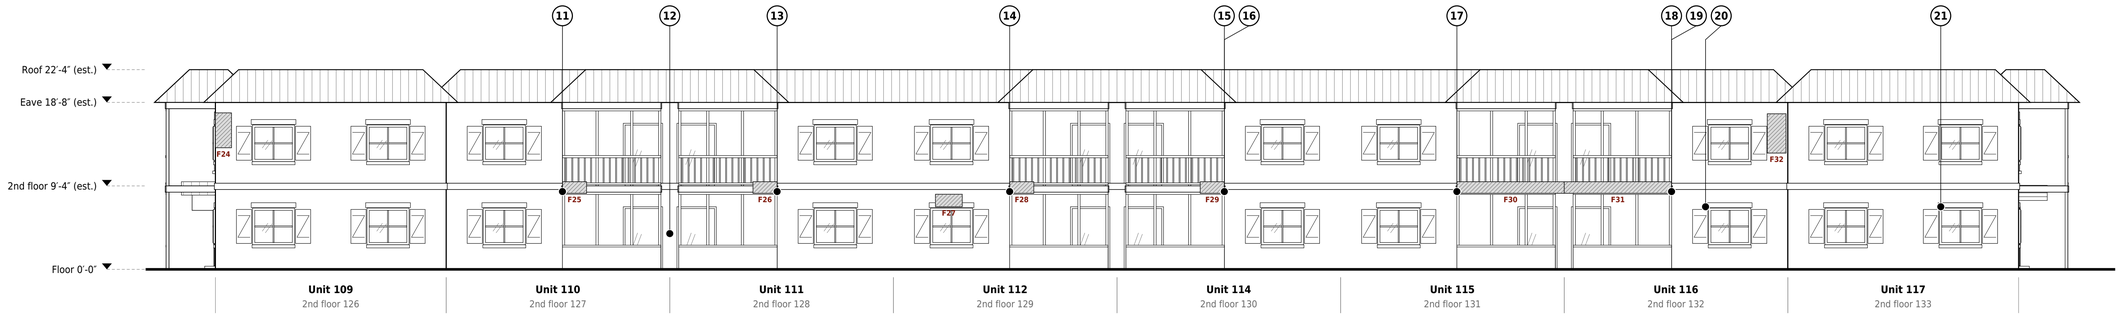

Elevation 3 · East

Scale 1/8″ = 1′-0″

Repairs on this sheet

No.	Code	Location and description	Floor	To exit
1	**B**	Beam crack. Right column, balconies 103/102	Ground	54′-10″
2	**RS**	Rust, balcony 102	Ground	51′-0″
3	**RS**	Rust, balcony 103	Ground	71′-11″
4	**B**	Beam crack. Right column, balconies 105/104	Ground	96′-10″
5	**B**	Beam crack. Left column, balconies 105/104	Ground	96′-10″
6	**E**	Edge. Side edge, balcony 105	Ground	95′-5″
7	**B**	Beam crack. Right column, balconies 107/106	Ground	73′-9″
8	**FL**	Balcony 124 floor, waterproofing required	2nd	55′-2″
9	**B**	Beam crack. Left column, balconies 107/106	Ground	54′-10″
10	**ST**	Stucco, corner of unit 125	2nd	41′-10″
11	**B**	Beam crack. Left column, balconies 110/111	Ground	55′-5″
12	**BL**	Block crack between balconies 110/111	Ground	64′-5″
13	**B/E**	Beam edge, balcony 111	Ground	71′-11″
14	**B/E**	Beam edge, balcony 112	Ground	95′-5″
15	**B/E**	Beam edge, balcony 114	Ground	95′-5″
16	**B**	Beam crack. Right column, balconies 112/114	Ground	97′-3″
17	**B**	Beam crack. Left column, balconies 115/116	Ground	74′-3″
18	**B**	Beam crack. Right column, balconies 115/116	Ground	55′-5″
19	**B/E**	Beam edge, balcony 116	Ground	52′-9″
20	**BR/ST**	Cracked brick and stucco, wall of unit 116	Ground	47′-3″
21	**BR**	Cracked brick, wall of unit 117	Ground	40′-7″

Field repairs seen in photos · CompanyCam Nov 11, 2026

Hatched areas on the elevations. Locations read from photos, approximate.

No.	Location	Description	Photos
F1	Un 101	Gray stucco patch below the south ground-floor window, west wall of unit 101	4, 6
F2	Un 101	Small stucco patch below the north ground-floor window, west wall of unit 101	4, 6
F3	Un 118	Stucco patch between the 2nd-floor windows above unit 101 (unit 118)	5, 6
F4	Un 101	Patch at the northwest corner next to the red alarm box	3
F5	Un 103	Slab-edge patch at the left column of balconies 103/102 (west)	8
F6	Un 102	Slab-edge patch at the right column of balconies 103/102 (west)	8
F7	Un 103	Patched slab band between floors, recess at unit 103	9
F8	Un 104	Patched slab band between floors, recess at unit 104	9
F9	Un 105	Slab-edge patch at the left column of balconies 105/104 (west)	10
F10	Un 104	Slab-edge patch at the right column of balconies 105/104 (west)	10
F11	Un 105	Patched slab band between floors, recess at unit 105	11
F12	Un 106	Patched slab band between floors, recess at unit 106	11
F13	Un 107	Slab-edge patch at the left column of balconies 107/106 (west)	12, 14, 15
F14	Un 106	Slab-edge patch at the right column of balconies 107/106 (west)	12, 14, 15
F15	Un 107	Patched slab band between floors, recess at unit 107	13
F16	Un 107	Vertical stucco patch at the inside corner next to unit 108	16
F24	Un 126	Stucco patch at the southeast corner, 2nd floor (unit 126), next to the BLDG 100 sign	26, 27
F25	Un 110	Slab-edge patch at the left column of balconies 110/111 (east)	30, 31
F26	Un 111	Slab-edge patch at the right column of balconies 110/111 (east)	30, 31
F27	Un 112	Stucco patch above the ground-floor window arch, unit 112	32
F28	Un 112	Slab-edge patch at the left column of balconies 112/114 (east)	34, 35, 36
F29	Un 114	Slab-edge patch at the right column of balconies 112/114 (east)	34, 35, 36
F30	Un 115	Slab-edge repairs with primer along balcony 115 (east)	42, 43, 44
F31	Un 116	Slab-edge repairs with primer along balcony 116 (east)	42, 43, 44
F32	Un 132	Stucco patch at the inside corner next to unit 117, 2nd floor (unit 132)	48

MTD Painting & Construction Corp.
CGC 1534015
PH: 833-350-9300
info@MTDcgc.com
12296 Wiles Rd, Coral Springs, FL 33076
10600 Chevrolet Way, Suite 220,
Estero, FL 33928

Project

Barcelona Gardens Condominium


101 E McNab Rd,
Pompano Beach, FL 33060

Sheet title

Building 100 · Elevations 1 West and 3 East

Phase 1 · long faces

Key plan

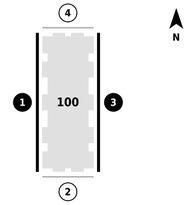

Legend

- Repair
- 15′-0″ or less from an exit
- Between 15′-0″ and 20′-0″ from an exit
- Field repair seen in photos (F#)

Notes

1. Plan geometry measured from NV5 CAD drawings (3/16″ = 1′-0″).
2. Repair locations per NV5 drawings BP25-00004816.
3. Floor-to-floor, eave and roof heights estimated from site photos; the height of each repair is approximate.
4. Distances to exit measured in plan from the corridor door.
5. Scales valid on a 36×24″ sheet; at any other size use the graphic scale.
6. Reference document for coordination. Does not replace the signed NV5 drawings.

MTD Job No.
2025-016-12

Date
11/11/2026

Scale
1/8″ = 1′-0″

Basis
NV5 BP25-00004816

Sheet

E-101



Elevation 2 · South

Scale 1/4″ = 1′-0″



Elevation 4 · North

Scale 1/4″ = 1′-0″

Repairs on this sheet

No.	Code	Location and description	Floor	To exit
22	**B**	Beam crack. Corner of balcony 108	Ground	23′-11″
23	**ST/W**	Stucco at end wall of unit 117	Ground	27′-10″
24	**B**	Beam crack. Corner of balcony 117	Ground	24′-10″
25	**E/OH**	Overhead edge, balcony 117	Ground	15′-0″
26	**B**	Beam crack. Corner of balcony 101	Ground	23′-11″

Field repairs seen in photos · CompanyCam Nov 11, 2026

Hatched areas on the elevations. Locations read from photos, approximate.

No.	Location	Description	Photos
F17	Un 108	Stucco patches along the southwest corner, both floors (units 108/125)	17, 18
F18	Un 108	Stucco patch on the south wall of unit 108, between floors	17
F19	Un 108	Stucco patch next to balcony 108 at slab level	19
F20	Un 108	Slab-edge repairs along the front of end balcony 108	19
F21	Un 108	Stucco patch beside the south entrance canopy (exit discharge)	20, 21
F22	Un 109	Vertical stucco patch between the south entrance and porch 109 (exit discharge)	23
F23	Un 109	Slab-edge repairs along the front of end balcony 109	24, 25
F33	Un 101	Slab-edge patches along the front and corner of end balcony 101 (north)	1, 2

MTD Painting & Construction Corp.
CGC 1534015
PH: 833-350-9300
info@MTDcgc.com
12296 Wiles Rd, Coral Springs, FL 33076
10600 Chevrolet Way, Suite 220,
Estero, FL 33928

Project

Barcelona Gardens Condominium


101 E McNab Rd,
Pompano Beach, FL 33060

Sheet title

Building 100 · Elevations 2 South and 4 North

Phase 1 · end faces

Key plan

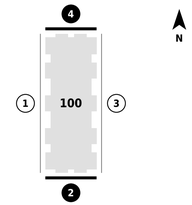

Legend

- Repair
- 15′-0″ or less from an exit
- Between 15′-0″ and 20′-0″ from an exit
- Field repair seen in photos (F#)

Notes

1. Plan geometry measured from NV5 CAD drawings (3/16″ = 1′-0″).
2. Repair locations per NV5 drawings BP25-00004816.
3. Floor-to-floor, eave and roof heights estimated from site photos; the height of each repair is approximate.
4. Distances to exit measured in plan from the corridor door.
5. Scales valid on a 36×24″ sheet; at any other size use the graphic scale.
6. Reference document for coordination. Does not replace the signed NV5 drawings.

MTD Job No.
2025-016-12


Date
11/11/2026

Scale
1/4″ = 1′-0″

Basis
NV5 BP25-00004816

Sheet

E-102

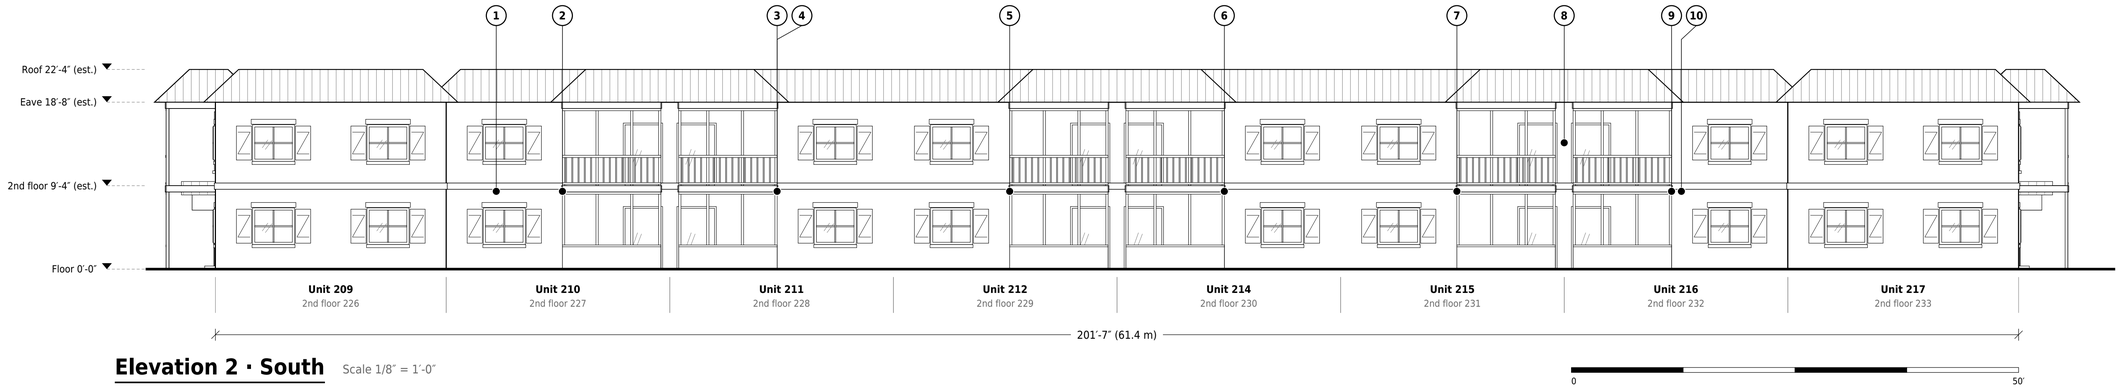

Elevation 2 · South

Scale 1/8″ = 1′-0″



Elevation 4 · North

Scale 1/8″ = 1′-0″

Repairs on this sheet


No.	Code	Location and description	Floor	To exit
1	B/E	Beam edge, wall of unit 210	Ground	44′-8″
2	B	Beam crack. Left column, balconies 210/211	Ground	55′-5″
3	B	Beam crack. Right column, balconies 210/211	Ground	74′-3″
4	B/E	Beam edge, balcony 211	Ground	71′-11″
5	B	Beam crack. Left column, balconies 212/214	Ground	97′-3″
6	B	Beam crack. Right column, balconies 212/214	Ground	97′-3″
7	B	Beam crack. Left column, balconies 215/216	Ground	74′-3″
8	ST	Stucco, column between balconies 231/232	2nd	64′-5″
9	B	Beam crack. Right column, balconies 215/216	Ground	55′-5″
10	B/E	Beam edge, balcony 216	Ground	50′-2″
11	B	Beam crack. Left column, balconies 203/202	Ground	73′-9″
12	B	Beam crack. Right column, balconies 205/204	Ground	96′-10″
13	ST	Stucco, center column of balconies 205/204	Ground	108′-0″
14	B	Beam crack. Right column, balconies 207/206	Ground	73′-9″
15	B	Beam crack. Left column, balconies 207/206	Ground	54′-10″

MTD Painting & Construction Corp.
CGC 1534015
PH: 833-350-9300
info@MTDcgc.com
12296 Wiles Rd, Coral Springs, FL 33076
10600 Chevrolet Way, Suite 220,
Estero, FL 33928

Project
Barcelona Gardens Condominium
101 E McNab Rd,
Pompano Beach, FL 33060

Sheet title
Building 200 · Elevations 2 South and 4 North
Phase 2 · long faces

Key plan

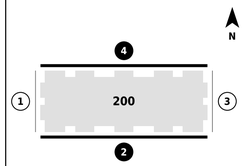

Legend
- Repair
- 15′-0″ or less from an exit
- Between 15′-0″ and 20′-0″ from an exit

Notes
1. Plan geometry measured from NV5 CAD drawings (3/16″ = 1′-0″).
2. Repair locations per NV5 drawings BP25-00004987.
3. Floor-to-floor, eave and roof heights estimated from site photos; the height of each repair is approximate.
4. Distances to exit measured in plan from the corridor door.
5. Scales valid on a 36×24″ sheet; at any other size use the graphic scale.
6. Reference document for coordination. Does not replace the signed NV5 drawings.

MTD Job No.
2025-016-12

Date
11/11/2026

Scale
1/8″ = 1′-0″

Basis
NV5 BP25-00004987

Sheet
E-201



Elevation 1 · West

Scale 1/4″ = 1′-0″



Elevation 3 · East

Scale 1/4″ = 1′-0″

Repairs on this sheet


No.	Code	Location and description	Floor	To exit
16	**B**	Beam crack. Corner of balcony 208	Ground	23′-11″
17	**ST**	Stucco, balcony 208 next to west exit	Ground	**7′-0″**
18	**B**	Beam crack. Corner of balcony 209	Ground	24′-10″
19	**B**	Beam crack. Corner of balcony 217	Ground	24′-10″
20	**B**	Beam crack. Beam at wall of unit 217	Ground	23′-4″
21	**RS**	Rust, balcony 217	Ground	**10′-1″**
22	**RS**	Rust, balcony 217 next to east exit	Ground	**8′-7″**
23	**B**	Beam crack. Corner of balcony 201	Ground	23′-11″
24	**ST**	Stucco, end wall next to balcony 201	Ground	23′-5″

MTD Painting & Construction Corp.
CGC 1534015
PH: 833-350-9300
info@MTDcgc.com
12296 Wiles Rd, Coral Springs, FL 33076
10600 Chevrolet Way, Suite 220,
Estero, FL 33928

Project
Barcelona Gardens Condominium
101 E McNab Rd,
Pompano Beach, FL 33060

Sheet title
Building 200 · Elevations 1 West and 3 East
Phase 2 · end faces

Key plan

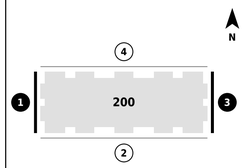

Legend
- Repair
- 15′-0″ or less from an exit
- Between 15′-0″ and 20′-0″ from an exit

Notes
1. Plan geometry measured from NV5 CAD drawings (3/16″ = 1′-0″).
2. Repair locations per NV5 drawings BP25-00004987.
3. Floor-to-floor, eave and roof heights estimated from site photos; the height of each repair is approximate.
4. Distances to exit measured in plan from the corridor door.
5. Scales valid on a 36×24″ sheet; at any other size use the graphic scale.
6. Reference document for coordination. Does not replace the signed NV5 drawings.


MTD Job No.
2025-016-12

Date
11/11/2026

Scale
1/4″ = 1′-0″

Basis
NV5 BP25-00004987

Sheet
E-202

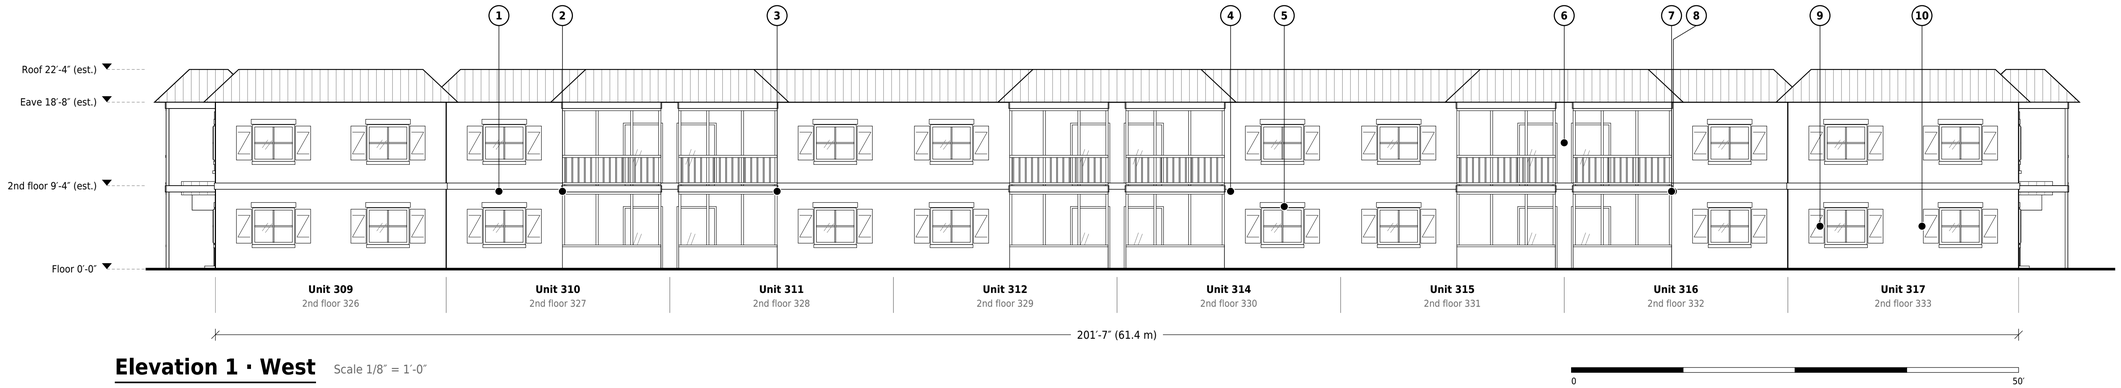

Elevation 1 · West

Scale 1/8″ = 1′-0″



Elevation 3 · East

Scale 1/8″ = 1′-0″

Repairs on this sheet


No.	Code	Location and description	Floor	To exit
1	B/E	Beam edge, wall of unit 310	Ground	44′-11″
2	B	Beam crack. Left column, balconies 310/311	Ground	55′-5″
3	B	Beam crack. Right column, balconies 310/311	Ground	74′-3″
4	B/E	Beam edge next to column of balconies 312/314	Ground	94′-3″
5	BR	Cracked brick veneer, wall of unit 315	Ground	88′-1″
6	ST	Stucco, column between balconies 331/332	2nd	64′-5″
7	B	Beam crack. Right column, balconies 315/316	Ground	55′-5″
8	B/E	Beam edge, balcony 316	Ground	51′-0″
9	ST	Stucco, wall of unit 317	Ground	45′-5″
10	ST	Stucco, wall of unit 317	Ground	41′-1″
11	B	Beam crack. Right column, balconies 303/302	Ground	54′-10″
12	ST	Stucco, center column of balconies 303/302	Ground	63′-10″
13	E	Edge, right column of balconies 305/304	Ground	96′-10″
14	B	Beam crack. Left column, balconies 305/304	Ground	96′-10″
15	B/E	Beam edge, balcony 306	Ground	71′-4″

MTD Painting & Construction Corp.
CGC 1534015
PH: 833-350-9300
info@MTDcgc.com
12296 Wiles Rd, Coral Springs, FL 33076
10600 Chevrolet Way, Suite 220,
Estero, FL 33928

Project
Barcelona Gardens Condominium
101 E McNab Rd,
Pompano Beach, FL 33060

Sheet title
Building 300 · Elevations 1 West and 3 East
Phase 3 · long faces

Key plan

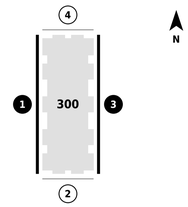

Legend
- Repair
- 15′-0″ or less from an exit
- Between 15′-0″ and 20′-0″ from an exit

Notes
1. Plan geometry measured from NV5 CAD drawings (3/16″ = 1′-0″).
2. Repair locations per NV5 drawings BP25-00005001.
3. Floor-to-floor, eave and roof heights estimated from site photos; the height of each repair is approximate.
4. Distances to exit measured in plan from the corridor door.
5. Scales valid on a 36×24″ sheet; at any other size use the graphic scale.
6. Reference document for coordination. Does not replace the signed NV5 drawings.


MTD Job No.
2025-016-12

Date
11/11/2026

Scale
1/8″ = 1′-0″

Basis
NV5 BP25-00005001

Sheet
E-301

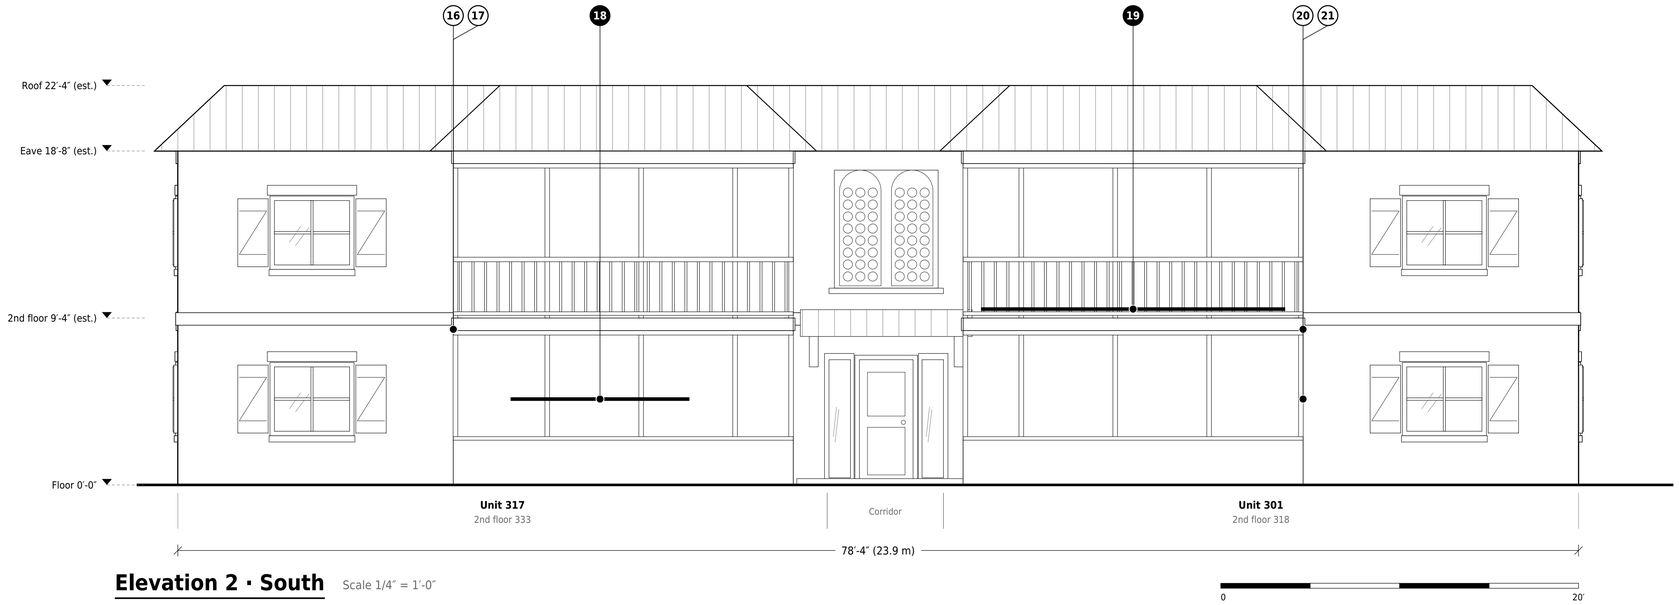

Elevation 2 · South

Scale 1/4″ = 1′-0″



Elevation 4 · North

Scale 1/4″ = 1′-0″

Repairs on this sheet

No.	Code	Location and description	Floor	To exit
16	**B**	Beam crack. Corner of balcony 317	Ground	24′-10″
17	**B/E**	Beam edge, balcony 317	Ground	24′-3″
18	**Hatch**	Unlabeled hatch at edge of balcony 317	Ground	**12′-4″**
19	**FL**	Balcony 318 floor, waterproofing required	2nd	**6′-0″**
20	**B**	Beam crack. Corner of balcony 301	Ground	23′-11″
21	**ST**	Stucco, end wall next to balcony 301	Ground	23′-4″
22	**C**	Code “C” (not in legend), balcony 308 next to north exit	Ground	**7′-0″**
23	**B/E**	Beam edge, corner of balcony 309	Ground	24′-10″

MTD Painting & Construction Corp.
CGC 1534015
PH: 833-350-9300
info@MTDcgc.com
12296 Wiles Rd, Coral Springs, FL 33076
10600 Chevrolet Way, Suite 220,
Estero, FL 33928

Project

Barcelona Gardens Condominium


101 E McNab Rd,
Pompano Beach, FL 33060

Sheet title

Building 300 · Elevations 2 South and 4 North

Phase 3 · end faces

Key plan

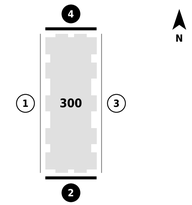

Legend

- Repair
- 15′-0″ or less from an exit
- Between 15′-0″ and 20′-0″ from an exit

Notes

1. Plan geometry measured from NV5 CAD drawings (3/16″ = 1′-0″).
2. Repair locations per NV5 drawings BP25-00005001.
3. Floor-to-floor, eave and roof heights estimated from site photos; the height of each repair is approximate.
4. Distances to exit measured in plan from the corridor door.
5. Scales valid on a 36×24″ sheet; at any other size use the graphic scale.
6. Reference document for coordination. Does not replace the signed NV5 drawings.

MTD Job No.
2025-016-12


Date
11/11/2026

Scale
1/4″ = 1′-0″

Basis
NV5 BP25-00005001

Sheet

E-302

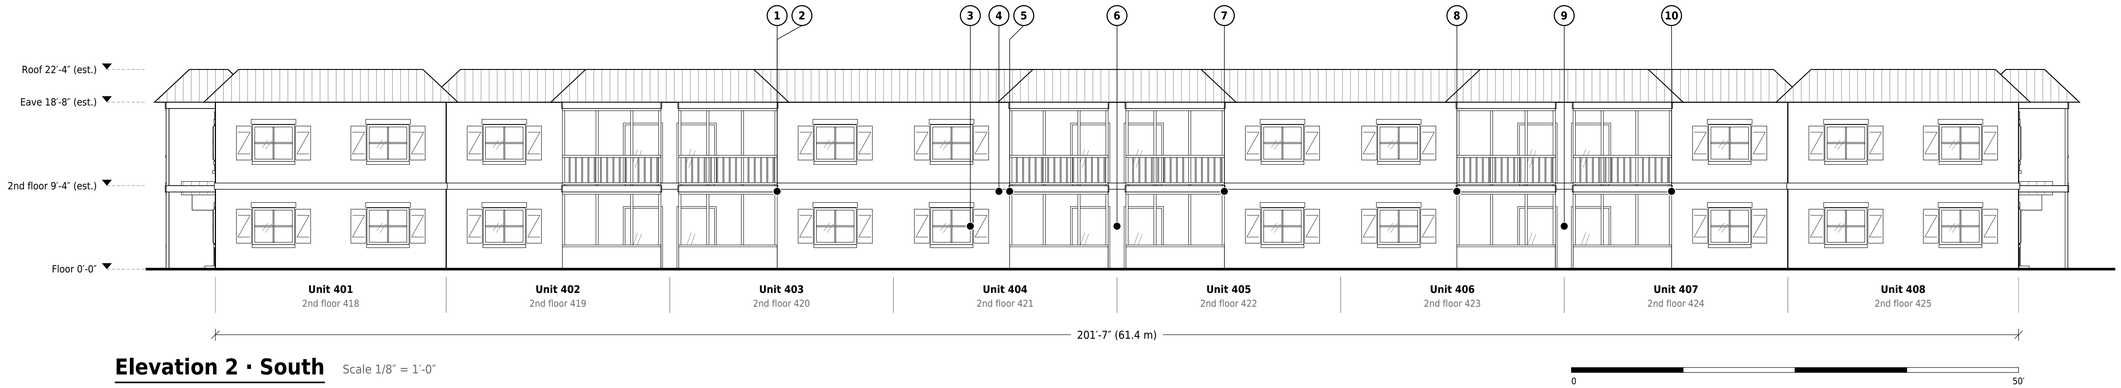

Elevation 2 · South

Scale 1/8″ = 1′-0″



Elevation 4 · North

Scale 1/8″ = 1′-0″

Repairs on this sheet


No.	Code	Location and description	Floor	To exit
1	B	Beam crack. Left column, balconies 403/402	Ground	73′-9″
2	B/E	Beam edge, balcony 403	Ground	70′-8″
3	ST	Stucco, wall of unit 403	Ground	89′-10″
4	B/E	Beam edge next to balcony 404	Ground	93′-6″
5	B	Beam crack. Right column, balconies 405/404	Ground	96′-10″
6	ST	Stucco, center column of balconies 405/404	Ground	108′-0″
7	B/E	Beam edge, balcony 405	Ground	94′-6″
8	B	Beam crack. Right column, balconies 407/406	Ground	73′-9″
9	ST	Stucco, center column of balconies 407/406	Ground	63′-10″
10	B	Beam crack. Left column, balconies 407/406	Ground	54′-10″
11	B	Beam crack. Left column, balconies 410/411	Ground	55′-5″
12	B	Beam crack. Right column, balconies 410/411	Ground	74′-3″
13	B/E	Beam edge, balcony 411	Ground	71′-4″
14	B	Beam crack. Left column, balconies 412/414	Ground	97′-3″
15	B/E	Beam edge, balcony 415	Ground	71′-3″
16	ST	Stucco, column between balconies 431/432	2nd	64′-5″
17	B	Beam crack. Right column, balconies 415/416	Ground	55′-5″

MTD Painting & Construction Corp.
CGC 1534015
PH: 833-350-9300
info@MTDcgc.com
12296 Wiles Rd, Coral Springs, FL 33076
10600 Chevrolet Way, Suite 220,
Estero, FL 33928

Project
Barcelona Gardens Condominium
101 E McNab Rd,
Pompano Beach, FL 33060

Sheet title
Building 400 · Elevations 2 South and 4 North
Phase 4 · long faces

Key plan

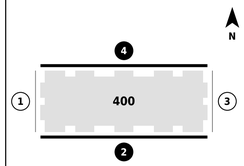

Legend
- Repair
- 15′-0″ or less from an exit
- Between 15′-0″ and 20′-0″ from an exit

Notes
1. Plan geometry measured from NV5 CAD drawings (3/16″ = 1′-0″).
2. Repair locations per NV5 drawings BP25-00004990.
3. Floor-to-floor, eave and roof heights estimated from site photos; the height of each repair is approximate.
4. Distances to exit measured in plan from the corridor door.
5. Scales valid on a 36×24″ sheet; at any other size use the graphic scale.
6. Reference document for coordination. Does not replace the signed NV5 drawings.

MTD Job No.
2025-016-12

Date
11/11/2026

Scale
1/8″ = 1′-0″

Basis
NV5 BP25-00004990

Sheet
E-401



Elevation 1 · West

Scale 1/4″ = 1′-0″

0 20′



Elevation 3 · East

Scale 1/4″ = 1′-0″

0 20′

Repairs on this sheet


No.	Code	Location and description	Floor	To exit
18	**B**	Beam crack. Corner of balcony 417 (labeled 317)	Ground	24′-10″
19	**Hatch**	Unlabeled hatch, wall of unit 417 (labeled 317)	Ground	17′-11″
20	**FL**	Balcony 418 floor, waterproofing required	2nd	**6′-0″**
21	**RS**	Rust, end wall of unit 401 (labeled 301 on plan)	Ground	23′-2″
22	**RS**	Rust, balcony 401 (labeled 301)	Ground	23′-5″
23	**B**	Beam crack. Corner of balcony 401 (labeled 301)	Ground	23′-11″
24	**B**	Beam crack. Corner of balcony 408	Ground	23′-11″
25	**B/E**	Beam edge, balcony 408	Ground	23′-7″
26	**FL***	Waterproofing note at ground-floor balcony 409 (no hatch)	Ground	**14′-7″**
27	**E**	Edge. Cracked edge, balcony 426	2nd	**12′-0″**
28	**E**	Edge, corner of balcony 426	2nd	24′-5″
29	**CC**	Cracked corner, balcony 409	Ground	24′-10″
30	**B/E**	Beam edge, balcony 409	Ground	24′-5″

MTD Painting & Construction Corp.
CGC 1534015
PH: 833-350-9300
info@MTDcgc.com
12296 Wiles Rd, Coral Springs, FL 33076
10600 Chevrolet Way, Suite 220,
Estero, FL 33928

Project
Barcelona Gardens Condominium
101 E McNab Rd,
Pompano Beach, FL 33060

Sheet title
Building 400 · Elevations 1 West and 3 East
Phase 4 · end faces

Key plan

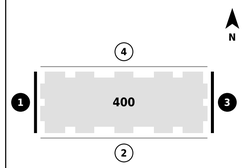

Legend
- Repair
- 15′-0″ or less from an exit
- Between 15′-0″ and 20′-0″ from an exit

Notes
1. Plan geometry measured from NV5 CAD drawings (3/16″ = 1′-0″).
2. Repair locations per NV5 drawings BP25-00004990.
3. Floor-to-floor, eave and roof heights estimated from site photos; the height of each repair is approximate.
4. Distances to exit measured in plan from the corridor door.
5. Scales valid on a 36×24″ sheet; at any other size use the graphic scale.
6. Reference document for coordination. Does not replace the signed NV5 drawings.

MTD Job No.
2025-016-12

Date
11/11/2026

Scale
1/4″ = 1′-0″

Basis
NV5 BP25-00004990


Sheet
E-402



Elevation 2 · South

Scale 1/4″ = 1′-0″

0 20′

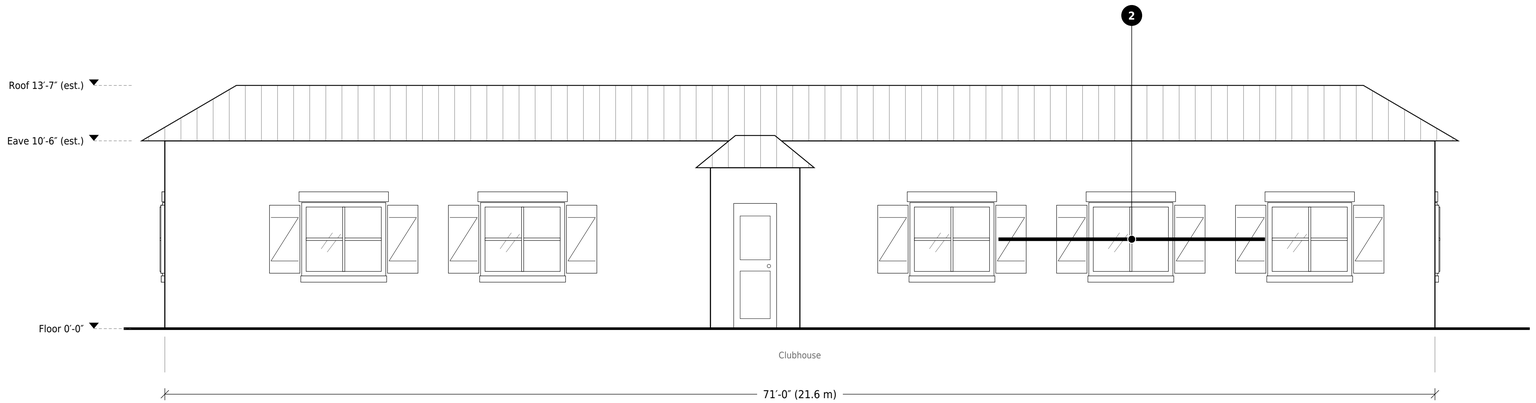

Elevation 4 · North

Scale 1/4″ = 1′-0″

0 20′

Repairs on this sheet

No.	Code	Location and description	Floor	To exit
1	ST	Stucco, clubhouse south wall	Ground	8′-4″
2	ST	Stucco, clubhouse north wall	Ground	13′-7″

MTD Painting & Construction Corp.
CGC 1534015
PH: 833-350-9300
info@MTDcgc.com
12296 Wiles Rd, Coral Springs, FL 33076
10600 Chevrolet Way, Suite 220,
Estero, FL 33928

Project

Barcelona Gardens Condominium


101 E McNab Rd,
Pompano Beach, FL 33060

Sheet title

Clubhouse · Elevations 2 South and 4 North

Phase 5 · faces with repairs
Dimensions from the aerial; the NV5 clubhouse drawing is not to scale. Entry location estimated.

Key plan

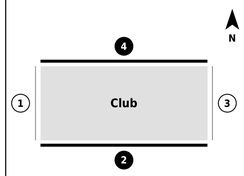

Legend

- Repair
- 15′-0″ or less from an exit
- Between 15′-0″ and 20′-0″ from an exit

Notes

1. Plan geometry measured from NV5 CAD drawings (3/16″ = 1′-0″).
2. Repair locations per NV5 drawings BP25-00004987.
3. Floor-to-floor, eave and roof heights estimated from site photos; the height of each repair is approximate.
4. Distances to exit measured in plan from the corridor door.
5. Scales valid on a 36×24″ sheet; at any other size use the graphic scale.
6. Reference document for coordination. Does not replace the signed NV5 drawings.

MTD Job No.
2025-016-12

Date
11/11/2026

Scale
1/4″ = 1′-0″

Basis
NV5 BP25-00004987

Sheet

E-501