

The rooms fit; some activities need their own space


Review against the consolidated daytime furniture and the concept 18 night arrangement

LAUNDRY	Open machine doors pass; an aisle basket blocks the route.
	Store baskets under the folding run; retain working floor.
SHOPPING	An open pantry drawer blocks the through-pantry route.
	Use the direct hall-to-kitchen route while drawers are open.
COOKING	An open dishwasher obstructs the sampled cooking route.
	Keep passing traffic on the courtyard side of the island.
SCHOOL MORNING	A person at the boot bench obstructs the original gym route.
	A gym-side bypass passes; test the family together at full scale.
MEAL FOR TEN	Adding end chairs blocks front and rear dining routes.
	Current table has eight chairs; two island places are separate.
BATH TIME	A helping adult occupies the tested bath approach.
	Sequence bathing / basin use; no multi-person bathroom fit claimed.
OVERNIGHT GUESTS	Two guest-bed places + two office places + one shared child bed.
	Office work pauses; far-side sofa-bed sleeper crosses the mattress.

Most important layout decision: is a single table seating ten a requirement, or is eight plus island seating acceptable?

Protect the laundry aisle and the route past the boot bench

Service-end plan 1:35 at A3 | Amber outlines are temporary objects / users, shown together for location only

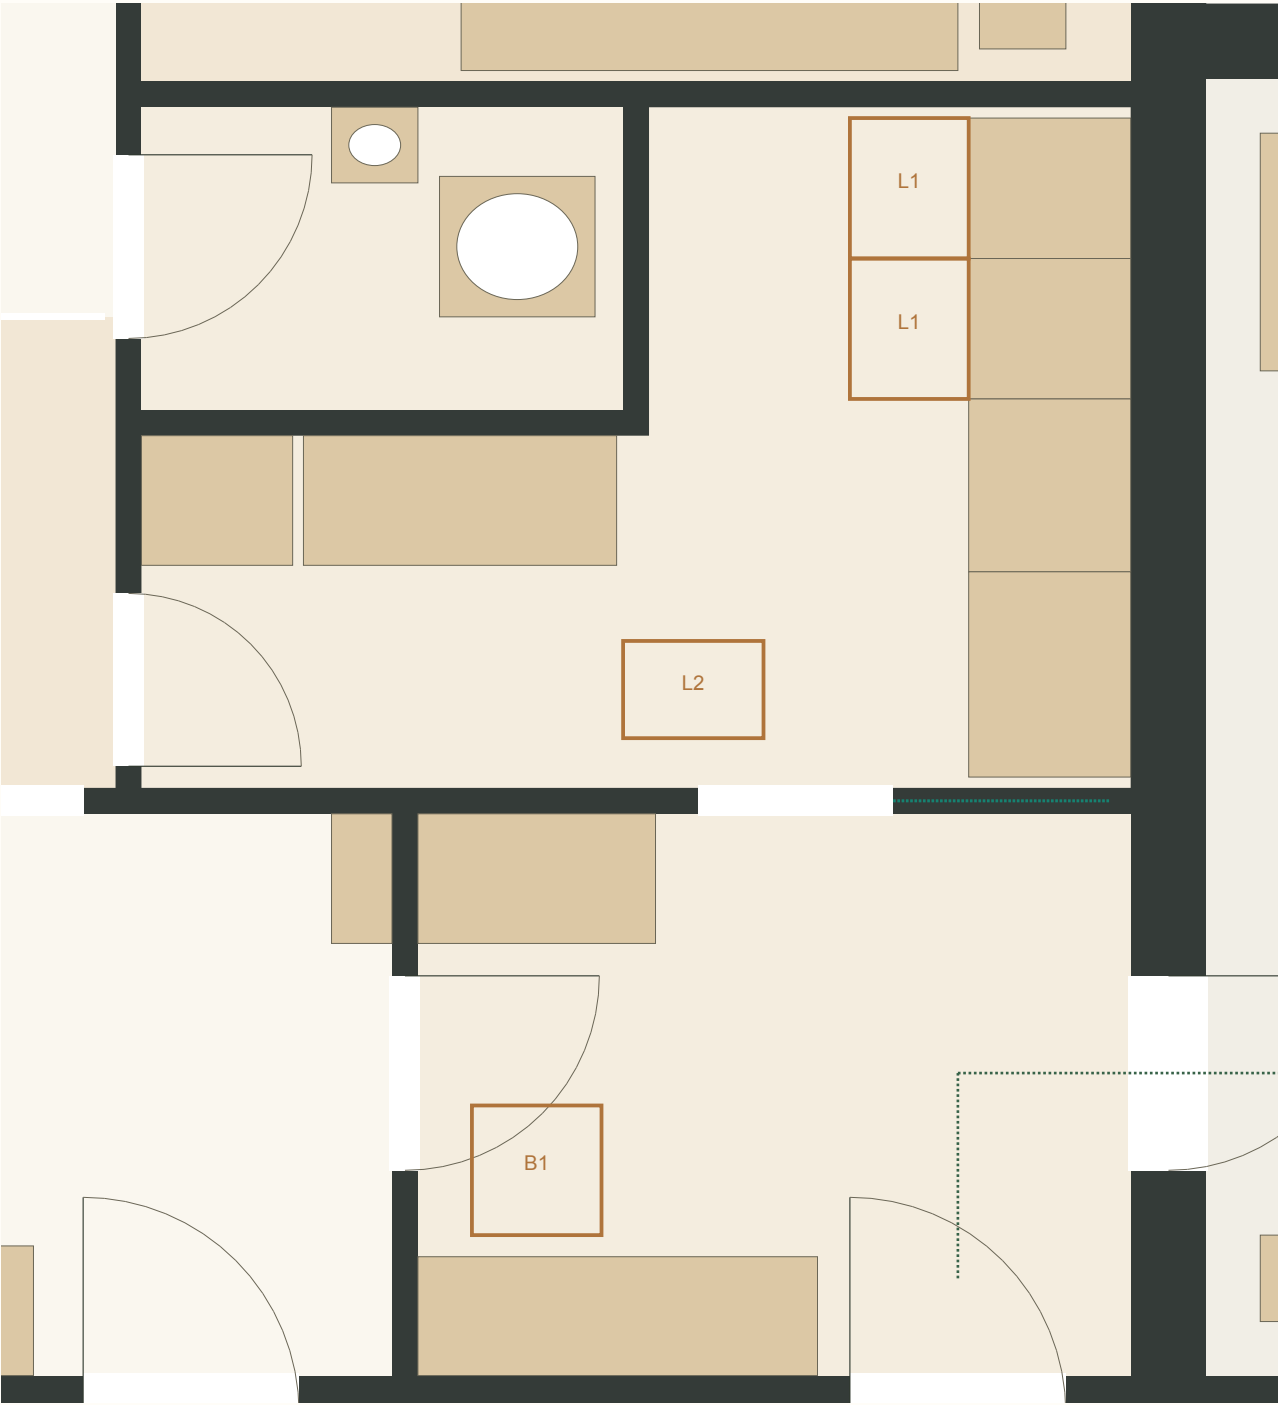

LAUNDRY

L1: each machine door projects 0.55 m into the aisle.
A 0.70 m sampled approach remains clear behind them.
L2: a 0.65 x 0.45 m basket obstructs the boot-to-laundry route.
L3: removing the basket restores the sampled route.
Basket storage under the counter is an operating proposal.

BOOT ROOM

B1: a 0.60 m-square seated-person / knee reservation.
The original route to the gym passes too close to it.
Green: the alternative via the gym side clears the reservation.
This is a single moving person, not five people getting ready.
Coats, school bags and opening cupboard fronts need a mock-up.

LIMITS OF THESE CHECKS


Existing joinery and gym equipment are retained.
Body and basket sizes are scenario inputs, not measured users.
The routes sample a 0.70 m-wide moving envelope.
Door timing, bending, lifting and simultaneous passing are not simulated.
A wider basket-carrying envelope needs separate testing.

DESIGN IMPLICATION

The full laundry remains valuable. Option A plant would take away the counter / storage that helps keep this floor clear.

Ten dining seats need a layout decision

Kitchen / dining plan 1:40 at A3 | Additional end chairs and open dishwasher shown as temporary conflict tests

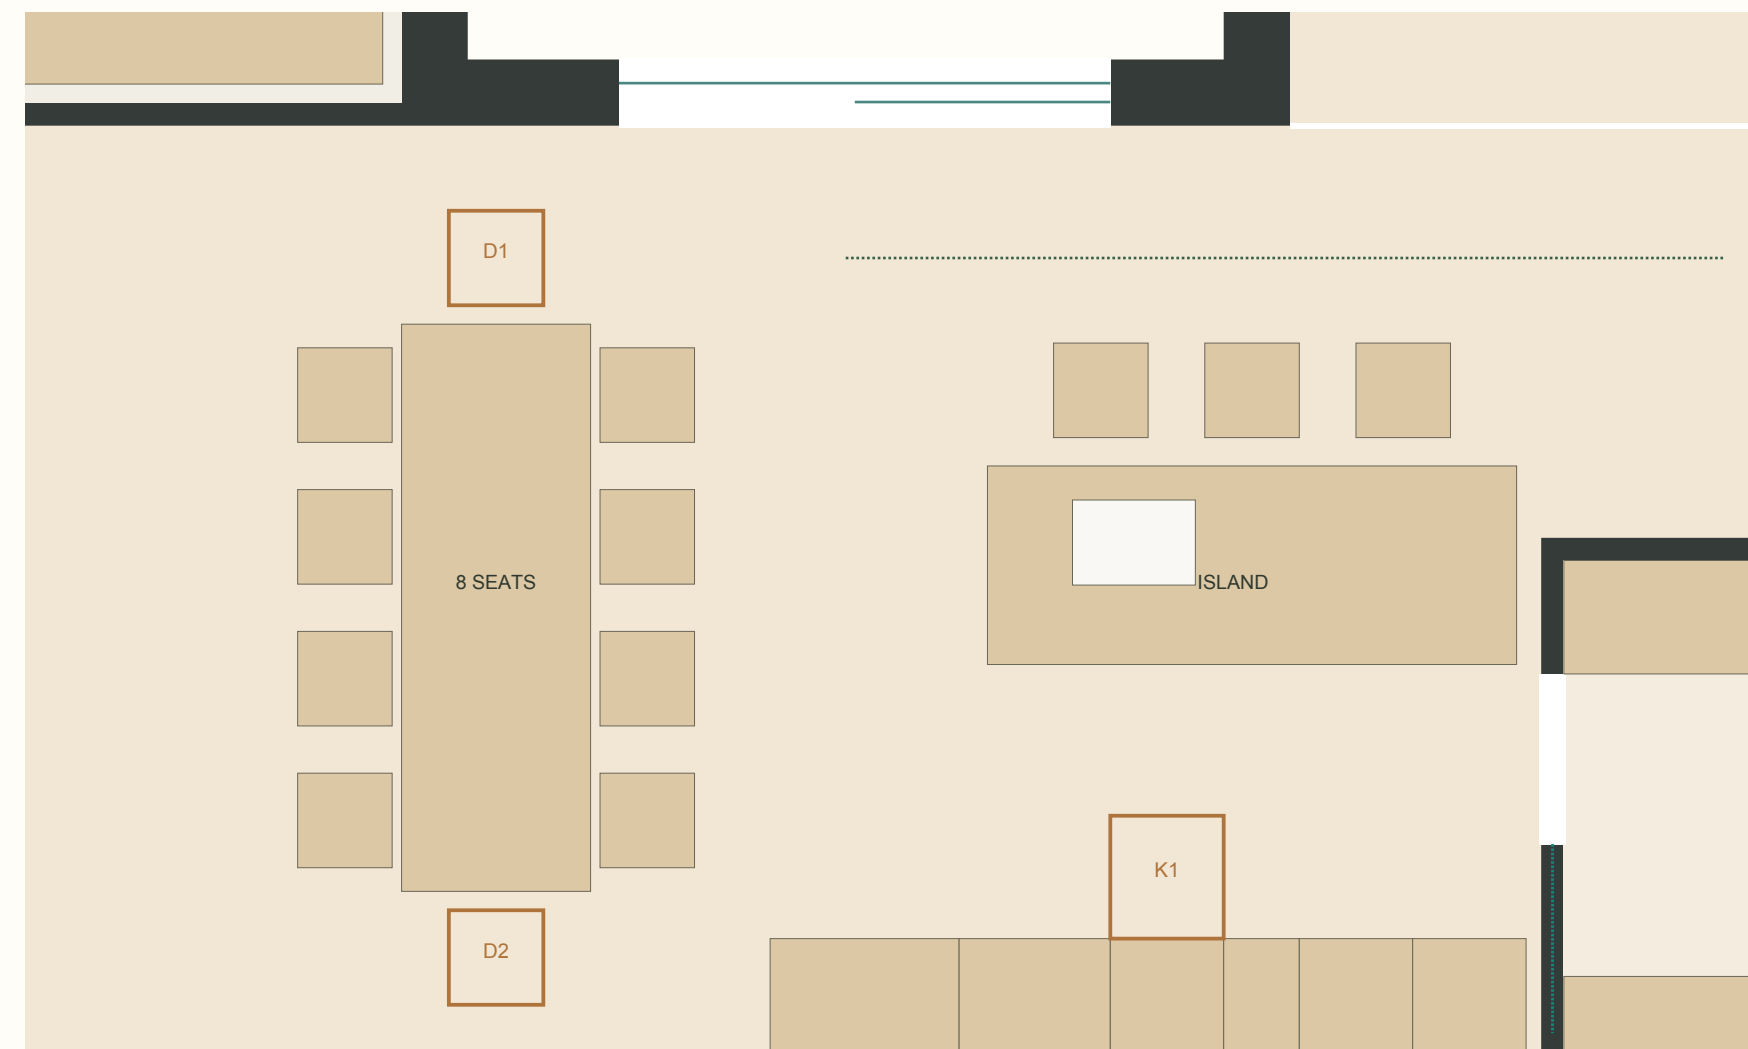

D1 / D2: END CHAIRS

Current dining arrangement has eight seats.
Two extra 0.50 m chairs obstruct front / rear cross-routes.
There is no verified ten-place table arrangement yet.
Eight at the table plus two at the island is possible
as separate seating, not ten dining together.

K1: DISHWASHER

0.65 m open-door projection tested.
The sampled cooking-aisle route is obstructed.
Green: courtyard-side passing route remains clear.
A person unloading adds another occupied area.
Selected appliance hinges and doors still need checking.

FOLLOW THROUGH INTO THE NEXT PLAN

Keep the eight-seat dining arrangement as the current proposal. Do not silently add ten seats to a furnished drawing.
If ten at one table matters, develop table position, chair pull-out and both circulation edges as one measured change.
Two simultaneous high-flow showers remain a services requirement; geometry checks do not prove pressure or hot-water capacity.
No new partitions or furniture changes are adopted by this review. The JSON preserves all 12 reproducible scenarios.