To: Fuel Quality Committee, Windrell Fuel Facilities Corporation
From: Natalie Daugherty, fuel quality manager, Pellacre Aviation Services
Date: 14 October 2026, 07:55
Subject: recalled batch J-26-1187, what is drained before fuelling resumes
References: QM-09 sections 3 and 4; Teverell Fuels notice RN-2026-031

J-26-1187 still stands in three hydrant sections and four refuellers; 86 uplifts took it

At the 05:30 suspension fuel from J-26-1187 stood in Pier B (the pipe under stands 27 and 28, closed since 15:00 yesterday), in the cargo apron beyond its first pit and in the remote stands, 6,600 L, 11,000 L and 3,600 L of the batch, and in refuellers RF-23, RF-24, T-31 and T-35. The farm header, the main, Pier A, the international apron and the maintenance base hold none of it. Each section and refueller below is drained before it fuels again (QM-09 3.2); everything else can resume once the committee approves.

The batch went where the pits drew it. The hydrant is always full, so fuel in a branch moves only when a pit beyond it draws: Pier A, Pier B's open stands and the international apron took the batch soon after the main turned over and had drawn it out again on Tank 1 before the suspension, but the cargo apron's uplifts after 16:38 were all at its first pit, the remote stands drew five times all Tuesday, and nothing has drawn under stands 27 and 28 since they closed. The maintenance base drew nothing on Tuesday and never took the batch. One line fill through the pump station's meter, which is when the 09:40 and 18:36 product change checks at P-A01 were taken, turns over the main and the busy piers, not these branches; the densities in the agents' shift-start and idle-pit checks agree with this tracing at every pit and time they were taken.

Hydrant sections to drain

Section	Segments holding the batch	Batch litres standing	Drain point
Pier B	HB-06, HB-07	6,600	LPD-B, section valve SV-B shut
Cargo apron	HE-01, HE-02, HE-03	11,000	LPD-E, section valve SV-E shut
Remote stands	HF-01, HF-02	3,600	LPD-F, section valve SV-F shut

Source: hydrant network register (segment lengths and bores); both agents' tickets, 12 to 14 October; the low point drain and idle-pit flush records. Nearest 100 L.

Refuellers to drain

Refueller	Agent	Where it is	Batch litres held
RF-23	Corbel Into-Plane Services	Corbel workshop (hose reel), since 13:06 yesterday	3,070
RF-24	Corbel Into-Plane Services	Corbel, north apron	310
T-31	Northgarth Aviation Fuelling	Northgarth workshop bay 2 (axle bearing), since 11:52 yesterday	14,680
T-35	Northgarth Aviation Fuelling	Northgarth, coupled to tractor N-7 since 11:58 yesterday	2,340

Source: rack loading log; both agents' tickets; Corbel's equipment log (RF-23 pumped 3,843 L to RF-24 at 12:50 yesterday); Northgarth's vehicle log (couplings). Each tank taken as one mixed body of fuel from the weekly dip of 12 October. Nearest 10 L.


Aircraft operators to notify

86 uplifts delivered fuel from the batch: 73 through the hydrant and 13 from refuellers, each listed with its ticket, registration, flight, start in UTC, pit or refueller and litres in j26-1187_recall_uplifts.csv, which is also the recall return. The refuellers' share by airline:

Airline	Batch litres delivered by refuellers
Brightwing Airlines	4,130
Northcove Air	10,740
Orvelle Airways	240
Sablewood Air	7,550
Tallowmere Air	3,020
Vireo Airlines	330

Nearest 10 L, from the unrounded litres of each uplift.

Where J-26-1187 stood at the 05:30 suspension

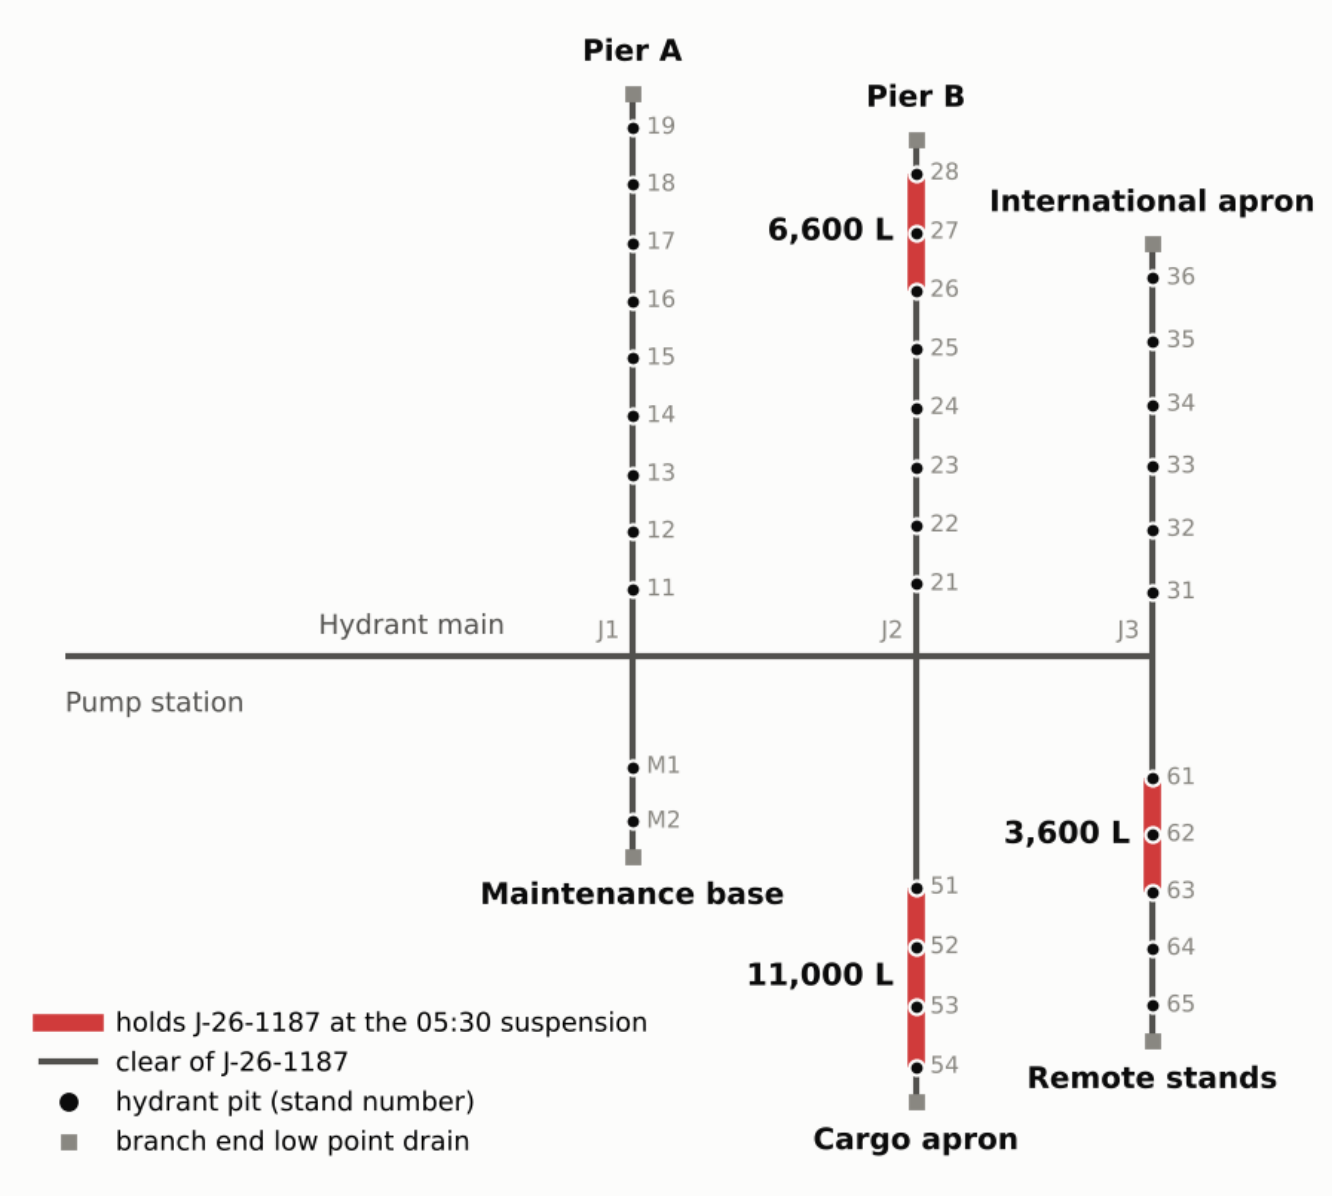

Schematic, not to scale. Litres of pipe at line temperature from the register; at 15 C each section rounds to the same 100 L.

N. Daugherty, fuel quality manager, Pellacre Aviation Services, for the Fuel Quality Committee meeting of 14 October 2026, 08:00.