Tamarack Prairie Co-operative Ltd., Petroleum Division

Work order TT-2027-01: Ituna regular and Canora regular to precision tightness testing

To	Precision tank and line testing contractor (standing offer TPC-SO-2025-14)
From	Leah Haynes, Controller, for Roy Turner, Petroleum Manager
Date	6 January 2027
Subject	PD-07 Rev. 3 quarterly review, October to December 2026: systems going for testing

Site	Tank system	Book shortfall, Q4 (litres)	Loss to the ground (L/h)	Test required
GB-131 Ituna	Tank 1, regular	2,974	1.2	Tank and lines, precision
GB-134 Canora	Tank 1, regular	2,255	0.9	Tank and lines, precision

Source: PD-07 quarterly book from gauge closes, bills of lading and point-of-sale exports to 5 January 2027; service work orders 2024 to 2026.


Both systems lost more than the PD-07 line of 0.75 litres an hour to the ground over the quarter. Please test the tank and its pressurised lines at each in January and send the results to the Controller's office. Both were reported to the province as suspected releases on 6 January 2027. Every other gas bar tank system was at or under the line and stays on monthly monitoring.

How the loss was worked out

Each system's book shortfall is its gauge close on 1 October, plus product received at the bill of lading's net volume on the business day of the drop, less point-of-sale volume, less the gauge close on 1 January. Part of every shortfall is product the dispenser meters handed out beyond what they registered: the co-op's meters drift that way with the litres they pass after a calibration. That part was taken out at the drift the 2024 to 2026 tank books show across the whole network, about 6.1 mL per 20 L draft for every 100,000 litres a meter passes, applied to each hose's litres since its last calibration or replacement in the work orders.[1] What is left, per hour of the quarter, is product lost to the ground.[2]

Ituna's 1987 single-wall steel tank loses product whatever it sells, which is what the cathodic protection survey's low readings would lead one to expect. Canora's regular loses product in step with its sales, so a reconciliation that books every sales-linked loss to the meters would clear it; its meters were calibrated on 2 July 2026 and have passed too few litres since to account for more than a small part of its shortfall. Its submersible pump was replaced on the same visit, and the contractor should start with the pump head and the line from it. Kamsack's regular and Foam Lake's diesel run larger shortfalls than either, and their meters' use since calibration accounts for them.

Every gas bar tank system against the line

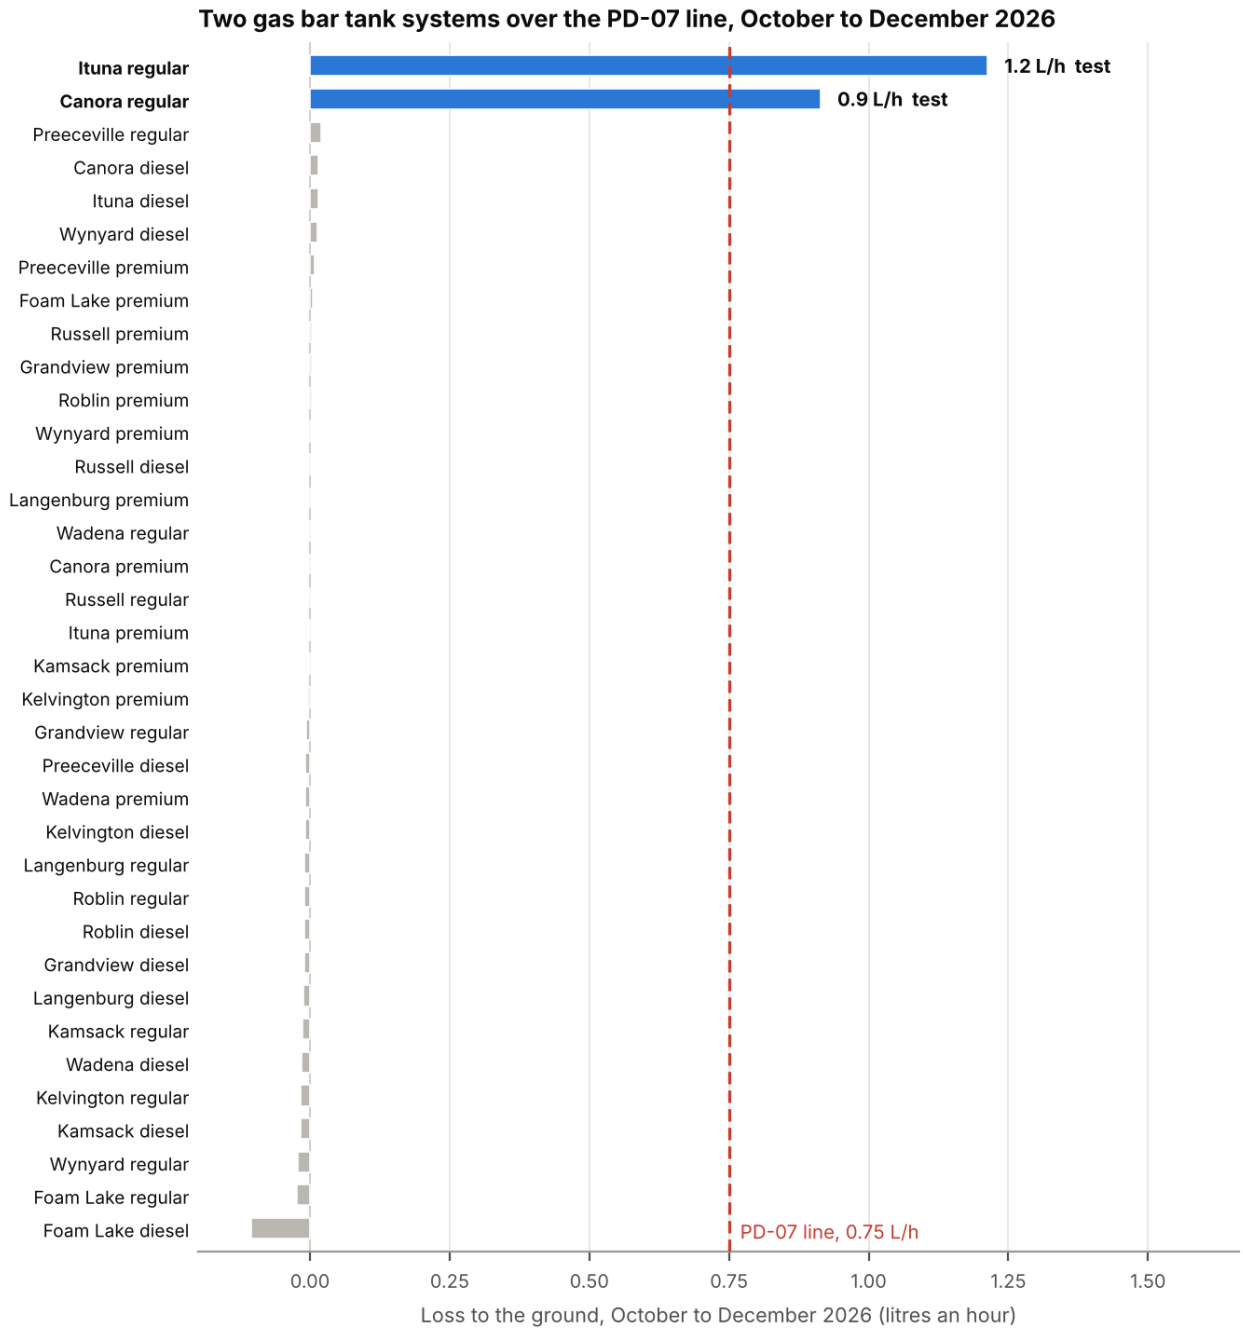

Bars in blue are the systems on this work order; the dashed line is the PD-07 line of 0.75 litres an hour.

1. Kamsack's diesel dispenser (5) was not calibrated at the April 2025 visit; its meters are counted from June 2024.

2. Hours elapsed in the quarter per PD-07 s.4: 2,208 in Saskatchewan and 2,209 at the Manitoba gas bars, whose clocks went back on 1 November.