
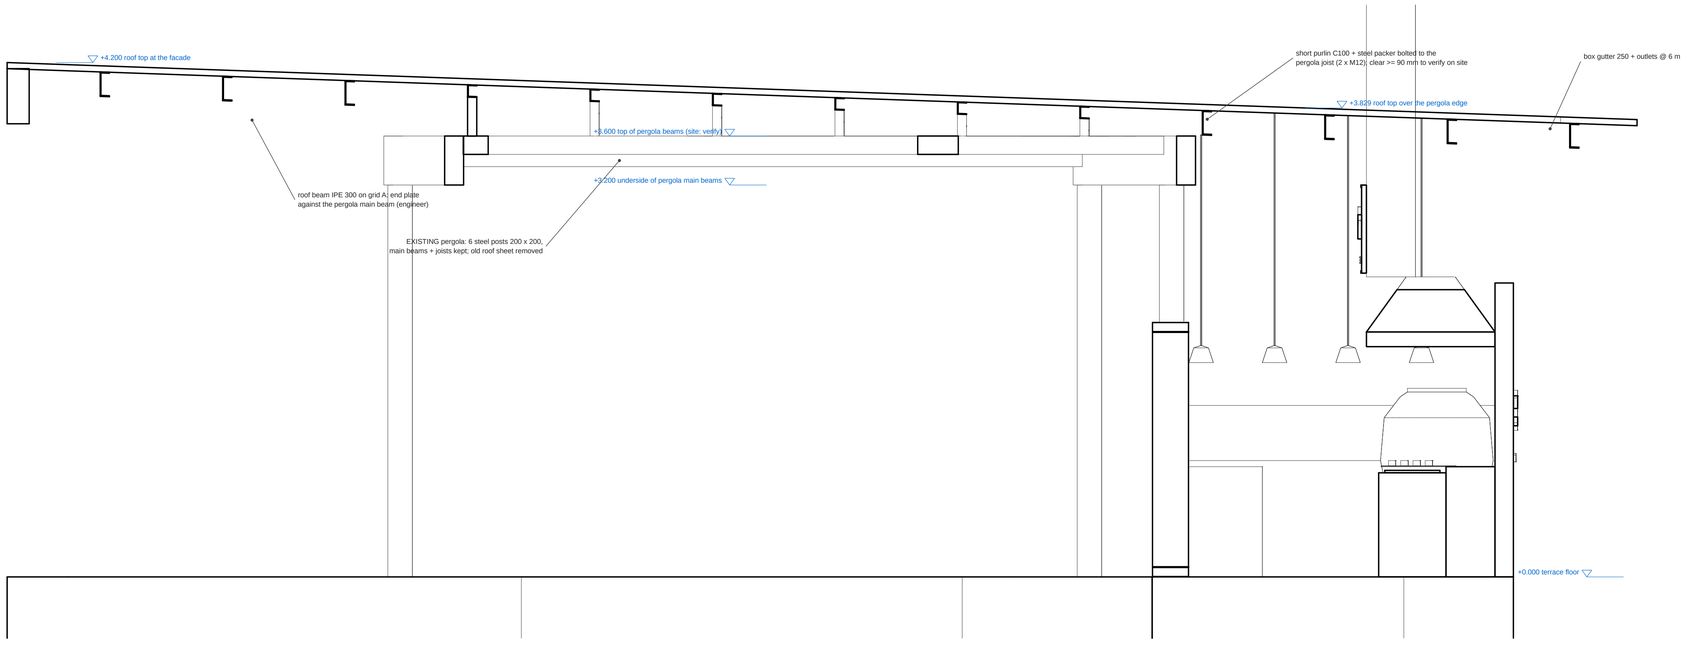


SECTION E-E THROUGH THE PERGOLA (building → street) 1:25

Klip-Lok sheet 3.5 %, short C100 purlins on packers over the pergola beams; grid-A beam ends on the pergola

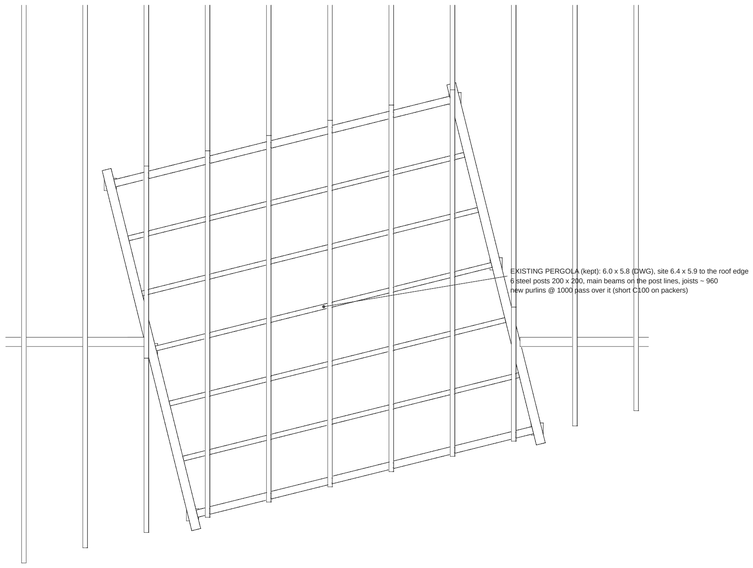

FRAMING PLAN OVER THE PERGOLA (roof sheet removed) 1:50

pergola posts / beams existing; new purlins @ 1000 run over it, beam A stops at the pergola

SEQUENCE

1. Survey: pergola post positions, beam sizes and levels; record the old roof drainage. Engineer checks posts + footings for the new roof load + typhoon uplift (if not enough: 2-3 new posts beside them, same cladding).
2. Remove the old pergola roof sheet only. Keep posts, main beams, joists.
3. Facade ledger, roof beams IPE 300, street columns. Grid-A beam ends with an end plate on the pergola main beams.
4. Purlins C200 @ 1000; over the pergola short C100 purlins on steel packers bolted to its joists (levels from the survey).
5. Insulation blanket 50 mm foil-faced on safety mesh, then Klip-Lok sheets roll-formed on site, one length facade -> gutter, clipped (clip spacing per engineer, closer at edges).
6. Gutter, downpipes, facade + side flashings. Inside: posts clad as Khiva columns, beams in carved walnut, ceiling panels between the joists.

WHY THIS ROOF

Sandwich panels need >= 4 deg (7 %) without joints; under the balcony slab (+3.85) only 2 deg fits over the pergola -> standing seam (min 2 deg, no screws through the sheet).
One roof plane, one gutter: no step and no valley at the pergola -> fewer joints that can leak in the monsoon.

SAMARKAND — Uzbek / Tajik restaurant terrace · 254 Vo Nguyen Giap, Da Nang

Existing pergola (kept) — new roof over it: section, framing plan, sequence

Drawn from the 3D model (closed-shell, QA-clean); dimensions in mm, levels in m from the finished terrace floor ±0.000

Sheet S-09 Rev R12-v8.3 2026-11-04 A1 Construction set — verify on site before fabrication