
| NIHVA TECHNOLOGIES PVT. LTD. | Vendors Inspection | | | Format No.: NIHVA-QA-F- 07 |
|---|---|---|---|---|
| | | | | Rev. No.: 00 |
| | | | | Rev. date: |
| | | | | Date of Origin: 01-01-2017 |
| Parameter | Specification | Observations | | |
| Min. HT | 300 mm | 303 | 297 | 293 |
| Cabin HT inner | 2100 mm | 2225 | | |
| Platform length Inner | 1200 mm | 1155 | | |
| Platform width Inner | 1200 mm | 1165 | | |
| Lift Height | 6000 mm | Unable to carried out due to unsufficient height | | |
| Max. Height | 6300 mm | Unable to carried out due to unsufficient height | | |
| Motor | 3 phase Siemens 3HP | | | Motor & Pump details |
| Pump Make | REXROTH | | | |
| Pump Discharge | 5.5 Liter per minute | | | |
| Hydraulic circuit details | Shown in Manual | | | |
| Valve details | Shown in Manual | | | |
| Presssure gauge | Found OK | | | |
| Tank capacity | 30 Ltr. | | | |
| Hydraulic oil used | Hydraulic -68 make- Lubritech | | | |
| Seal kit used | Shown in Manual | | | Cylinder details |
| Internal Leakage | Not found | | | |
| Cylinder total length | 3259 mm | | | |
| Hone tube OD | 88.9 mm | | | |
| Hone tube ID | 79 | | | |
| Plated Shaft | 60 mm | | | |
| Structure | Not fixed | | | |
| Load test(1.5 * Capicity) | Unable to carried out due to unsufficient height | | | |

| | |
|---|---|
| Remark : 1) Fill the welding shown at the time of visit.<br>2) Gaps observed at the cabin corners. Need to clear these Gaps.<br>3). NRV recommonded.<br>4) Unable to take final trial & Load test of the Goods Lift because of Height Unavailability.<br>5).Need Electrical Manual with proper Electrical Connection Diagram<br>6) Other details show in manual | Suggestions |



Strength of this assembly is very less

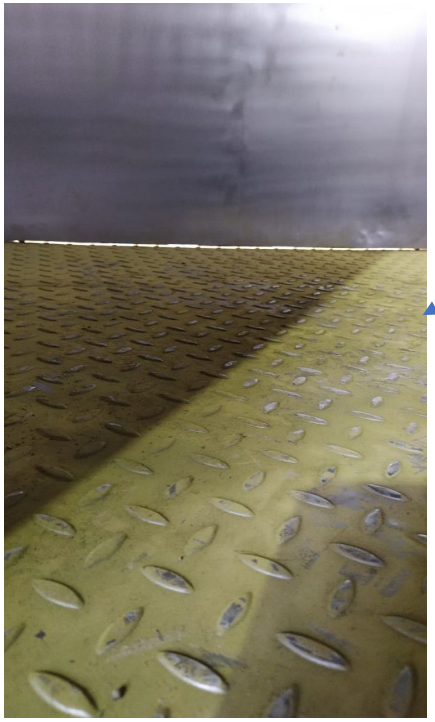

Gap observed between platform & Vertical Cabin



Outside light seen from inside









