STARZ ELECTRONICS

M201 — MEASURING ENCODER PLATE / R1

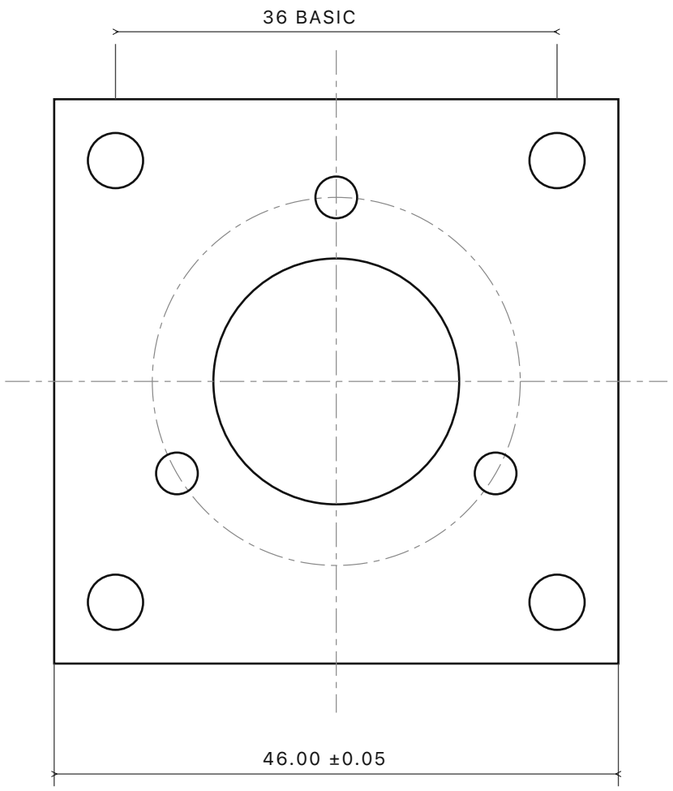

VIEW FROM COUPLING SIDE / 2:1

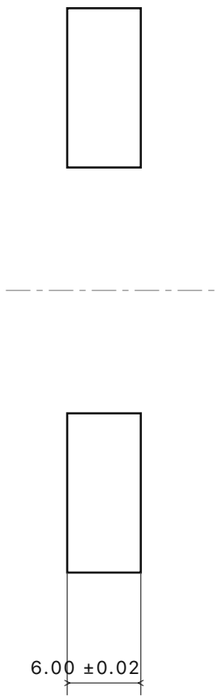

AXIAL SECTION / 2:1

3 × Ø3.40 +0.10/0 THRU;PCD30 BASIC;120° apart;one hole on+Z.

4 × Ø4.50 +0.10/0 THRU;36×36 BASIC square;future support attachment.

Central bore Ø20.040 +0.020/0 THRU;no shoulder against encoder pilot tip.

All hole positions Ø0.10 to A|B|C. Hole coordinates below are BASIC.

ENGINEERING DRAWING — RELEASE HOLD

Units mm · A3 · Do not scale dimensions

DATUM A: encoder mounting face Y0

DATUM B: central bore axis

DATUM C: left edge X−23 in this view

A flatness0.02;opposite face parallel0.02

B perpendicularity0.02 to A

B cylindricity0.01;pilot bore Ra0.8µm

Joint faces Ra1.6µm;other faces Ra3.2µm

Material EN AW-6082-T6;no coating on A/B

Stock50×50×8;quantity2;edgesC0.20±0.05

Encoder holes (X,Z),PCD30 BASIC:

(0,+15), (+12.990381,−7.5)

(−12.990381,−7.5)

3 ×ISO4762 M3×10,class8.8

3 ×ISO7092 M3,3.2×6×0.5,200HV

Nominal encoder thread engagement3.5

Nominal thread-bottom clearance1.5

Encoder pilot19.979−20.000 ×5 long

Diametral pilot clearance0.040−0.080

Encoder tip20 from A,not15

Final mounting torque/support still open

PROCESS: square stock;finish A/opposite face;finish pilot bore;drill3PCD holes and4support holes;deburr without dishing A.

INSPECT:46square;6thickness;pilot diameter/cylindricity;face flatness/parallelism;hole positions and clearance diameters.

ASSEMBLY: encoder body behind A;pilot passes freely;washers on coupling side. Do not use screws to pull a misaligned pilot in.

SCOPE: eight-part encoder face mount only. Pressure arm,shaft bearings,complete tool access and wire guides are not this drawing.

PART M201 · MEASURING ENCODER PLATE

S1-B-MEAS-R1-2026-09-12

SCALE2:1 / SINGLE SELECTED DIMENSION RECORD

SOURCE: Autonics E40 drawing;STARZ measurement_spec