



SABARMATI DIESELS, LOCO CARE CENTRE, SABARMATI
Mechanical
IA/IB/IC Schedule of 3Phase Electric Locomotive [Inspection]

लोको संख्या Loco No 32461 क्लास Class IB शिड्यूलमें लेने का दिनांक Date taken under Sch 26/6/24.

	आगमनIncoming / शिड्यूलSchedule		अंतिमनिरीक्षणFinal Inspection	
	अपर डैक Upper Deck	अंडर ट्रक Under Truck	अपर डैक Upper Deck	अंडर ट्रक Under Truck
Date/ Shift	26/6/24 8/11		30/6/24 16/11	
Name of Technician	DIPAK + DINESH		Manu + Bharat	
Designation/ Token No.	TECH II		Tec-I	
Signature				

Customer Feed Back/Bookings (Record feedback given by Loco pilot)

Sr. No.	Customer Feed Back/Bookings	Action Taken	Name of TCN / Attended By	Remarks, if any & Sign. of JE/SSE
①	MACHINE ROOM: 2 SILICA GEL PINK.		⑧	CAB: 2 LP SIDE WIPER WATER NOZZEL STUCK UP
②	CAB: 1 WATER RESERVOIR TANK LEAKAGE.		⑨	CAB: 2 ALP SIDE WIPER WATER PIPE LEAKAGE.
③	CP LOADING 8.0 TO 9.2		⑩	CAB: 2 AFZ LIGHT NOT GLOWING.
④	CAB: 1 FP A.C. COIL LEAKAGE	ATTENDED	⑪	BOTH CAB B.C. PR 3=8
⑤	CAB: 1 BP HOSE PIPE EXPIRED.		⑫	All road to check.
⑥	CAB: 1 FP HOSE PIPE BROKEN		⑬	AIR DRYER ONE HUMIDITY WHITE
⑦	CAB: 2 BP HOSE PIPE EXPIRED			

Inspection Wing Mechanical: Check and record Following

	CPA Loading Time (Pressure 0 to 8.0 kg/cm ²)	Safety Valve Blowing	Pantograph-1		Pantograph-2		Compressor Loading Time (Pressure 8 to 9.5 kg/cm ²)		CP Safety Valve Blowing	Unloaded valve
			Raising	Lowering	Raising	Lowering	Comp-1	Comp-2		
Std. Value	8.0 Minutes	8.5 ± 0.25 kg/cm ²	6 to 10 Second	Less than 15 Second	6 to 10 Second	Less than 15 Second	120 Second	120 Second	11.5 ± 0.35 kg/cm ²	Operation time. Approx. 12 Sec.
GI	N.A.	9.8	9.0	11. sec	8.0	12	89 SEC	91 SEC	> 11	6.8 SEC
Final		9.8	9.0	9 sec	8.0	11	65 sec	70 sec	> 11	6.5 sec

Std. Value	MR safety Valve pressure		Duplex check valve setting/Brake Pipe Pressure by Auto Brake (A9)		Feed Pipe Pressure		Brake Cylinder Pressure by Direct Brake (SA9)		Horn Sound			
	Blowing	Closing							Std. - Good			
	10.5 ± 0.2 kg/cm ²	9.5 - 9.8 kg/cm ²	5.0 ± 0.1 kg/cm ²		6.0 ± 0.2 kg/cm ²		3.5 ± 0.1 kg/cm ²		Cab-1		Cab-2	
GI	10.6	9.5	5.0	5.0	6.0	6.0	3.8	3.8	W	W	G	G
Final	10.7	9.6	5.0	5.0	6.0	6.0	3.8	3.8	W	W	G	G

Std. Val.	Computerized Control Brake (CCB) System if applicable		Air Flow	Air Dryer		ADC	MRC Time By both CP 0-10kg/cm ²
	Alerter and Penalty		Working	Working, Tower to change every minute (FILL, SH) & In every two minutes (KBIL.)	Humidity Indicator Colour Std-Blue	Working	3.5 Minutes (Max.) For 1750 LPM or [8.5 Minute for each 1450 LPM CP]
GI	Passed successfully	Working	WORKING	TRIDENT WORKING	BLUE	WORKING	3 MIN 13 SEC.
Final	E70 BRAKE SYSTEM					WORKING	3 MIN 10 SEC.

* Both CCB close to 2 min 55 sec on station

* C.P - 1 - 5 min 50 sec
C.P - 2 - 5 min 30 sec

Signature of JAG JE/SSE

	CPA Pressure build up time 8.5 kg/cm ²	BP drop in 5 Minute	FP drop in 5 Minute	MR drop in 15 Minute	Press BPPB to apply or release parking brake. Check Pressure in Parking Brake gauge	VCB Pressure switch setting
Std. Value	60 Sec. Max.	Max. drop 0.15 kg/cm ²	Max. drop 0.70 kg/cm ²	Max. drop 1.0 kg/cm ²	6.0 ± 0.15 kg/cm ²	Opens 4.5 ± 0.15 kg/cm ² . Closes 5.5 ± 0.15 kg/cm ²
GI	58 SEC	NODROP	0.3 DROP	0.2 DROP	Cab-1	Cab-2
Final	59 sec	0.05 drop	0.20 drop	0.3 drop	NOT PROVIDED	

	ACP on 4mm test plate		Auto brake controller Position	BP (kg/cm ²)		BC (kg/cm ²)	
Std Values	Working		Run	5.0 ± 0.10	Cab-1	Cab-2	0.0
			Initial Application	4.6 ± 0.10	4.6	4.7	0.40 ± 0.10
	Cab-1	Cab-2	Full Service	3.35 ± 0.20	3.4	3.4	2.50 ± 0.10
			Emergency	Below 0.30	0.0	0.0	2.50 ± 0.10
Gen. Insp.	OK	WORKING					
Final							

	Loco pilot cabin condition		Wiper Operation		Look out Glass		Fire Extinguisher	Sand box	Sander Operation		Cleaning of Loco
	Cab-1	Cab-2	Cab-1	Cab-2	Cab-1	Cab-2			Cab-1	Cab-2	
Std. Values	Good	Good	Working	Working	Clear	Clear	Sealed	Full	Working		Cleaned
Gen. Insp.	DIRTY	DIRTY	WORKING	WORKING	DIRTY	DIRTY	SEALED	Full	Working		Cleaned
Final	DIRTY	DIRTY	W	W	DIRTY	DIRTY	SEALED				DIRTY

क्र.सं. SN	कार्यवाही कार्य / निरीक्षण का विवरण / (शिफ्ट्यूल) Detail of Work/ Inspection (Schedule)	कार्यवाही की गयी Action Taken	टीसीएन का नाम Name of TCN	हस्ताक्षर/ टिप्पणी Sign/ Remarks
---------------	--	----------------------------------	------------------------------	-------------------------------------

(A) Pneumatic System (When Loco is energised check, attend and record)

1	Check correctness of reading of BP, FP, MR, BC, AFI & RS gauges.	CHECKED OK	1	
2	Check on dummy of BP FP pipe.	CHECKED OK		
3	Check the working of PTDC	E70 BRAKE SYSTEM.		
4	Check the proper functioning of all the gauges of the driver desk BP: (i) Normal (ii) with 7.5 mm hole BP should not drop below 4 kg/cm ² in 60 second. FP: (i) Normal (ii) with 5.5 mm hole FP should not drop below 4.5 kg/cm ² in 60 second. MR: (i) Mainline MR leakage without application of SA-9 Direct Brake (ii) Mainline MR leakage with application of SA-9 Direct Brake	BP- 4.6 FP- 5.8		
5	(RS drop) Panto line air leakage 0.70 kg/cm ² in 5 minutes.	No drop.		
6	Check working of Panto selection switch.	WORKING.		
7	Position of isolating cock on pneumatic panel. (70,74,136 in open condition & 47 in close condition.)	CHECKED OK		
8	Drain moisture from MR and Inter Cooler.	DRAINED.		
9	Check functioning of air dryer for purging, cycle time and change over with MR pressure of 8.0 kg/cm ² .	CHECKED OK.		
10	Check Position of the Air dryer cock (13,14 in service & 187 in isolated)	CHECKED OK.		
11	Check air dryer charging when compressor is in working. (FTIL -120 sec/SIL-180 sec)	TRIDENT WORKING.		
12	Check and attend leakage of air dryer, compressor valves, Pneumatic valves, Pneumatic panels & pipelines.	CHECKED OK.		

Signature of JAG JE/SSE

क्र.सं. SN	कार्यवाही कार्य विवरण निरीक्षण का (शिड्यूल) Detail of Work/ Inspection (Schedule)	कार्यवाही की गयी Action Taken	टीसीएन का नाम Name of TCN	हस्ताक्षर/ टिप्पणी Sign/ Remarks
B	BRAKE CONTROLLER (AUTO AND DIRECT)			
1	Check the functioning of driver's direct air brake & automatic train brake.	CHECKED OK		
2	Check the free movement of the brake controller.	CHECKED OK		
3	Perform repeated application and release of brakes with both auto and direct brake controller from both cabs and ensure that BP & BC pressure build up & drop is proper on the gauge. Ensure by physically going to individual main and parking brake cylinder that their operation is smooth and without air leakage.	CHECKED OK		
C	CARBODY FILTER:			
	Check condition and clean car body filter and refit.	checked.		
1	Thoroughly clean all roof and side body filters with water jet.	cleaned		
2	Check tightness of Roof joint clamp and Roof top bolt	checked		
3	Remove Louvers & Fly screen and clean it. Repair if found defective.	cleaned		
4	Remove the tread plate and clean the drainage channels Check and adjust, if necessary, the door-operating rod (IC Sch)	-x-		
H	LOOKOUT GLASS & SIDE WINDOWS			
1	Clean any built up dirt and debris from the channel below the cab-sliding window. Clear the sliding window channel drains hole in the door opening.			
2	Clean look out glass with detergent water solution.			
I	WASHER / WIPER			
1	Check the operation of windscreen wipers using the manual handles. Rectify any fault found.	CHECKED OK		
2	Check the condition of windscreen wiper blades. Replace if required.	CHECKED OK		
3	Check the wiper and parallel arm assembly for wear and damage. Replace the arm or any part if there is excessive wear or damage. (IC Sch)	-x-		
4	Check the water level in the reservoir at No.1 and No.-2 end. Top up if required. Check wipers for proper operation			
5	Clean the washer nozzle jet. (IC Sch)	-x-		
6	Check for damage of air and water pipes	CHECKED OK		
7	Examine all components for wear, looseness scoring and cracks, renew any defective components.	CHECKED OK		
8	Check seat-mounting points for integrity and ensure fixing or fully tightened.	CHECKED OK		
J	Key interlocking: Check all keys are present & the complete system is operational	CHECKED OK		
K	Fire Extinguisher			
1	Ensure availability of fire extinguishers and ensure that it is not expired.	CHECKED OK		
2	Check the condition of CO2 gas cylinder, its regulator and pressure gauge in both cabs. Check the CO2 gas pressures. Refill if necessary	CHECKED OK		
3	Clean pipeline by compressed air and check that there should not be any leakage.			
4	CO2 Gas pressure and date: Cab-1 74 kg/cm ² Cab-2 72 kg/cm ²			
	30/12/24 30/12/24			

Signature of QAG JE/SSE

क्र.सं. SN	कार्यवाही कार्य / निरीक्षण का विवरण / (शिड्यूल) Detail of Work/ Inspection (Schedule)	कार्यवाही की गयी Action Taken	टीसीएन का नाम Name of TCN	हस्ताक्षर/ टिप्पणी Sign/ Remarks
5	Clean fire detection unit pipeline air intake holes with soft non-metallic brush & vacuum cleaner.			
L	OIL LEAKAGE IN MACHINE ROOM / CLEANING OF MACHINE ROOM.			
1	Visually inspect the machine room for any signs oil leakage from traction converter, transformer, D.C. Link, and series resonant circuit capacitors and other electrical equipment and carefully clean the same. (Caution : Electric supply room)	CHECKED OK		26/6/24
2	Clean the complete machine room with the air pressurized supply and vacuum cleaner to remove all the dust particles.			
M	SAND GEAR SYSTEM			
	a) Check Sand box, cover gasket, Ejector and replace gasket if necessary.	CHECKED OK		
	b) Check all sander pipe for alignment and check fasteners also.	CHECKED OK		
	c) Check and ensure tightness of Sand box foundation bolt.	CHECKED OK		
	d) Ensure sander pipe height 60mm above rail level.	CHECKED OK		
	e) Refill sand in all sand boxes.			
N	OIL COOLING UNIT CASING WITH RADIATOR			
1	Remove all dust, dirt and debris from the radiator chamber via the machine room access cover. (By using vacuum cleaner).	Checked		
2	Visually check the conservator tank along with its gauge glass for any sign of crack / damage / oil leakage.	Checked		
3	Measure air delivery before and after cleaning of radiator.			
4	Measure vibrations of oil cooling casing using vibration analyzer and take appropriate action			
5	Visually check the casing and support arrangement for oil pumps on the casing for any sign of crack of the damage	Checked		
6	Visually check the oil cooler radiator for any oil leakage from VPTFP and VPSR and external damage from top to bottom.	Checked		
7	IC Sch: a) Clean radiator with hot water jet and check that the radiator is not blocked.			
8	b) Tighten the front foundation bolts of casing mounted on to the radiator and check intactness of jail and Z-clamp welding crack.	Checked		

Check and put (✓) mark on the check box (CB) against each of the following items if the same has been checked.
Write defects noticed and action taken in the Non-Schedule work table.

UPPER DECK [Inspect, Attend and Record]

SN	Description	CB	Remarks
1.	Loose, missing and broken components/parts.	✓	
2.	Clamping and condition of its welding/fastener.	✓	
3.	Condition and working of all pressure gauges.	✓	
4.	Working of all brake valves.	✓	
5.	Leakage of air (MR)	✓	
6.	Gauges, securing of loco pilot cabin.	✓	
7.	Operation of Wipers.	✓	
8.	Co-Action working of A9 Auto brake.	✓	
9.	Fire Extinguishers (prescribed Nos.)	✓	02 NOS + 02 NOS

BK. SMALL.

Signature of QAG JE/SSE


10.	Check tightness of compressor foundation bolt & abnormal sound.	✓	
11.	check slackness of compressor fan and no vibration in comp.	✓	
12.	Check tightness of air dryer foundation bolt.	✓	
13.	Ensure Air dryer indicator blue colour	BLUE	
14.	Ensure clamping of all pipe to avoid vibration and rubbing.	✓	
15.	Ensure fitment of all split pins	✓	
16.	tightness of all bolts of Loco Roof Check	✓	
17.	Check window of both cab, shutter window door & corridor doors	✓	

Check and put (✓) mark on the check box (CB) against each of the following items if the same has been checked. Write defects noticed and action taken in the Non-Schedule work table.

UNDER TRUCK [Inspect, Attend and Record]

क्र.सं. SN	विवरणDescription	CB	टिप्पणीRemarks
1.	Loose, missing and broken components/parts.	✓	
2.	Clamping and condition of its welding/fastener.	✓	
3.	Air leakage in bogie.	✓	
4.	Overheated parts / Abnormal wear in parts.	✓	
5.	Check and Ensure Brake block and Wheel clearance >10mm	✓	
6.		✓	

(Remarks if any & sign):


Signature and Name of Technician for Inspection Incoming with date & shift: **DIPAK+DINESH (26/6/24)**
CB 1173. 

Signature and Name of JE/SSE for Inspection Incoming with date & shift:

Signature and Name of Technician for Inspection Final with date & shift:

Signature and Name of JE/SSE for Inspection Final with date & shift:

अन्य किसी भी जानकारी Any Other Information:


Signature of QAG SSE Incharge (Inspection)


Signature of QAG JE/SSE

SCHEDULE PROGRESS CHART

SN	Date	Shift	QC	Work Details	Name of JE/SSE	Sign of JE/SSE	Remarks
1	26/6/24	8/17		PRE-INSPECTION.			
2	28/6/24	8/17		OCB + Radiator scan done			
3	29/6/24	8/17		Comsch & Transformer scan done			
4	30/6/24	16/24		Final inspection done			
5							
6							
7							
8							
9							
10							
11							
12							
13							
14							
15							
16							
17							
18							
19							
20							
21							
22							
23							

AF1877

Signature of QAG JE/SSE



पश्चिम रेलवे
Western Railway

SABARMATI DIESELS, LOCO CARE CENTRE, SABARMATI

IA/IB/IC SCHEDULE OF 3 PHASE ELECTRIC LOCOMOTIVE [UNDERFRAME]

लोको संख्या Loco No	32461	क्लास Class		शिड्यूल में लेने का दिनांक Date taken under Sch	
---------------------	-------	-------------	--	--	--

UNDERFRAME IA/IB/IC SCHEDULE & RECORDS

A-Check and record Hoot Wear, Flange Wear & Tread Wear (Record Wheel Diameter in Schedule or After TT)									
Wheel No	Wheel Tread dia	Root Wear	Flange Wear	Tread Wear	Wheel No	Wheel Tread dia	Root Wear	Flange Wear	Tread Wear
1	1041.9	3	2	1	7	1053.8	2.5	0.5	1
2	1041	2.5	1	1	8	1050.6	2.5	1	1
3	1041.8	2	1	1.5	9	1053.5	1	0.5	1
4	1040.5	1.5	0.5	1	10	1049.8	3	1.5	1
5	1041	2.5	1.5	1.5	11	1052.4	2.5	1.5	1.5
6	1040.5	4	2	2	12	1050	3.5	2	1

B- Check and Record in IC Sch Vertical & lateral clearance (Primary & Secondary) as per TC/0082 (REV-1) dated 17/09/2015

Standard Value	Primary vertical clearance (Cab-1 & 2 Bogie) Actual Value Axle box & Bogie frame											
	1	2	3	4	5	6	7	8	9	10	11	12
27 to 35 mm												

Standard Value	Primary lateral clearance (Cab-1&2 Bogie) Actual Value Axle box & Bogie frame											
	1	2	3	4	5	6	7	8	9	10	11	12
15 to 22 mm												

Standard Value	Secondary lateral clearance (Cab-1 Bogie) Actual Value Bogie frame & under frame			
	CAB-2 LP Side	CAB-1 ALP Side	CAB-2 LP Side	CAB-1 ALP Side
32 to 60 mm				

Standard Value	Secondary lateral clearance (Cab-1 Bogie) Actual Value Bogie frame & under frame			
	CAB-2 LP Side	CAB-1 ALP Side	CAB-2 LP Side	CAB-1 ALP Side
45 to 55 mm				


क्यूएजी जेई/एसएसई QAG-JE/SSE

C- Check and record wheel gauge below Parameters: (IC Schedule) WHEEL GAUGE [Permissible limit 1596 mm, (159610.5 mm for RB/New loco)]

Axle No.	A	B	C	Average	Remarks
1					
2					
3					
4					
5					
6					

Check and record below Parameters in Schedule or if TT is done:

Axle No.	Standard (mm)		Cab-1		Cab-2	
Location	Max	Min	R1	L1	R2	L2
Buffer Length			640	635	638	642
Buffer Height			1050	1045	1045	1050
Rail guard height			110	105	112	110
CBC Height			1060		1064	

		Cab-1	Cab-2
STRIKER WEAR PLATE	New 8 mm, Condemn 2 mm		
SHANK WEAR PLATE	New 6 mm, Condemn 1 mm		

E- Measure D SHAKLE and write Coupling No.

CAB-1

CAB-2

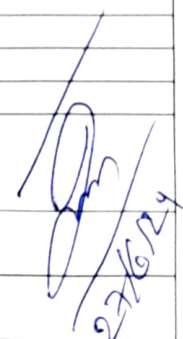
Check and Record Gear case Oil Level:

TM	OIL FOUND	OIL TOP UP	TM	OIL FOUND	OIL TOP UP
1	5.5 Liter	0.500	4	5.5 Liter	0.500
2	5.5 Liter	0.500	5	5.5 Liter	0.500
3	5.5 Liter	0.500	6	5.5 Liter	0.500

	Hand Brake Operation	CB Coupler Operation & Condition		Transition Screw Coupling Operation & Condition		CBC Lock Pin		HP/FF Pipe	
Std. Value	Working	Normal		Normal		Intact		Intact	
Gen. Insp.		Cab-1	Cab-2	Cab-1	Cab-2	Cab-1	Cab-2	Cab-1	Cab-2
Final Insp.									

Brake Piston Travel :						Brake Shoe release	Standard 3/9/10 mm
Class of Loco	Standard value	Observed (mm)					
WAG7/WAP7	107 to 117 mm	Location-	1	2	3	4	
WAG9		Location-					

क्यूएजी जेई/एसएसई QAG-JE/SSE

Sr. No.	Detail of Work/ Inspection	Name Technician	Sign/Remark
F	DRAFT GEAR AND COUPLERS		
	1. Liberally apply general-purpose grease to the face of the centre buffer coupler at the end of the Locomotive	Checked on	
	2. Check the intactness of the CBC bottom support plate bolts	Checked on	
	3. Check the knuckles against crack by DPT (IC Sch)		
	4. Check knuckle by gauge no. 1&2 (130-135 mm by go no go gauge) (IC Sch)	Checked on	
	5. Check knuckle nose wear by gauge no. 3 go no go gauge (IC Sch)	Checked on	
	6. Check intactness and functioning of CBC operating handle.	Checked on	
	7. Check visually the striker casting of CBC assembly.	Checked on	
	8. Check for working of CBC, Lock and unlock it, locking arrangement, working of TC	Checked on	
	9. Check washer lock at knuckle pin bottom	Checked on	
	10. Check gap between Striker and Draft gear for draft gear slackness	Checked on	
G	BUFFERS		
	1. Check buffers for any crack visually of the flange and intactness of foundation bolts, check nuts and split pins (4 nos. each).	Checked on	
	2. Liberally apply general purpose grease to the face of the buffers at the ends of the Locomotive. Also smear grease on the buffer head plunger.	Checked on	
	3. Conduct RDPT of Buffers to detect crack flaws. (IC Sch)	Checked on	
	4. Check and measure the buffer height and buffer length. (IC Sch)	Checked on	
H	SUSPENSION		
	1. Examine the primary and secondary springs for signs of damage, cracks and broken end visually with torch light and tapping by a hammer & replace, if necessary	Checked on	 27/6/24
	2. Examine different types of dampers for oil leakage and intactness of fasteners and end fittings	Checked on	
	3. Proper torque of all fasteners related to suspension arrangement and mounting of equipment in under frame (IC Sch)	Checked on	
	4. Check the condition of various Spheris block in the primary and secondary suspension arrangement and of various equipment mounted in the under frame like axle guide link, traction motor and its support arm, gear case support arm for their healthiness (it should not be crack) and replace, if necessary.	Checked on	
	5. RDPT of all TM nose and its support arm. (IC Sch)	Checked on	
I	TRACTION BAR		
	1. Check the well being and presence of the safety sling	Checked on	
	2. Check the push/pull rod pivot heads for damage	Checked on	
	3. Examine the traction link assembly for signs of damage. Any defective item should be renewed	Checked on	

क्यूएजी जेई/एसएसई QAG-JE/SSE

Sr. No.	Detail of Work/ Inspection	Name Technician	Sign/Remark
	4. Check the fastener at the traction ends and those retaining the traction rod for security. If a fastener is loose, it must be renewed and tightened to the specified torque. Ensure intactness of the locking plate. SM1-241	Chaudhary	
	5. RDPT of traction bar at end (flange) portion & V-Ring	Chaudhary	
	6. Housing flange. 6) RDPT of Pivot post for any crack (IC Sch)	Chaudhary	
	7. Examine limit chain and links for wear, corrosion or damage	Chaudhary	
	8. Inspect the safety slings, pins and R clips for wear and damage,	Chaudhary	
	9. Check Aclathan/Vulkollon ring against any crack or shifting	Chaudhary	
	10. Check gap in housing flange and traction link flange	Chaudhary	
	11. Torque modified bolt M20 X65 by 260Nm (SMI 241)	Chaudhary	
J	BOGIE FRAME AND BRAKE GEAR	Chaudhary	
i	BRAKE BLOCK	Chaudhary	
	1. Inspect the brake blocks for wear. If it is below the minimum limit, replace the complete locomotive set brake block.	Chaudhary	
	2. Check the brake block key security	Chaudhary	
	3. Check the brake rigging for loose, damaged or worn out parts Rectify as required.	Chaudhary	
	4. Examine the bogie frame, transom beam & damper base for signs of crack/damage	Chaudhary	
	5. Check fitment of Palm Pull rod J Bracket, hanger lever and TM safety rope wire.	Chaudhary	
	6. Inspect the rubber bumps for damage deterioration. Replace if required	Chaudhary	
	7. Examine all bogies mounted equipment (Including earthing straps) for signs of damage and security of fastening	Chaudhary	
	8. Inspect the brake rigging rotation points and component contact surfaces. Rectify any faults found.	Chaudhary	
	9. Inspect the bogie body safety pin eyehole at the bogie frame for wear or cracks (IC Sch)	Chaudhary	
	10. Maintain the vertical & lateral clearances (Primary & secondary) as per TC-082 (IC Sch)	Chaudhary	
	11. Check the earthing shunts provided on bogie and body. Check intactness or axle box cover bolts <u>and sealing</u> .	Chaudhary	
	12. Inspect brake gear for any worn out loose, damaged, hanging or dragging parts. Confirm intactness	Chaudhary	
	13. Test for correct operation of the brake cylinder actuator unit.	Chaudhary	
	14. Check the proper tightness of parking brake & service brake pneumatic pipes.	Chaudhary	
	15. Check the external hitting marks & physical damage on the brake cylinder actuator unit.	Chaudhary	
	16. Check the condition of parking brake cylinder bellows If damaged, replace them.	Chaudhary	
	17. On parking brake cylinder pulling spindle & ring should be intact.	Chaudhary	
	18. Check proper functioning of parking brake & service brake cylinder.	Chaudhary	

क्यूएजी जेई/एसएसई QAG-JE/SSE

Sr. No.	Detail of Work/ Inspection	Name Technician	Sign/Remark
	19. Check the operation (manual releasing) of the parking brakes	Chaudhary	
	20. Check the bogie isolating cock, should be in proper position.	Chaudhary	
	21. Check the wear of scrubber blocks, replace if required (WAP5only)	Chaudhary	
	22. Maintenance of Traction Motor support plate and bogie nose to Prevent crack/breakage of Traction Motor support plate (Holder for Traction motor suspension) should be done as per RDSO's SMI no. RDSO/2011/EL/SMI/0269 (Rev. '0') dtd, 18.05.11	Chaudhary	
ii	WHEEL SET AND AXLE BOX	Chaudhary	
	1. Examine all the wheels visually for following defects.	Chaudhary	
	a) Cracks: if any, requires replacement.	Chaudhary	
	b) Flats: Length 40mm or more requires re profiling.	Chaudhary	
	c) Cavities: Isolated cavities of length 15mm or more or multiple cavities of length 10mm or more and less than 50mm apart require re-profile/replacement.	Chaudhary	
	d) Metal builds up Height 1mm, or above and length 50mm or more requires re-profiling. For length less than 50mm., remove the build up with hand tools.	Chaudhary	
	e) Scoring and Grooving: Circumferentially around the wheel tread due to action of brake blocks require re-profile/replacement.	Chaudhary	
	2. Measure and record the wheel diameters and tread profile. Refer RDSO's Tech. Circular no. ELRS/TC/0083 (Rev. "0"), (IC Sch)	Chaudhary	
	3. Disconnect the electrical cable from the earth return unit. Remove the earth return unit from the axle. Examine the bearings and rear sealing position for signs of grease leakage or deterioration. (IC Sch)	Chaudhary	
	4. Check the axle for any cracks with the help of ultrasonic flaw detector. At the same time visual inspection should be done. (IC Sch Every 06 month)	Chaudhary	
	5. Grease Axle box after 300000 KM Engine Run		
	6. Check the temperature of axle boxes. The axle boxes which are running warm or reported to have higher temperature in comparison with others shall be attended on priority by physically opening of axle box cover and outer angle ring. The suitable maintenance shall be done either in-situ or by dismantling the axle box.	Chaudhary	
iii	GEAR CASE (WAP7/WAG9/WAG9H)		
	1. Externally clean the gear case & its gauge glass. Inspect for any signs of oil leakage and any external hits/ damage. Verify integrity of gauge glass protective cover and clean oil sight glass for visibility.	Chaudhary	
	2. Check the oil level in the gauge glass and top up if required. Ensure intactness of the drain plug along with its sealing. Check its tightness.	Chaudhary	
	3. Check for any breakage of bolt and replace	Chaudhary	
	4. Check for intactness of all fasteners of gear case	Chaudhary	
	5. Tighten all gear case fasteners at prescribed torque	Chaudhary	
	6. Check the gear case oil visually and replace if found dirty or dust full level in the gear case and fill to the requirement	Chaudhary	
	7. Check Gear case oil for metal contamination	Chaudhary	
	8. Visually examine for fractures, the tyre profile for wear, flat, and skidding marks	Chaudhary	

क्यूएजी जेई/एसएसई QAG-JE/SSE

Sr. No.	Detail of Work/ Inspection	Name Technician	Sign/Remark
9.	Check wheel root, flange and Tread wear & record Change all unserviceable Brake Blocks	chaitan	on file
10.	Check condition and operation of Hand Brakes. Lubricate & adjust as necessary.	chaitan	
11.	Adjust Brakes and lubricate tunion	chaitan	
12.	Lubricate Brake Gearing, Slack Adjusters, Buffers, CB Coupler Assembly	chaitan	
13.	Split the cotter pin, if new provided	chaitan	
14.	Sch IC: a) Axle box old grease to remove and New grease to fill, old grease sample to be sent Lab for metal content check	chaitan	
	b) Lubricate suspension roller tube bearing.	chaitan	
	c) Check Transition screw coupling long and short shackle bar thickness by Go-No Go gauge (39.5 mm snap 1/25 mm snap 8)	chaitan	
	d) Carry out DFT of Buffer Foundation and DPT/MPT of CBC Knuckle clevis & Yoke. Check size of Clevis, Knuckle, coupling by Go-No Go Gauge as specified. As per SMI-213/MIG-76	chaitan	

Check and put (✓) mark on the check box (CB) against each of the following items if the same has been checked. Write defects noticed and action takes in the Non-Schedule work table.

UNDER TRUCK [Inspect, Attend and Record]

SN	Description	CB No.	Remarks
1.	Measure and record buffer & rail guard height.		
2.	If skidded, fill Wheel Sledding Complain Report Form, FRMB/22 or if Biased wheel wear, fill up Check last for Based Wheel Wear Cause Invest, FILM/24)	✓	
3.	Proper Fitment of Brake Block and as Key	✓	
4.	Rubbing of brake block with wheel in brake release position	✓	
5.	Movement of brake pull rod in brake applied position	✓	
6.	Brake Shoe and Brake hanger Pin/Bolts	✓	
7.	Brake piston movement.	✓	
8.	Support arrangement for brake cross tie bars	✓	
9.	CBC Drooping.	✓	
10.	Operation of both Transition screw couplings	✓	
11.	Operation of CBC, Operating Rod and Coupler lock Pin	✓	
12.	Operation of CBC Knuckles	✓	
13.	CBC retaining plate and support plate bolts	✓	
14.	Side buffers and their mounting bolts.	✓	
15.	Bolts of Cattle guards and back supports.	✓	
16.	Fitment of Rail Guard	✓	
17.	<u>Gear case mounting bolts and 'C' clamp bolts</u>	✓	
18.	<u>Suspension bearing cap bolts and it's sealing.</u>	✓	
19.	<u>Crack in TM Suspension taper roller bearing housing</u>	✓	

क्यूएजी जेई/एसएसई QAG-JE/SSE



पश्चिम रेलवे
Western Railway

SABARMATI DIESELS, LOCO CARE CENTRE, SABARMATI
IA/IB/IC SCHEDULE OF 3PHASE ELECTRIC LOCOMOTIVE
[COMPRESSOR & PNEUMATIC SYSTEM]

लोको संख्या Loco No क्लास Class शिफ्ट में लेने का दिनांक Date taken under Sch

क्र.सं. SN	कार्यवाही कार्य निरीक्षण का विवरण / (शिफ्ट) Detail of Work/ Inspection (schedule)	कार्यवाही की Action Taken	टीसीएन का नाम Name of TCN	हस्ताक्षर/ टिप्पणी Sign/ Remarks
A	मेन कंप्रेसर और बेबी कंप्रेसर Main Compressor and Baby Compressor			
1	Check the pressure build up timing of each compressor independently in pre-inspection and take needful action during inspection. [From 0 to 10 kg/cm ² i) With 1750LPM Comp-7 Minutes max. ii) With 1450LPM Comp- 8.5 Minutes max.]	CP-I → 6 MIN CP-II → 6 MIN	48 SEC. 15 SEC.	
2	Feel the vibrations of the compressor in pre-inspection and taken needful action during inspection.	CHECKED OK		
3	Check for any external damage abnormal sound proper functioning of the compressor	CHECKED OK		
4	Check the complete compressor support brackets for their healthiness	CHECKED OK		
5	Visually examine the compressor mounting resilient blocks and take needful action	CHECKED OK		
6	Visually examine the various interconnecting pipelines and its support clamps of the compressors for their healthiness air leakage.	CHECKED OK		
7	Cleaning of input air filter and the primary oil filter	Clean		
8	Clean the breather assembly	Clean		
9	Check and Drain the inter cooler after cooler assembly and also observe its discharge and take needful action.	—		
10	Ensure healthiness / intactness of various protection guards of compressor.	Checked		
11	Check the condition of the coupling between compressor & motor	Checked		
12	Visually check the compressor fan blade for their healthiness	Checked		
13	Check the oil level in the compressor and top up as per requirement.	Checked		
14	Carry out the inspection of each type of compressor in line with recommendation of respective manufacturer.	Checked		
15	Check compressor foundation base for crack (For under slung compressor)	Checked		
B	Aux. Compressor (CPA)			
1	Clean the CPA externally. Clean Suction Air filter.	Clean		
2	Check oil level and condition of oil and top up if required with the oil specified (Servo Press 150).	—		
3	Check tightness of all nut bolts, foundation bolts.	Checked		
4	Measure and record time & pressure of the auxiliary compressor	—		
C	Sch IC: i) CP all discharge valves to remove.			
	ii) CP all discharge valves refit by overhauled			
	iii) CP oil to be change.	Changes		
	iv) Baby compressor/CPA oil to be change	Changes		
	CPA			
	CP-1			
	CP-2			
	v) Baby compressor/CPA safety valve (8.5 kg/cm ²) to be replace by overhauled	—		

स्पष्टी जू. डी.सी. से डी.सी. के द्वारा Signature of QAG JE/SSE

क्र.सं. SN	कार्यवाही कार्य / निरीक्षण का विवरण / (शिड्यूल) Detail of Work/ Inspection (schedule)	कार्यवाही की Action Taken	टीसीएन का नाम Name of TCN	हस्ताक्षर/ टिप्पणी Sign/ Remarks
D	AIR SUPPLY AND PNEUMATIC SYSTEM			
1	NRV and unloader valves fail due to ingress of Carbon which extracted from CP. So, one cycle dismantling, checking and cleaning of NRV and unloader to be ensured in all type of 3-phase locomotives.			
E	AIR DRYER			
1	Inspect the air dryer for any damage and its mounting for any damage, crack in mounting plate, intactness of fasteners. Check for any hit mark on main reservoir and drain cock. Check for proper position of the air dryer angle cocks.	CHECKED OK		
2	Check the integrity of the welding of the hanging support.	CHECKED OK		
3	Check humidity indicators for blue colour. White indications mean the air dryer is not operating effectively. Desiccant shall be changed, if needed.	CHECKED OK		
4	Replace desiccant if found to be contaminated with either water or oil.	CHECKED OK		
5	Testing of air dryer for proper functioning to be done as per Technical Circular no. RDSO/2011/EL/TC/0108, Rev.'0' dtd. 7.3.11 for testing of air dryers and its efficacy on electric locomotives.	CHECKED OK		
F	E-70 BRAKE SYSTEM (PNEUMATIC PANEL)			
1	Visually inspect the pneumatic panel noting any sign of air leakages and rectify accordingly.	CHECKED OK		
2	Clean the pneumatic panel externally.			
3	Check for correct position of the cut out/isolating cock.	CHECKED OK		
4	Check all the cable connections for looseness or deficiency of cleats. If any inspection section is to be informed (IC Sch)	→ X →		
5	Ensure provisioning and proper functioning of RS gauge, Switch, lamp & other gauges on pneumatic panel.	CHECKED OK		
6	Check the sealing of connectors, flexible pipe, regulator, air tank etc.	CHECKED OK		
G	BRAKE ISOLATING COCKS: Check for correct operations of BP & FP angle cocks. Check the condition of BP/FP pipe, cock & isolating handle for any hit marker crack. Check correct condition of Bogie Isolating cock.	CHECKED OK		
H	BRAKE HOSES: Examine the brake hoses at the ends of the locomotive to make sure that they are not chafed or damaged. Check coupling cocks for correct operation.	CHECKED OK		
I	AIR RESERVOIR			
1	Blow down and drain the reservoir until exhaust of complete water and oil. Check all drain cocks are closed on completion.	BLOW DOWN DONE		
2	Check for any hit mark on main reservoir & drain cock	CHECKED OK		
3	Ensure intactness / tightness of main reservoir foundation bolts.	CHECKED OK		
4	Check the rubber gasket at the inspection cover of air reservoir for any damage/leakage.	CHECKED OK		
5	Check the pressure regulator operates correctly	CHECKED OK		

न्यू एजी जू. इजी/सी. से. इजी. के हस्ताक्षर Signature of QAG JE/SSE

क्र.सं. SN	कार्यवाही कार्य / निरीक्षण का विवरण / (शिड्यूल) Detail of Work/ Inspection (schedule)	कार्यवाही की Action Taken	टीसीएन का नाम Name of TCN	हस्ताक्षर/ टिप्पणी Sign/ Remarks
J	THROTTLE VALVE (IC Sch): Overhaul the throttle valve and change the rubber parts.	✓		
K	IN LINE FILTER (IC Sch): Remove the filter element and clean thoroughly.	✓		
L	HORN & HORN SWITCH			
1	Check condition of horn handle for any damage. Check for proper operation of horn.	CHECKED OK		
2	Check the condition of horn boots and replace if required	CHECKED OK		
3	Remove the horn & horn switch and Overhaul. Replace the diaphragm of horn. (IC Sch)	✓		
4	Check all angle cocks for proper operation	CHECKED OK		
5	Ensure proper colour code of all the angle cocks.	CHECKED OK		
6	Check the tightness of the brake electronics control cards holding screws.	CHECKED OK		
7	Check all the pipes for leakage or damage. Check all the clamps for any damage and looseness.	CHECKED OK		
M	वायुवीय प्रणाली PNEUMATIC SYSTEM			
1	MR Safety valve, ADC, Panto throttle valve (Only for conventional Pantograph) replace by Overhaul in IC Sch.	✓		

Remarks if any

क्यूएजी जे. ईजी/सी.से.ईजी के हस्ताक्षर Signature of QAG JE/SSE



पश्चिम रेलवे
Western Railway

SABARMATI DIESELS, LOCO CARE CENTRE, SABARMATI
CHECK SHEET FOR 3PHASE HR PANTOGRAPH ASSEMBLY (IA/IB/IC)

लोको संख्या Loco No क्लास Class शिफ्ट में लेने का दिनांक Date taken under Sch

SCHEDULE: PANTOGRAPH SR.NO. /Make/Type: LOCATION:

SN	Detail of Work/ Inspection (schedule)	Standard value	Action Taken		Remarks
			PT-1	PT-2	
1.	Ensure that wearing strips are without sharp edges and no gap between end strip and wearing strip.	Smooth and no gap	cleared	cleared	
2.	Ensure availability of bolts, nuts, lock nuts, spring, washer, split pin etc.	All intact	cleared	cleared	
3.	Check the rubber air pipe for any leakage	No leakage	cleared	cleared	
4.	Check the rubber air bellow for any leakage/damage/rubbing	No leakage	cleared	cleared	
5.	Check lower frame assembly for any crack and play	No crack	cleared	cleared	
6.	Check upper frame assembly for any crack and breakage	No crack	cleared	cleared	
7.	Check coupling rod assembly for crack and its fitting intactness.	No crack & intact	cleared	cleared	
8.	Check diagonal rod for any crack both end side. (by DPT)	No crack	cleared	cleared	
9.	Check plain bearing eye bush for freeness.	free	cleared	cleared	
10.	Check ball bearing friction of Base frame, Upper frame and Coupling rod.	ok	cleared	cleared	
11.	Check Cam wear on top of cable rope guide surface.	OK	cleared	cleared	
12.	Check condition of all shunts (not more than 5% strand broken)	OK	cleared	cleared	
13.	Check pantograph pan for any external hitting marks	No hitting marks	cleared	cleared	
14.	Verify all welded joint for cracks.	OK	cleared	cleared	
15.	Check the control box for any air leakage	No air leakage	cleared	cleared	
16.	Check the condition and operation of hydraulic damper.	Normal	cleared	cleared	
17.	Check Parallel guide bar for free function of Panto Pan Head	working	cleared	cleared	
18.	Ensure that the thickness of wearing strips above the condemning size	New - 39 mm Condemn - 26 mm	14.70mm	14.26 mm	
19.	Check the static contact force of pantograph at 6.4 kg/cm ² MR pressure	70 N / 7Kg Load Test	Tested	Tested	
20.	Check the raising and lowering time of pantograph	6 to 15 second			
21.	Check the horizontality of panto pan with spirit level.	Level OK	cleared	cleared	
22.	Check the function of auto drop device (ADD)	Working	—	—	

SN	Detail of Work/ Inspection (schedule)	Standard value	Action Taken		Remarks
			PT-1	PT-2	
23.	Check the function of over reach detector (ORD)	Working	clear	clear	Indent for 28/6/24
24.	Check air filter for air leakage or not draining.	No leakage	clear	clear	
25.	Check the all pneumatic valve (3/2 valve, throttle valve and safety valve) for any leakage and proper function.	No leakage	clear	clear	
26.	Check pressure regulator for any leakage and proper function.	No leakage	clear	clear	
27.	Check the tightness of all bolts and thread locking compound to be provided in bearing base bolts.	Provided	clear	clear	
28.	Examine the roofline conductors for defects/looseness at joints.	No defect	clear	clear	
29.	Check the roof for any foreign material such as wire / clothpieces.	No foreign material	clear	clear	
30.	Check tightness, cleanliness and wear-tear of shunt connection between Panto and Roof line.	Tight, clean	clear	clear	
31.	Check that the pan head locking pins springs are in place and secure. Check that the head moves freely on its mounting pins attached to the apex frame. If movement is not free, check that the head is not twisted, the side beam are not bent/twisted & mounting pins are not loose or bent.	OK	clear	clear	
32.	Check tightness of the flexible shunt connecting screws. When a loose screw is found the shunt should be disconnected from the head &/or the pantograph frame, the mating surface cleaned & the shunt reconnected with new screws. Check all shunts for frayed strands and renew any shunt in which 5% or more of the strands are frayed.	OK	clear	clear	
33.	IC Sch: Clean filter element, if found brownish then replace with new.	Clear			

Remarks if any:

Signature and Name of Technician

Signature and Name of JE/SSE

AFRIT

①	②	③	④	⑤	⑥	⑦	⑧	⑨	⑩	⑪	⑫
0.5	1	1	0.5	1	0.5	1	1	1	1	1.5	1.5
1	0.5	0.5	0	0.5	1	1	1	0.5	1	1	1.5
0	1	1	0.5	1	0	0.5	0.5	0.5	0.5	1	0.5

①	②	③	④	⑤	⑥
1036.8	1036.5	1035.3	1035.00	1035.4	1035.2
⑦	⑧	⑨	⑩	⑪	⑫
1045.8	1045.3	1047.00	1046.7	1045.4	1046.00

28/6/24

FRC Booking

- * Both Comp close on 9 kg/cm² in 2 min 55 sec
- * CP I : → Cab-1 में 3 kg/cm² बने 0.5 min 35 sec नीचा है, एवं Cab-2 में MR - 9.8 kg/cm² दिखाता है
- * CP-II : → Cab-1 में 3 kg/cm² बने 04 min 53 sec एवं Cab-2 में 9.8 kg/cm² दिखाता है
- * Correction में Bc pressure 3.0 kg होता है 8-9.5 → 52 sec

Cab No 2 में LHS Sand pipe missing

L2 Sand pipe conyex dummy missing

HRB R1 - Sand NW Jam to attend

~~HRB R1~~ & ~~DCB R1~~ Air leakage

* Cab-1 & Cab-2 Air leak

* Machine room - 1 में TM blower crack है

* MR → Jage Cab-1 में रखवा है

* Cab-1 में wiper motor में पानी नहीं आ रहा है

* Cab-2 में LP side पानी नहीं आ रहा है → Nozal साफ है



पश्चिम रेलवे
Western Railway

SABARMATI DIESELS, LOCO CARE CENTRE, SABARMATI
1A/1B/1C Schedule of 3 Phase Electric Locomotive [Heavy Section]

लोको संख्या Loco No क्लास Class शिड्यूल में लेने का दिनांक Date taken under Sch

Sr. No	Details of Work / Inspection (Schedule)	Action Taken	Name of TCN	Sign / Remarks
A	V C B			
1	Check insulator for crack. VCB roof bus bar, chips and flash marks. If damage in service, renew it	check		
2	Clean insulator, other parts that are dirty with soft, clean & dry cloth. (Do not use cleaning products based on fluoridated or chlorate compounds or sodium meta silicate). apply Silicon Spray.	clean		
3	Check contact spring (Earthing contact)	check		
4	Check moving contact lever of auxiliary switch and tension spring & its mounting bolts for breakage	check		
5	Check the cables & lugs for broken cables, lugs looseness	check		
6	Check the main bushing condition, its connection and foundation bolts and clamps.	check		
7	Check the tightness of HV Connections (Torque 70Nm)	check		
8	IC Sch: a) Check for damage to connection of the earthing isolator, Cleaning & greasing, if necessary. b) Check the torque of VCB fixing screw (Torque 70Nm) c) Remove the bottom cover and check that the control air and electrical connection are tightened & Ensure that there is no leakage from pressure regulator	check		
B	EARTHING SWITCH (HOM)			
	a) Check the arm of earthing switch for any sign for any defect, play, crack etc, copper braid is undamaged and properly connected			
	b) Clean and lubricate the copper braid			
C	PRESSURE SWITCH (IC Sch)			
	Check the tightness of pneumatic connection			
D	AUXILIARY SWITCH (IC Sch)			
	a) Check drive screw for breakage or other damage			
	b) Check the parts of control rod and stay bolt for any deformation			
	c) Check the cables and lugs for broken cables, lugs looseness.			
	d) Securing of auxiliary blocks and support (Tightening torque-1.2Nm)			
	e) Check the working order of each auxiliary contacts			
E	EARTHING CONNECTION.			
	a) Check the earthing connection tightening torque 70Nm.			
	b) Connection of earthing system in 3-phase locomotives type WAP5, WAP7 & WAG9 (As per RDSO/2007/EL/SM1/248 Rev.'0' dated 22.11.2007)			

Signature of QAG JF/SSE

Sr. No	Details of Work / Inspection (Schedule)			Action Taken	Name of TCN	Sign / Remarks
	c) Check Earthing shunt of Bogie to Body					
	Axle box 1-3		Axle box 2-4			
	Axle box 5-7		Axle box 6-8			
	d) Check Earthing shunt of Axle to Bogie					
	Axle box 2		Axle box 3			
	Axle box 6		Axle box 7			

Sr. No	Details of Work / Inspection (Schedule)			Action Taken	Name of TCN	Sign / Remarks
F	MAIN TRANSFORMER					
1	Read off the oil level on the gauge situated on the conservator. Top up the oil as necessary and check for any signs of leakage. Clean the gauge with dry cloth			Checked		
2	Inspect the colour of the silica gel. If it is pink, replace with blue silica gel			Checked		
3	Examine the flanges of the pipe couplings and flexible hose that link the transformer and conservator			Checked		
4	Check the availability of hose/pipe over the oil pipe compensator and check stoochi coupling pipes for proper lay up/alignment			Checked		
5	Check the main Transformer and its protection cover for any damage, crack & oil leakage. Also refer instructions contained in RDSO's letter no. EL/3.2.1/3-Ph / TC-0076 for arresting oil leakages, if any			Checked		
6	Check the deformity of Transformer drain cock protection cover/guard if deformed replace it			Checked		
7	Perform the sample test on transformer oil. Check specific value of BDV, DGA, moisture and acidity and condition monitoring of loco transformer by Dissolve Gas Analysis. (RDSO SMI 138 & OFM Doc. Dt. 27 th Nov. 1995)			Checked		
8	Check visually the condition of transformer foundation bolt and Nylon lock nuts for proper locking.			Checked		
9	Check the earthing cable. Clean and visually inspect the insulator condition and Electrical connection of transformer and converter for crack & flashed mark and ensure red marking.			Checked		
10	Visually inspect for leakage, damage, burning/overheat signs and all fixing clamps condition of oil cooling metallic pipes, Prismatic level gauge, TFP bushing, HV bushing, Hose pipe etc.			Checked		

PJF
29/6/24

- ① AFTD TT work karai ✓ Chason
- ② OVRDOLI work karai ✓ Chason
- ③ BAKKONDIOLI karai ✓ Chason
- ④ BIS C.B.C AIT work karai ✓ Chason
- ⑤ BIS 24ES work karai ✓ Chason


28/6/24


Signature of QAG/JE/SSE