



RTL Design Sherpa

APB PIC 8259 Micro-Architecture Specification 1.0

January 4, 2026

Table of Contents

1 Pic 8259 Mas Index.....	7
2 pic_8259 – Overview.....	8
2.1 Overview.....	8
2.1.1 Parameters.....	9
2.1.2 Applications.....	9
2.2 Functional Description.....	9
2.2.1 Figure 1.1: PIC 8259 Block Diagram.....	9
2.2.2 Register Summary.....	9
2.2.3 Interrupt Priority.....	10
2.2.4 Priority Modes.....	11
2.3 Waveforms.....	11
2.3.1 Waveform 1.1: Interrupt Request.....	11
2.3.2 Waveform 1.2: Interrupt Acknowledge Sequence.....	11
2.3.3 Waveform 1.3: End-of-Interrupt (EOI).....	12
2.3.4 Waveform 1.4: Cascade Mode.....	13
2.3.5 Waveform 1.5: Priority Rotation.....	13
2.4 Navigation.....	14
3 pic_8259 – Register Map.....	15
3.1 Overview.....	15
3.2 Functional Description.....	15
3.2.1 Register Map.....	15
3.2.2 Global Configuration.....	16

3.2.3 Initialization Command Words (ICW).....	18
3.2.4 Operation Command Words (OCW).....	19
3.2.5 Status / Readback Registers.....	22
3.3 Design Notes.....	25
3.4 Navigation.....	25

List of Figures

Figure 1.1: PIC 8259 Block Diagram.....	9
---	---

List of Tables

No tables in this document.

List of Waveforms

Waveform 1.1: Interrupt Request.....	11
Waveform 1.2: Interrupt Acknowledge Sequence.....	11
Waveform 1.3: End-of-Interrupt (EOI).....	12
Waveform 1.4: Cascade Mode.....	13
Waveform 1.5: Priority Rotation.....	13

1 Pic 8259 Mas Index

Generated: 2026-10-02

RTL Design Sherpa · Learning Hardware Design Through Practice [GitHub](#) · [Documentation Index](#) · [MIT License](#)

2 pic_8259 – Overview

2.1 Overview

The pic_8259 is an 8259A-compatible Programmable Interrupt Controller with an APB interface. It handles interrupt management for legacy PC-compatible systems: eight request lines in, one interrupt line out, with masking, priority resolution, and an initialization sequence in between.

Implemented in the current RTL:

- 8 interrupt inputs (`irq_in[7:0]`) with a single `int_out` line. `irq_in` may be asynchronous – it passes a `SYNC_STAGES`-flop synchronizer (default 2) before the edge detector, so a pin transition costs `SYNC_STAGES + 1` clocks before `int_out` reflects it
- Fully-decoded 32-bit APB register file (no legacy A0 two-port model). Only 0x00-0x2C are decoded; everything else in the 4 KB window is dropped with `PSLVERR`
- Acknowledge by read: a read of `PIC_INTA` (0x2C) stands in for the `INTA` bus cycle. It returns `{vector_base[7:3], irq}` with a valid bit, sets the `ISR` bit, and clears an edge-mode `IRR` bit
- Live `IRR` and `ISR` with the fully nested rule: an in-service level blocks itself and every lower-priority level until its `EOI`; a higher-priority level preempts
- All eight `OCW2` commands: non-specific, specific and rotating `EOI`, set-priority, rotate-on-AEOI arm/disarm, and automatic `EOI` (`ICW4` AEOI)
- Special mask mode (`OCW3`)
- Edge or level triggering
- Interrupt masking (`IMR` / `OCW1`)

Now the other half of the story. The following register bits are software-visible storage with no hardware effect – they are kept so a classic `ICW`/`OCW` sequence runs unchanged, and that is all they do (see the register map design notes):

- Special fully nested mode (`ICW4` `SFNM`)
- Buffered mode (`ICW4` `BUF`)
- `OCW3` read-register-select and poll. `IRR` and `ISR` have dedicated read-only registers, and `PIC_INTA` answers the poll question with the acknowledge folded in
- `auto_reset_init` (`PIC_CONFIG` bit 2) affects only whether `init_mode` clears itself after `ICW4`

This is the block after the 2026-09-09 fixes (issue #50); before them there was no acknowledge path at all.

2.1.1 Parameters


Parameter	Type	Default	Description
SYNC_STAGES	int	2	irq_in synchronizer depth in flops. Minimum 2 (a simulation-time guard rejects less)

2.1.2 Applications

- PC-compatible interrupt management
- Legacy device support
- x86 system integration

2.2 Functional Description

2.2.1 Figure 1.1: PIC 8259 Block Diagram

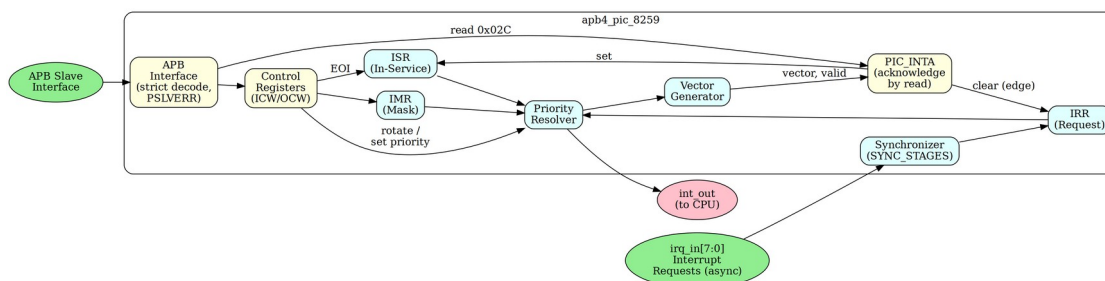

PIC 8259 Block Diagram

2.2.2 Register Summary

The block uses a fully-decoded 32-bit register file, not the legacy A0 two-port model. See [Chapter 5: Register Map](#) for full field definitions.

Offset	Register	Access	Description
0x00	PIC_CONFIG	RW	Global configuration (pic_enable, init_mode, auto_reset_init)
0x04	PIC_ICW1	WO	Initialization Command Word 1

Offset	Register	Access	Description
0x08	PIC_ICW2	WO	Initialization Command Word 2 (vector base)
0x0C	PIC_ICW3	WO	Initialization Command Word 3 (cascade config)
0x10	PIC_ICW4	WO	Initialization Command Word 4
0x14	PIC_OCW1	RW	Interrupt Mask Register (IMR)
0x18	PIC_OCW2	WO	EOI / priority command
0x1C	PIC_OCW3	WO	Special mask (read-select and poll are storage only)
0x20	PIC_IRR	RO	Interrupt Request Register
0x24	PIC_ISR	RO	In-Service Register
0x28	PIC_STATUS	RO	Initialization state / diagnostics
0x2C	PIC_INTA	RO	Interrupt acknowledge by read (side-effecting)

The PIC is disabled at reset - firmware must BOTH complete the ICW initialization sequence (ICW1 -> ICW2 -> ICW3 if cascaded -> ICW4 if requested; PIC_STATUS.init_complete=1) AND set pic_enable (PIC_CONFIG bit 0) before any interrupt can be requested or delivered – out of reset the init FSM sits in INIT_IDLE and IRR never updates. OCW2 and OCW3 commands are ignored until both conditions hold.

2.2.3 Interrupt Priority

IRQ	Default Priority
IR0	Highest (0)
IR1	1
IR2	2 (the conventional cascade input on a master)
IR3	3
IR4	4
IR5	5

IRQ	Default Priority
IR6	6
IR7	Lowest (7)

2.2.4 Priority Modes


- **Fixed Priority:** IR0 highest, IR7 lowest (the reset and post-ICW1 order)
- **Rotating Priority:** the level just retired becomes lowest – rotate on non-specific EOI (0xA0), rotate on specific EOI (0xE0-0xE7), or once per acknowledge with rotate-on-AEOI armed (0x80) in AEOI mode
- **Specific Priority:** set-priority (0xC0-0xC7) names the lowest level

In every mode an in-service level blocks itself and all lower-priority levels until its EOI, and `int_out` asserts only for an unmasked request that outranks everything in service. Special mask mode (OCW3) relaxes that for an in-service level that software has also masked.

2.3 Waveforms

2.3.1 Waveform 1.1: Interrupt Request

Shows an IRQ input assertion triggering the interrupt process.

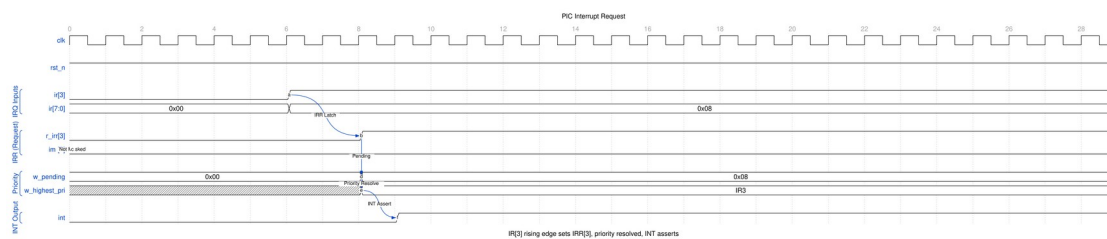


PIC Interrupt Request

When an IR pin asserts, the synchronized input sets the corresponding IRR bit (on the rising edge in edge mode; for as long as the pin is high in level mode). The priority resolver selects the highest priority unmasked request that outranks every in-service level and asserts INT to the CPU. A masked request stays in the IRR and never reaches INT until it is unmasked.

2.3.2 Waveform 1.2: Interrupt Acknowledge Sequence

The acknowledge, as an APB read of PIC_INTA.

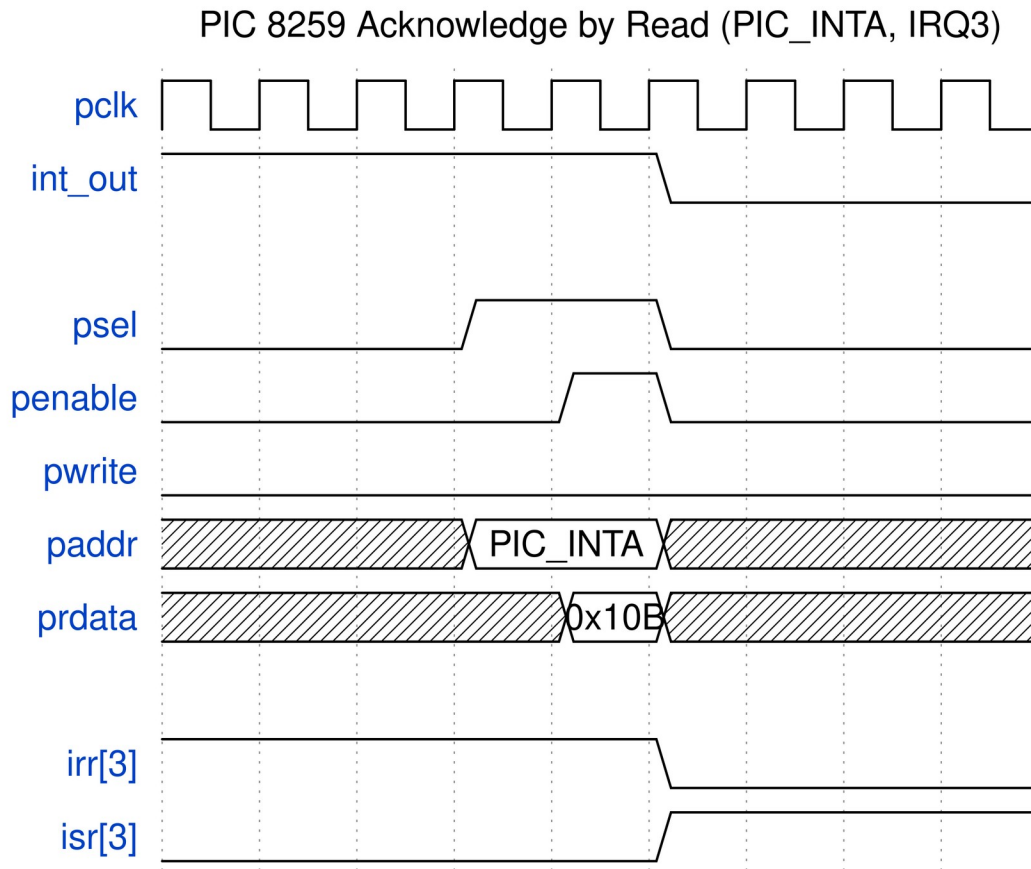


PIC Interrupt Acknowledge

This block has no INTA pin; a single APB read of PIC_INTA (0x2C) does the work of both classic INTA pulses. In the access cycle the read data carries the vector (base + IR number) with bit 8 set to say a request was acknowledged, and at the end of that same cycle the core transfers the level from IRR to ISR (in edge mode the IRR bit clears; in level mode it keeps following the pin). The data returned is the pre-acknowledge state. INT drops in the next cycle unless a higher-priority request is still waiting. With nothing pending the read returns valid=0 and the spurious IRQ7 vector, and changes nothing.

2.3.3 Waveform 1.3: End-of-Interrupt (EOI)

Software clears the in-service bit with an EOI command.

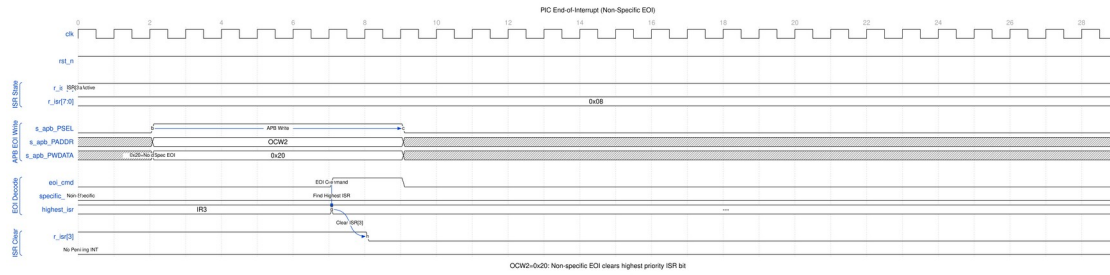


PIC EOI

Non-specific EOI (0x20) clears the highest priority ISR bit – under the fully nested rule, the level acknowledged most recently; under special mask mode, the highest in-service level that is not masked. Specific EOI (0x60-0x67) clears a designated IR. Either is a no-op when nothing is in service. Once the bit clears, the levels it was blocking become eligible again, so INT reasserts if a lower-priority request was waiting; in AEOI mode the acknowledge itself retires the level and no EOI is written.

2.3.4 Waveform 1.4: Cascade Mode

Master-slave configuration for 15 IRQ sources.

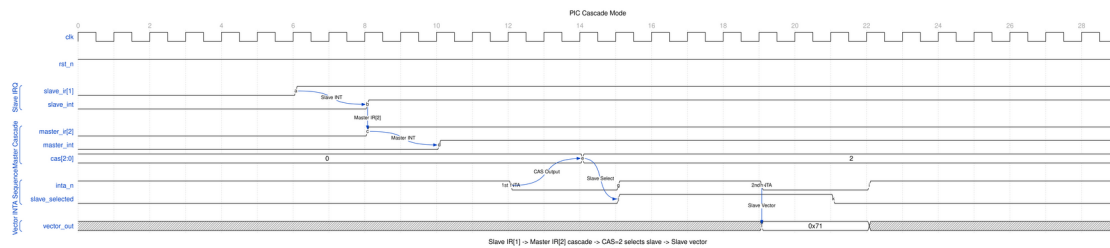


PIC Cascade

Slave INT connects to master IR2. During INTA, master outputs cascade select (CAS) lines. Slave with matching ID provides the interrupt vector.

Note: cascade IS implemented (RLB/pic_8259 TASK-001), but this block has no CAS or SP/EN pins, so the cascade_sel step above is architectural rather than literal. Acknowledge here is an APB read of PIC_INTA, not an INTA pulse pair, so there is no second pulse on which to broadcast a slave ID. The equivalent, and what the RTL does: when the acknowledged level is one ICW3 marks as cascaded, the master returns the SLAVE's vector and forwards the acknowledge down. Covered by [dv/tests/test_pic_8259_cascade.py](#) (RLB/pic_8259 TASK-001).

2.3.5 Waveform 1.5: Priority Rotation

Automatic priority rotation for equal-service scheduling.

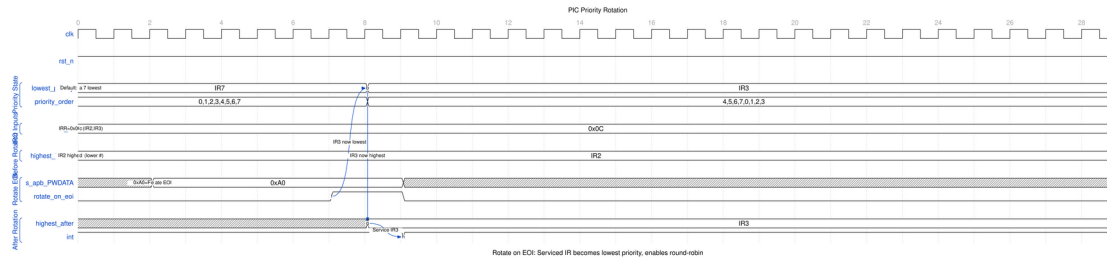

PIC Priority Rotation

Rotate-on-EOI (0xA0) retires the highest-priority in-service level and makes it the lowest priority, implementing round-robin scheduling among interrupt sources. Rotate on specific EOI (0xE0-0xE7) does the same for a named level, set-priority (0xC0-0xC7) moves the base without an EOI, and with rotate-on-AEOI armed (0x80) each acknowledge in AEOI mode rotates exactly once. ICW1 restores the fixed IR0-highest order.

2.4 Navigation

Next: 02_architecture.md (*planned, not yet written*)

RTL Design Sherpa · Learning Hardware Design Through Practice [GitHub](#) · [Documentation Index](#) · [MIT License](#)

3 pic_8259 – Register Map

3.1 Overview

Forget the legacy two-port, A0-based interface of the original 8259A – this block doesn't have one. What you get is a fully-decoded, 32-bit-aligned APB register file: each ICW/OCW and every status register sits at its own dedicated offset, with no A0 pin and no OCW3 read-select multiplexing. The one thing APB cannot give you is an INTA bus cycle, so the acknowledge is a READ of PIC_INTA (0x2C) – the same trick the ARM PL190 VIC plays with VICVectAddr. Reading that register has side effects; its section below spells them out.

Decode is strict. Only the twelve offsets 0x000 through 0x02C exist. Every other address in the 4 KB window is dropped – a write is ignored, a read returns 0x0000_0000 – and the transfer completes with PSLVERR asserted. There is no aliasing: 0x044 is not ICW1 and 0x054 is not the IMR, they are errors. (Earlier RTL decoded six address bits for storage while the side-effect strobes compared all twelve, so an aliased write landed in storage and fired nothing; fixed 2026-09-09, issue #50.)

3.2 Functional Description

3.2.1 Register Map

Offset	Register	Access	Reset	Description
0x00	PIC_CONFIG	RW	0x0000_0004	Global configuration and control (gates all operation)
0x04	PIC_ICW1	WO	—	Initialization Command Word 1 (edge/level, single, ICW4-needed)
0x08	PIC_ICW2	WO	—	Initialization Command Word 2 (interrupt vector base)
0x0C	PIC_ICW3	WO	—	Initialization Command Word 3 (cascade config)
0x10	PIC_ICW4	WO	—	Initialization Command Word 4 (mode bits)

Offset	Register	Access	Reset	Description
0x14	PIC_OCW1	RW	0x0000_00 FF	Operation Command Word 1 - Interrupt Mask Register (IMR)
0x18	PIC_OCW2	WO	—	Operation Command Word 2 (EOI / priority command)
0x1C	PIC_OCW3	WO	—	Operation Command Word 3 (special mask; read-select and poll are storage only)
0x20	PIC_IRR	RO	0x0000_00 00	Interrupt Request Register
0x24	PIC_ISR	RO	0x0000_00 00	In-Service Register
0x28	PIC_STATUS	RO	—	Initialization state and diagnostics
0x2C	PIC_INTA	RO	—	Interrupt acknowledge by read – reading it acknowledges the pending interrupt

Anything else in the window: dropped with PSLVERR.

Access notes: PIC_ICW1-ICW4, PIC_OCW2, and PIC_OCW3 are write-only in the RTL - their read-back paths are tied to zero, so reading these offsets returns 0x0000_0000. PIC_CONFIG, PIC_OCW1 (IMR), PIC_IRR, PIC_ISR, PIC_STATUS and PIC_INTA return meaningful data on a read. PIC_INTA and the two status registers are wires, not storage – what you read is the core’s state in that cycle.

3.2.2 Global Configuration

3.2.2.1 PIC_CONFIG (Offset 0x00, RW)

The PIC is disabled out of reset. Firmware **must** complete the ICW initialization sequence (through PIC_STATUS.init_complete=1) AND set pic_enable before any interrupt request can propagate - IRR only updates once the init FSM reaches INIT_COMPLETE. pic_enable gates delivery, not observation: while it is 0 the core forces int_out low and refuses to acknowledge, but IRR keeps capturing requests and ISR keeps whatever was in service, so a disable/enable cycle

mid-handler neither loses a request nor silently retires a level. The edge detector tracks the synchronized inputs at all times, so a request that drops and rises again inside a disabled window is seen, and enabling never manufactures an edge from a line that was already high. A line that rises between ICW1 and ICW4 is not latched (IRR capture waits for INIT_COMPLETE, and ICW1 clears IRR anyway) and is not manufactured either. OCW2 and OCW3 commands are gated the same way: a write issued before initialization completes, or with `pic_enable=0`, changes the register storage and nothing else – it cannot rotate the priority base or set special mask mode ahead of time.

Bits	Name	Access	Reset	Description
0	<code>pic_enable</code>	RW	0	Master enable (0=disabled, 1=enabled)
1	<code>init_mode</code>	RW	0	Initialization request. Taken on its 0 → 1 edge; consumed by the next ICW1 write
2	<code>auto_reset_init</code>	RW	1	Hardware clears <code>init_mode</code> when ICW4 is written
31:3	Reserved	RO	0	Reserved

`init_mode` is a start REQUEST, not a mode level. The core takes it on its rising edge and arms a re-initialization; the next ICW1 write consumes the request and begins the sequence. If the PIC was already initialized, arming drops the init FSM from INIT_COMPLETE back to INIT_IDLE (so `PIC_STATUS.init_complete` reads 0 until the new sequence finishes), which is the bit's practical use – letting software watch a re-initialization from step 0. Initialization does not otherwise need it: an ICW1 write from INIT_IDLE or INIT_COMPLETE starts the sequence on its own. Holding the bit at 1 afterwards changes nothing, so `auto_reset_init=0` is a legal configuration and INIT_COMPLETE holds with `init_mode` still set.

With `auto_reset_init=1` the hardware clears `init_mode` in the cycle the ICW4 write takes effect. The clear is a hardware-precedence `hwclr` in the register block, so a `PIC_CONFIG` write landing in that same cycle cannot swallow it: the software write still takes for `pic_enable` and `auto_reset_init`, and the clear still wins for bit 1. `auto_reset_init` has no other effect.

Re-initialization: an ICW1 write clears IRR, ISR and special mask mode, disarms rotate-on-AEOI and restores the priority base to 7 (IRQ0 highest), as it does on a real 8259A. Two departures from the datasheet remain. First, only INIT_IDLE and INIT_COMPLETE honor ICW1 as a sequence start – an ICW1 write while the FSM is mid-sequence (WAIT_ICW2/3/4) clears the state above but does not restart the step counter. Second, ICW1 does not touch the ICW4 storage, so an `IC4=0` re-initialization keeps whatever ICW4 last held (reset value `uPM=1`, `AEOI=0`) where a real part would assume zeros; write ICW4 explicitly if AEOI must be off.

3.2.3 Initialization Command Words (ICW)

All ICW registers are write-only; reading them returns 0.

3.2.3.1 PIC_ICW1 (Offset 0x04, WO)

Bit	Name	Reset	Description
0	IC4	0	1 = ICW4 needed, 0 = ICW4 not needed
1	SNGL	0	1 = single mode (no ICW3 in the sequence), 0 = cascade mode (ICW3 expected)
2	ADI	0	Call address interval (8080/8085 mode only; storage)
3	LTIM	0	1 = level triggered, 0 = edge triggered
4	ICW1 Marker	1	Resets to 1 (8259A ICW1 identifier); plain writable storage – hardware does not enforce or check it
31:5	Reserved	0	Reserved (the RTL implements no bits above bit 4)

Note: the RTL stores only bits [4:0]. The legacy A7-A5 vector bits of an MCS-80 8259A are not implemented here. SNGL's only hardware effect is whether the init FSM waits for ICW3.

3.2.3.2 PIC_ICW2 (Offset 0x08, WO)

Bits	Name	Reset	Description
7:0	vector_base	0x00	Interrupt vector base. The vector returned by PIC_INTA is {vector_base[7:3], irq[2:0]}; bits [2:0] written here never reach it
31:8	Reserved	0	Reserved

3.2.3.3 PIC_ICW3 (Offset 0x0C, WO)

Cascade configuration, and it is READ by the core (RLB/pic_8259 TASK-001). Write-only to software, which is the real 8259A behaviour – a read returns 0.

This block has no CAS or SP/EN pins: it acknowledges by an APB read of PIC_INTA, so there is no second INTA pulse on which a master could broadcast a slave ID. The equivalent is that a master whose acknowledged level is marked here returns the SLAVE's vector and forwards the acknowledge down. Covered by dv/tests/test_pic_8259_cascade.py (RLB/pic_8259 TASK-001).

Master mode: | Bits | Description | |——|————| | 7:0 | Bitmap of IR lines that have a slave attached (1 = slave present) |

Slave mode: | Bits | Description | |——|————| | 2:0 | Slave ID (cascade input number 0-7) |

3.2.3.4 PIC_ICW4 (Offset 0x10, WO)

Bit	Name	Reset	Description
0	uPM	1	1 = 8086/8088 mode, 0 = 8080/8085 mode (storage; the vector is always the 8086 form)
1	AEOI	0	Automatic EOI: the acknowledge retires the level at once (see PIC_INTA)
3:2	BUF (M/S)	00	Buffered-mode select: 00=non-buffered, 10=buffered slave, 11=buffered master. Storage only
4	SFNM	0	Special fully nested mode. Storage only – the ordinary fully nested rule runs regardless
31:5	Reserved	0	Reserved

3.2.4 Operation Command Words (OCW)

3.2.4.1 PIC_OCW1 - Interrupt Mask Register (Offset 0x14, RW)

Bits	Name	Access	Reset	Description
7:0	imr	RW	0xFF	Interrupt mask for IRQ0-7: 1 = masked (disabled), 0 = unmasked (enabled)
31:8	Reserved	RO	0	Reserved

Reset masks all eight interrupts.

The register field is the ONE copy of the mask – the core reads it directly, there is no mirror – so readback is exact from the cycle after the write and the new mask reaches the priority resolver in the same cycle. A masked request stays in the IRR (edge mode) or keeps following its pin (level mode) and is delivered once unmasked; `int_out` never asserts for a masked level. The IMR is not written by the init sequence; program it after ICW4.

3.2.4.2 PIC_OCW2 (Offset 0x18, WO)

Bits	Name	Reset	Description
2:0	irq_level (L2-L0)	0	IRQ level for specific EOI or set-priority
4:3	Reserved	0	Reserved (OCW2 identifier field in a legacy 8259A)
7:5	eoi_cmd (R,SL,EOI)	0	EOI / rotation command (see table)
31:8	Reserved	0	Reserved

EOI / rotation command encodings (bits [7:5] = R, SL, EOI), as executed by the RTL. Every command takes effect on the write and only while the PIC is initialized and enabled:

R	SL	EOI	Command	Effect
0	0	0	Rotate on auto EOI (clear)	Disarms rotate-on-AEOI
0	0	1	Non-specific EOI	Clears the highest-priority in-service bit (in the current rotated order); under special mask mode, the highest-priority in-service bit among the levels that are not masked. No-op when nothing qualifies
0	1	1	Specific EOI	Clears ISR[L2-L0]
0	1	0	No operation	Same as a real 8259A
1	0	0	Rotate on auto EOI (set)	Arms rotate-on-AEOI: in AEOI mode

R	SL	EOI	Command	Effect
				each acknowledge then makes the acknowledged level lowest priority
1	0	1	Rotate on non-specific EOI	Clears the highest-priority in-service bit AND makes that level lowest priority. No-op when ISR is empty – the base does not move
1	1	0	Set priority	L2-L0 becomes lowest priority; ISR untouched
1	1	1	Rotate on specific EOI	Clears ISR[L2-L0] and makes L2-L0 lowest priority

“Lowest priority” is the priority base: with base = b the order, highest first, is b+1, b+2, ... , 7, 0, ... , b (mod 8). The reset and post-ICW1 base is 7, giving the familiar IRQ0-highest order. This is a rotation of the level index, not a reflection – with base = 3 the order is 4,5,6,7,0,1,2,3, so IRQ4 outranks IRQ2.

Under the fully nested rule the highest-priority in-service level is the one acknowledged most recently, so a non-specific EOI from a nested handler retires the right level without the handler knowing which one it is. Special mask mode is the one place that ordering breaks – a lower-priority level can be acknowledged on top of a masked in-service one – so the non-specific EOI scan skips in-service levels whose IMR bit is set, exactly the levels SMM has stopped blocking. A handler that masked itself and set SMM is not retired by the EOI of the interrupt it let in.

A write with no byte enables asserted (PSTRB = 0) changes nothing and executes nothing: the command strobes are qualified by the byte enables, so such a write cannot replay the command already stored in OCW2 or ICW1.

3.2.4.3 PIC_OCW3 (Offset 0x1C, WO)

Bits	Name	Reset	Description
1:0	read_reg_cm d (RIS,RR)	00	Read-register select: 00=no action, 10=read IRR, 11=read ISR. Storage only – IRR and ISR

Bits	Name	Reset	Description
2	P	0	have dedicated registers Poll command. Storage only – PIC_INTA supersedes it
4:3	OCW3 Marker	01	Resets to 01 (OCW3 identifier); plain writable storage – not enforced or checked
6:5	ESMM,SMM	00	Special mask mode: 10=reset special mask, 11=set special mask; 0x = no change
31:7	Reserved	0	Reserved

Special mask mode changes what an in-service level blocks. Normally a level in service blocks itself and every lower-priority level until its EOI. With SMM set, an in-service level whose IMR bit is also set stops blocking – requests from every other unmasked level, lower as well as higher, are delivered while it is in service. An in-service level that is NOT masked still blocks as usual. So the idiom is the datasheet one: a handler that wants to let other interrupts in while it runs masks its own level and sets SMM; clearing SMM (or unmasking the level) restores the fully nested rule. SMM takes effect on the write, while the PIC is initialized and enabled, and ICW1 clears it.

3.2.5 Status / Readback Registers

3.2.5.1 PIC_IRR - Interrupt Request Register (Offset 0x20, RO)

Bits	Name	Reset	Description
7:0	irr	0	Pending interrupt requests for IRQ0-7 (1 = request pending)
31:8	Reserved	0	Reserved

IRR reflects requests before masking. In level mode each bit follows its (synchronized) IRQ pin, and the acknowledge leaves it alone – a pin held high re-requests as soon as the level is retired, which is what level-triggered means. In edge mode a bit sets on the rising edge of the synchronized input and clears when that level is acknowledged through PIC_INTA; a fresh edge landing in the acknowledge cycle is kept, not swallowed. An EOI never touches the IRR. Both modes clear the whole register on an ICW1 write or when pic_enable drops.

3.2.5.2 PIC_ISR - In-Service Register (Offset 0x24, RO)

Bits	Name	Reset	Description
7:0	isr	0	In-service bits for IRQ0-7 (1 = interrupt being serviced)
31:8	Reserved	0	Reserved

The live in-service register. A bit sets when its level is acknowledged by a PIC_INTA read and clears on the matching EOI (non-specific, specific, or either rotate variant), on an ICW1 write, or when pic_enable drops. In AEOI mode the acknowledge sets and clears the bit in the same cycle, so it is never observable. Several bits may be set at once when handlers nest.

3.2.5.3 PIC_STATUS (Offset 0x28, RO)

Initialization-state and diagnostic readback. This register is the only way to observe the init sequence progress from software.

Bits	Name	Reset	Description
0	init_complete	-	1 = initialization complete, 0 = in init sequence
3:1	icw_step	-	Current ICW step (0 = not initialized, 4 = complete)
4	int_output	-	Current state of the INT output pin
7:5	highest_priority	-	Highest-priority pending unmasked request in the current rotated order, ignoring the ISR – “which level is next”, not “which level may interrupt now”. Reads 0 when nothing is pending
31:8	Reserved	0	Reserved

3.2.5.4 PIC_INTA - Interrupt Acknowledge (Offset 0x2C, RO, side-effecting)

The 8259A moves a request from the IRR to the ISR during the CPU's INTA bus cycle and puts the vector on the data bus in the second pulse. APB has neither pulse, so a read of PIC_INTA does both jobs in one transfer. Writes are ignored (no side effect, no error).

Bits	Name	Reset	Description
7:0	vector	-	{ICW2.vector_base[7:3], irq[2:0]} of the acknowledged level when valid=1; {vector_base[7:3], 3'b111} (spurious IRQ7) when valid=0
8	valid	-	1 = a request was acknowledged and vector

Bits	Name	Reset	Description
			names it; 0 = nothing was pending, the read had no side effects
31:9	Reserved	0	Reserved

If an unmasked, unblocked request is pending – the same condition that drives `int_out`, so a read can never acknowledge something the pin was not offering – the read:

- returns `valid = 1` and that level's vector. The data is the state BEFORE the acknowledge: `PIC_INTA` is a wire in the register block and the bridge captures it in the same cycle the core registers the side effect;
- sets `ISR[irq]`, which from the next cycle blocks that level and every lower-priority one until EOI;
- clears `IRR[irq]` in edge mode. In level mode the IRR follows the pin and is left alone;
- in AEOI mode also clears `ISR[irq]` in the same cycle, and if rotate-on-AEOI is armed (`OCW2 0x80`) moves the priority base to the acknowledged level – exactly once per acknowledge.

If nothing is pending the read returns `valid = 0` with the spurious vector and changes nothing. That is the 8259A's spurious-IRQ7 convention; check `valid` rather than decoding the vector.

`int_out` drops in the cycle after the acknowledge unless another request of higher priority than everything now in service is waiting – with the in-service block, that means a HIGHER-priority level. A second edge on the level just acknowledged sets its IRR bit again but is held off until its EOI.

Programming sequence. With `pic_enable=1` and initialization complete:

1. `int_out` asserts (`PIC_STATUS.int_output` reads 1).
2. Read `PIC_INTA`. If `valid=0`, the interrupt was spurious – return without an EOI. Otherwise `vector[2:0]` is the level and `vector` is the full interrupt number.
3. Service the device. A higher-priority request can assert `int_out` during this step; a handler that re-enables CPU interrupts may re-enter at step 2 for it, and that nested handler's EOI retires the nested level first.
4. Write `PIC_OCW2`: non-specific EOI (`0x20`) or specific EOI (`0x60 | level`), or the rotate variants (`0xA0`, `0xE0 | level`) for round-robin service. In AEOI mode skip this step – the acknowledge already retired the level.

3.3 Design Notes

The register file above matches the RTL exactly. The behaviors that follow are the ones a datasheet reader would otherwise assume or overlook:

- **Priority and the INT pin.** A level is eligible when it is requesting, unmasked, and no level of equal or higher priority is in service. `int_out` is the OR of eligible levels (while initialized and enabled); the same predicate chooses what `PIC_INTA` acknowledges. An in-service level blocks itself and everything below it until its EOI; a higher-priority level still preempts. Special mask mode is the one exception, described under `OCW3`.
- **Timing.** `irq_in` may be asynchronous. It passes a `SYNC_STAGES`-flop synchronizer (default 2, minimum 2) before the edge detector, so a pin transition reaches the `IRR` `SYNC_STAGES + 1` clocks later and `int_out`, which is combinational from the `IRR`, `IMR` and `ISR`, follows in that cycle – about three `pclk` periods at the default. Register writes (`IMR`, `OCW2`, `OCW3`) act one cycle after the APB access phase; `PIC_INTA` acts in the access cycle.
- **Software-visible storage with no hardware effect.** `ICW4` `BUF` and `SFNM`, `OCW3` read-register-select and poll, and `ICW1` `ADI` are stored and never read by the core. There is no special fully nested mode. `ICW3` is NO LONGER in this list (RLB/pic_8259 TASK-001): it is read by the core and selects the cascade level. There are still no `CAS` or `SP/EN` pins – see the `PIC_ICW3` notes above for the acknowledge-by-read equivalent. `IRR` and `ISR` are dedicated registers, so the read-select command has nothing to select; the poll command is superseded by `PIC_INTA`, which returns the same “is there an interrupt, and which” answer with the acknowledge folded in. `auto_reset_init` affects only the clearing of `init_mode`.
- **History.** The acknowledge-by-read path, live `ISR`, EOI/nesting/SMM semantics, one-shot rotate-on-AEOI, single-copy `IMR`, gated `OCW2/OCW3`, edge-taken `init_mode`, strict decode with `PSLVERR` and the input synchronizer all landed together on 2026-09-09 (issue #50). Before that the block had no acknowledge at all, so the `ISR` never set and an edge request never cleared.

3.4 Navigation

Back to: [PIC 8259 Specification Index](#)