27 JAN 2022


ō

24 FEB

WAAS Rwy Idg 11002 APP CRS CH 40406 TDZE 21 187º Apt Elev W19B

## RNAV (GPS) RWY 19R TAMPA INTL (TPA)

For uncompensated Baro-VNAV systems, LNAV/VNAV NA below -15°C (5°F) or above  $43^{\circ}$ C (109°F). DME/DME RNP-0.3 NA. For inop MALSR, increase LPV Cat E visibility to MISSED APPROACH: Climb MALSR to 800 then climbing right  $^{9}\!\!4$  mile, LNAV/VNAV Cat E visibility to 1% mile, and LNAV Cat E visibility to 1% . Simultaneous approach authorized with Rwy 19L. LNAV procedure NA during turn to 3000 direct JACKT **A**5 **1** and hold, continue

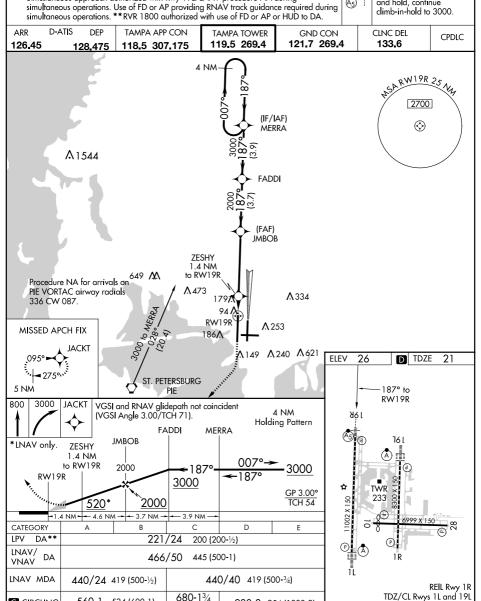

TAMPA, FLORIDA Amdt 2D 08OCT20

**C** CIRCLING

560-1 534 (600-1)

TAMPA INTL (TPA) RNAV (GPS) RWY 19R

HIRL Rwys 1L-19R, 1R-19L, and 10-28

654 (700-134)

980-3 954 (1000-3)