SC-5,

27 JAN 2022

ō

24 FEB

Rwy 33R Idg12001 Rwy 33L Idg 10000 LOC I-CDG APP CRS TDŹE 89 TDŹE 90 111.9 329° Apt Elev 96 Apt Elev 96


ILS or LOC RWY 33R

MISSED APPROACH: Climb to

GEORGE BUSH INTCNTL/HOUSTON (IAH)

MALSR



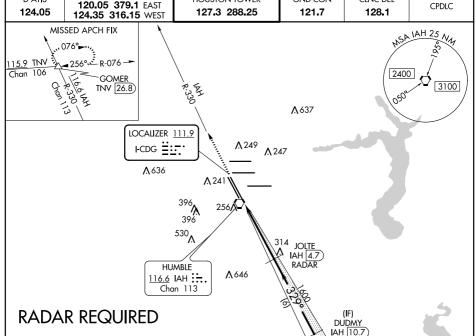

ELEV 96 <b>D</b> TDZE 33L 90	7		/	IAH [10.7]	)	3	
TDZ/CL Rwys 8R, 8L, TDZE 33R 89 15R, 26R, 26L, 27 and 33L		49 <b>1</b> 049	\	<b>50</b>		7	
HIRL all Rwys  A annu X 1 50 % A	2000	OMER	101				
\$\\\\\\\\\\\\\\\\\\\\\\\\\\\\\\\\\\\\\	IAH R-330 *LOC only.		JOI IAH RAD	4.7)		UDMY H 10.7	
\$\frac{\infty}{\sqrt{22}}\fra		*IAH	16	00	329°-	2000	
TWR (A) 422 (B) 10000 x 150 (C)	• • • • • • • • • • • • • • • • • • •			1600		GS 3.00° TCH 49	
V (33)	CATEGORY	1.3 NM - A	3.3 NM B	C	D D	E	
329° 4.6 NM	S-ILS 33R	S-ILS 33R # 289/24 200 (200-1/2)					
from FAF \ FAF to MAP 4.6 NM	S-LOC 33R	540/24	451 (500-1/2)	540	<b>)/45</b> 451 (50	0-%)	

540-1 450 (500-1)

SIDESTEP

Rwy 33L

Min:Sec 4:36 HOUSTON, TEXAS Amdt 13A 23JUN16

60 90 120 150 180

> 3:04 2:18 1:50

Knots

450 (500-11/2) 450 (500-2) ILS or LOC RWY 33R 29°59′N-95°20′W

540-11/2

540-2

NA