SE-4,

27 JAN 2022

ō

24 FEB

WAAS Rwy Idg 12600 APP CRS CH 58206 TDŹE 629 185° Apt Elev 629 **W18B** 


## RNAV (GPS) RWY 18R

HUNTSVILLE INTL-CARL T JONES FLD (HSV)

RNP APCH-GPS Circling NA for Cats C/D/E east of Rwy 18L-36R. Simultaneous approach authorized. LNAV procedure NA during simultaneous operations. Use of FD or AP required during simultaneous operations. For uncompensated Baro-VNAV systems, LNAV/VNAV NA below -8 °C or above 54°C. For inop ALS, increase LPV Cat E visibility to RVR 4000, LNAV/VNAV Cat E visibility to RVR 5000, and LNAV Cat E visibility to 11/4 SM.

ALSF-2 MISSED APPROACH: Climb to 3100 direct BOSAC and hold. (Ā)

ATIS HUNTSVILLE APP CON ★ UNICOM HUNTSVILLE TOWER ★ **GND CON** CLNC DEL 121.25 125.6 354.1 127.6 (CTAF) 0 350.35 121.9 269.525 120.35

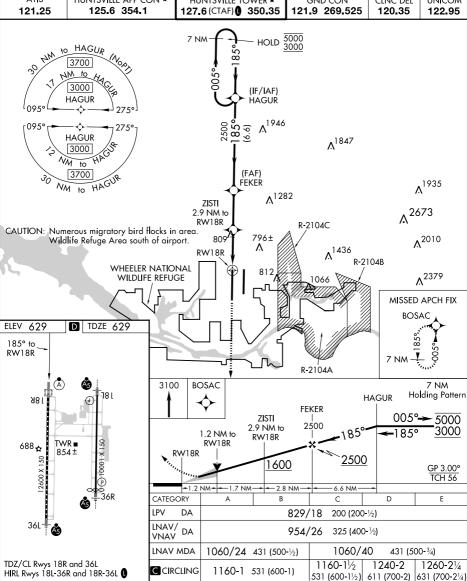

HUNTSVILLE, ALABAMA Amdt 3 27JAN22

HUNTSVILLE INTL-CARL T JONES FLD (HSV)