
LOC/DME I-OJP Rwy Idg 11601 APP CRS 110.7 TDŹE 92 005° Apt Elev 96 Chan 44

ILS RWY 36R (SA CAT I)

ORLANDO INTL (MCO)

MISSED APPROACH: Climb to 500 then climbing left turn to 3000 on heading 309° and ORL R-248 to DNMOR ORL 6 DME and hold, continue DME or RADAR required. Simultaneous approach authorized ALSF-2 Requires specific OPSPEC, MSPEC or LOA approval and Ŧ use of HUD to DH climb-in-hold to 3000

D-ATIS ORLANDO TOWER **GND CON** CLNC DEL ORLANDO APP CON 121,25 (Rwys 17L-35R,17R-35L) 126.4 (East) ARR 118.45 253.5 134.7 CPDLC 124.8 307.0 DEP 120.525 (Rwys 18L-36R,18R-36L) 121.8 (West) 124.3 253.5 341.7

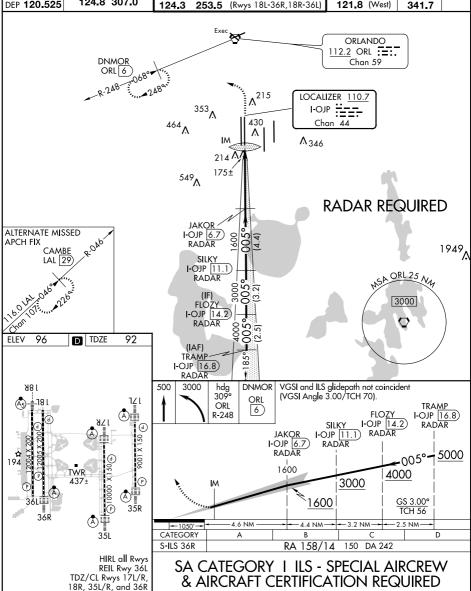

ORLANDO, FLORIDA Amdt 11 12OCT17

JAN 2022

ō

24 FEB

3 2022

ORLANDO INTL (MCO) ILS RWY 36R (SA CAT I)