NC-3,

27 JAN 2022

ō

24 FEB 2022

VORTAC SGF Rwy Idg 7003 APP CRS 116.9 TDŹE 1265 016° Apt Elev 1268 Chan 116


VOR/DME or TACAN RWY 2

SPRINGFIELD-BRANSON NTL (SGF)

For inoperative MALSR, increase S-2 Cat A and B visibility to RVR 5000 and Cat E to 11/2. When local altimeter setting not received, use Monett altimeter setting and increase all MDA 100 feet, increase Circling Cat C to 13/4 mile. VDP NA when using Monett altimeter setting.

MALSR

MISSED APPROACH: Climb to 3000 direct SGF VORTAC and hold (TACAN Aircraft continue on SGF R-024 to PLADD INT/SGF 18.4 DME and hold, north, right turns, 204° inbound).

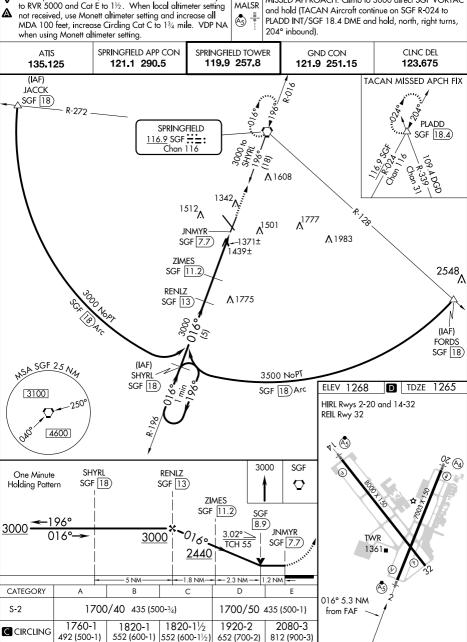

SPRINGFIELD, MISSOURI Orig-D 28MAY15

SPRINGFIELD-BRANSON NTL (SGF) VOR/DME or TACAN RWY 2