D-ATIS

124.05

SC-5,

27 JAN 2022

ಠ

24 FEB 2022

CPDLC

MISSED APCH FIX

4 NM TDZE

 D

LAAS Rwy Idg 10000 APP CRS CH 21895 TDŹE 91 087° Apt Elev RPI GUYO 96

GLS RWY 9 GEORGE BUSH INTCNTL/HOUSTON (IAH)

CLNC DEL

128,1

For inop MALSR, increase GLS all Cats visibility to RVR 4000. Simultaneous MALSR A NA approach authorized with Rwys 8L/R. DME/DME RNP-0.3 NA. Use of FD MISSED APPROACH: Climb to 580 then climbing right turn to or AP providing RNAV track guidance required during simultaneous operations. 3000 direct JEBOX and hold. GPS required. Autoland approach NA. **RVR 1800 authorized with use of FD or AP or HUD to DA. HOUSTON APP CON

GND CON

118,575

HOUSTON TOWER


135.15 290.2


RADAR REQUIRED


120.05 379.1 EAST


124.35 316.15 WEST





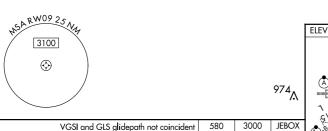

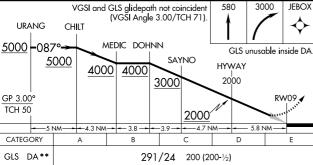

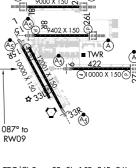

646 A

96

TDZ/CL Rwys 8R, 8L, 15R, 26R, 26L, 27 and 33L HIRL all Rwys

HOUSTON, TEXAS Amdt 1B 07DEC17

GEORGE BUSH INTCNTL/HOUSTON (IAH)GLS RWY 9