Chapter 17

Failure-Time Regression Analysis

William Q. Meeker and Luis A. Escobar

Iowa State University and Louisiana State University

Copyright 1998-2004 W. Q. Meeker and L. A. Escobar. Based on the authors' text *Statistical Methods for Reliability Data*, John Wiley & Sons Inc. 1998.

January 5, 2006 19h 15min

17 - 1

Chapter 17 Failure-Time Regression Analysis Objectives

- Describe applications of failure-time regression
- Describe graphical methods for displaying censored regression data.
- Introduce time-scaling transformation functions.
- Describe simple regression models to relate life to explanatory variables.
- Illustrate the use of likelihood methods for censored regression data.
- Explain the importance of model diagnostics.
- Describe and illustrate extensions to nonstandard multiple regression models

17-2


Computer Program Execution Time Versus System Load

- Time to complete a computationally intensive task.
- Information from the Unix uptime command
- Predictions needed for scheduling subsequent steps in a multi-step computational process.

17 - 3

17 - 5

Scatter Plot of Computer Program Execution Time Versus System Load

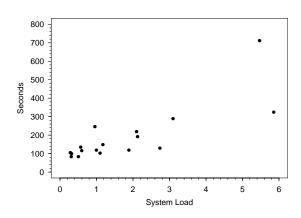

17 - 4

Explanatory Variables for Failure Times

Useful explanatory variables explain/predict why some units fail quickly and some units survive a long time.

- Continuous variables like stress, temperature, voltage, and pressure.
- Discrete variables like number of hardening treatments or number of simultaneous users of a system.
- Categorical variables like manufacturer, design, and location.

Regression model relates failure time distribution to explanatory variables $x = (x_1, \dots, x_k)$:

$$Pr(T \le t) = F(t) = F(t; x).$$

Failure-Time Regression Analysis

• Material in this chapter is an **extension** of statistical regression analysis with normal distributed data and

$$\mathsf{mean} = \beta_0 + \beta_1 x_1 + \dots + \beta_s x_k$$

where the x_i are explanatory variables.

- The ideas presented here are more general:
 - ▶ Data not necessarily from a normal distribution.
 - ▶ Data may be censored.
 - ▶ Nonstandard regression models that relate life to explanatory variables.
- Presentation motivated by practical problems in reliability analysis.

Nickel-Base Super-alloy Fatigue Data 26 Observations in Total, 4 Censored (Nelson 1984, 1990)


Originally described and analyzed by Nelson (1984 and 1990).

- Thousands of cycles to failure as a function of pseudostress in ksi.
- 26 units tested; 4 units did not fail.

Objective: Explore models that might be used to describe the relationship between life length and the amount of pseudostress applied to the tested specimens.


17 - 7

Nickel-Base Super-Alloy Fatigue Data (Nelson 1984, 1990)

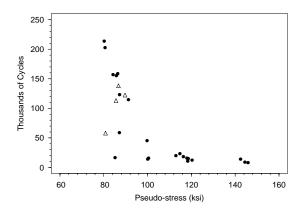

17-8

SAFT Models Illustrating Acceleration and Deceleration.

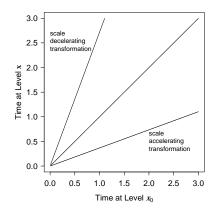

17 - 9

Scale Accelerated Failure Time (SAFT) Model

 Scale Accelerated Failure Time (SAFT) models are defined by

$$T(x)=T(x_0)/\mathcal{AF}(x),\quad \mathcal{AF}(x)>0,\quad \mathcal{AF}(x_0)=1$$
 where typical forms for $\mathcal{AF}(x)$ are:

- ▶ $\log[\mathcal{AF}(x)] = \beta_1 x$ with $x_0 = 0$ for a scalar x.
- ▶ $\log[\mathcal{AF}(x)] = \beta_1 x_1 + \ldots + \beta_k x_k$ with $x_0 = \underline{0}$ for a vector $x = (x_1, \ldots, x_k)$.
- When $\mathcal{AF}(x) > 1$, the model accelerates time in the sense that time moves more quickly at x than at x_0 so that $T(x) < T(x_0)$.
- When $0 < \mathcal{AF}(x) < 1$, $T(x) > T(x_0)$, and time is decelerated (but we still call this an SAFT model).

17 - 10

The SAFT Transformation Models and Acceleration

In a time transformation plot of $T(x_0)$ vs T(x)

- The **SAFT** models are straight lines **through** the origin:
- Accelerating SAFT models are straight lines below the diagonal.
- Decelerating SAFT models are straight lines above the diagonal.

Some Properties of SAFT Models

For a **SAFT** model $T(x)=T(x_0)/\mathcal{AF}(x)$, $(\Psi(x)>0)$, with baseline cdf $F(t;x_0)$ so $\mathcal{AF}(x_0)=1$


- Scaled time: $F(t;x) = F[\mathcal{AF}(x)t;x_0]$. Thus the cdfs F(t;x) and $F(t;x_0)$ do **not** cross each other.
- Proportional quantiles: $t_p(x) = t_p(x_0)/\mathcal{AF}(x)$. Then taking logs gives

$$\log[t_p(x_0)] - \log[t_p(x)] = \log[\mathcal{AF}(x)].$$

This shows that in any plot with a log-time scale $t_p(x_0)$ and $t_p(x)$ are equidistant.

In particular, in a probability plot with a log-time scale, F(t,x) is a translation of $F(t,x_0)$ along the $\log(t)$ axis.

Weibull Probability Plot of Two Members from an SAFT Model with a Baseline Lognormal Distribution

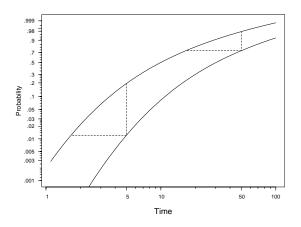

17 - 13

Lognormal Distribution Simple Regression Model with Constant Shape Parameter $\beta=1/\sigma$

• The lognormal simple regression model is

$$\Pr(T \leq t) = F(t; \mu, \sigma) = F(t; \beta_0, \beta_1, \sigma) = \Phi_{\mathsf{nor}} \left[\frac{\log(t) - \mu}{\sigma} \right]$$

where $\mu = \mu(x) = \beta_0 + \beta_1 x$ and σ does not depend on x.

• The failure-time log quantile function

$$\log[t_p(x)] = \mu(x) + \Phi_{\mathsf{nor}}^{-1}(p)\sigma$$

is linear in x.


Notice that

$$\frac{t_p(x)}{t_n(0)} = \exp\left(\beta_1 x\right)$$

implies that this regression model is a scale accelerated failure time (SAFT) model with $\mathcal{AF}(x) = \exp(-\beta_1 x)$.

17 - 14

Computer Program Execution Time Versus System Load Log-Linear Lognormal Regression Model $\log[\hat{t}_p(x)] = \hat{\mu}(x) + \Phi_{\mathsf{nor}}^{-1}(p)\hat{\sigma}$

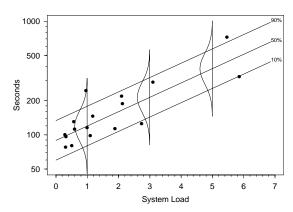

17 - 15

Likelihood for Lognormal Distribution Simple Regression Model with Right Censored Data

The likelihood for n independent observations has the form

$$\begin{split} L(\beta_0,\beta_1,\sigma) &=& \prod_{i=1}^n L_i(\beta_0,\beta_1,\sigma;\mathrm{data}_i) \\ &=& \prod_{i=1}^n \left\{\frac{1}{\sigma t_i}\phi_{\mathrm{nor}}\left[\frac{\log(t_i)-\mu_i}{\sigma}\right]\right\}^{\delta_i} \left\{1-\Phi_{\mathrm{nor}}\left[\frac{\log(t_i)-\mu_i}{\sigma}\right]\right\}^{1-\delta_i} \end{split}$$

where data_i = (x_i, t_i, δ_i) , $\mu_i = \beta_0 + \beta_1 x_i$,

$$\delta_i = \left\{ \begin{array}{ll} 1 & \text{ exact observation} \\ 0 & \text{ right censored observation} \end{array} \right.$$

 $\phi_{\rm nor}(z)$ is the standardized normal pdf and $\Phi_{\rm nor}(z)$ is the corresponding normal cdf.

The parameters are $\theta = (\beta_0, \beta_1, \sigma)$.

17 - 16

Estimated Parameter Variance-Covariance Matrix

Local (observed information) estimate

$$\begin{split} \widehat{\Sigma}_{\widehat{\theta}} \; &= \; \begin{bmatrix} \widehat{\text{Var}}(\widehat{\beta}_0) & \widehat{\text{Cov}}(\widehat{\beta}_0,\widehat{\beta}_1) & \widehat{\text{Cov}}(\widehat{\beta}_0,\widehat{\sigma}) \\ \widehat{\text{Cov}}(\widehat{\beta}_1,\widehat{\beta}_0) & \widehat{\text{Var}}(\widehat{\beta}_1) & \widehat{\text{Cov}}(\widehat{\beta}_1,\widehat{\sigma}) \\ \widehat{\text{Cov}}(\widehat{\sigma},\widehat{\beta}_0) & \widehat{\text{Cov}}(\widehat{\sigma},\widehat{\beta}_1) & \widehat{\text{Var}}(\widehat{\sigma}) \end{bmatrix} \\ &= \; \begin{bmatrix} -\frac{\partial^2 \mathcal{L}(\beta_0,\beta_1,\sigma)}{\partial \beta_0^2} & -\frac{\partial^2 \mathcal{L}(\beta_0,\beta_1,\sigma)}{\partial \beta_0\partial \beta_1} & -\frac{\partial^2 \mathcal{L}(\beta_0,\beta_1,\sigma)}{\partial \beta_0\partial \sigma} \\ -\frac{\partial^2 \mathcal{L}(\beta_0,\beta_1,\sigma)}{\partial \beta_1\partial \beta_0} & -\frac{\partial^2 \mathcal{L}(\beta_0,\beta_1,\sigma)}{\partial \beta_1^2} & -\frac{\partial^2 \mathcal{L}(\beta_0,\beta_1,\sigma)}{\partial \beta_1\partial \sigma} \\ -\frac{\partial^2 \mathcal{L}(\beta_0,\beta_1,\sigma)}{\partial \sigma \partial \beta_0} & -\frac{\partial^2 \mathcal{L}(\beta_0,\beta_1,\sigma)}{\partial \sigma \partial \beta_1} & -\frac{\partial^2 \mathcal{L}(\beta_0,\beta_1,\sigma)}{\partial \sigma} \\ \end{bmatrix}^{-1} \end{split}$$

Partial derivatives are evaluated at $\hat{\beta}_0, \hat{\beta}_1, \hat{\sigma}$.

Standard Errors and Confidence Intervals for Parameters

• Lognormal ML estimates for the computer time experiment were $\hat{\theta}=(\hat{\beta}_0,\hat{\beta}_1,\hat{\sigma})=(4.49,.290,.312)$ and an estimate of the variance-covariance matrix for $\hat{\theta}$ is

$$\hat{\Sigma}_{\hat{\theta}} = \begin{bmatrix} .012 & -.0037 & 0 \\ -.0037 & .0021 & 0 \\ 0 & 0 & .0029 \end{bmatrix}$$

• Normal-approximation confidence interval for the computer execution time regression slope is

$$[\beta_1, \quad \tilde{\beta}_1] = \hat{\beta}_1 \pm z_{(.975)} \widehat{\text{se}}_{\hat{\beta}_1} = .290 \pm 1.96(.046) = [.20, \quad .38]$$

where $\widehat{se}_{\widehat{\beta}_1} = \sqrt{.0021} = .046$.

Standard Errors and Confidence Intervals for Quantities at Specific Explanatory Variable Conditions

- ullet Unknown values of μ and σ at each level of x
- $\hat{\mu} = \hat{\beta}_0 + \hat{\beta}_1 x$, σ does not depend on x, and


$$\widehat{\Sigma}_{\widehat{\mu},\widehat{\sigma}} = \begin{bmatrix} \widehat{\mathsf{Var}}(\widehat{\mu}) & \widehat{\mathsf{Cov}}(\widehat{\mu},\widehat{\sigma}) \\ \widehat{\mathsf{Cov}}(\widehat{\mu},\widehat{\sigma}) & \widehat{\mathsf{Var}}(\widehat{\sigma}) \end{bmatrix}$$

is obtained from $\widehat{\mathsf{Var}}(\widehat{\mu}) = \widehat{\mathsf{Var}}(\widehat{\beta}_0) + 2x\widehat{\mathsf{Cov}}(\widehat{\beta}_1,\widehat{\beta}_0) + x^2\widehat{\mathsf{Var}}(\widehat{\beta}_1)$ and $\widehat{\mathsf{Cov}}(\widehat{\mu},\widehat{\sigma}) = \widehat{\mathsf{Cov}}(\widehat{\beta}_0,\widehat{\sigma}) + x\widehat{\mathsf{Cov}}(\widehat{\beta}_1,\widehat{\sigma})$.

- Use the above results with the methods from Chapter 8 to compute normal-approximation confidence intervals for F(t), h(t), and t_p .
- Could also use likelihood or simulation-based confidence intervals.

17 - 19

Log-Quadratic Weibull Regression Model with Constant ($\beta=1/\sigma$) Fit to the Fatigue Data $\log[\hat{t}_p(x)]=\hat{\mu}(x)+\Phi_{\rm SeV}^{-1}(p)\hat{\sigma}$, $x=\log({\it pseudo-stress})$ $\hat{\mu}=\hat{\beta}_0+\hat{\beta}_1x+\hat{\beta}_2x^2$

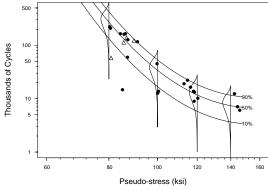

17 - 20

Weibull Distribution Quadratic Regression Model with Constant Shape Parameter $\beta=1/\sigma$

This is an AF time model with the following characteristics:

• The Weibull quadratic regression model is

$$\Pr[T < t] = \Phi_{\text{sev}} \{ \lceil \log(t) - \mu \rceil / \sigma \}$$

where $\mu = \mu(x) = \beta_0 + \beta_1 x + \beta_2 x^2$ and σ does not depend on x

• The failure-time log quantile function

$$\log[t_p(x)] = \mu(x) + \Phi_{\text{SeV}}^{-1}(p)\sigma$$

is quadratic in x. Also

$$t_p(x) = \exp(\beta_1 x + \beta_2 x^2) \times t_p(0)$$

which shows that the model is an SAFT model.

17 - 21

Likelihood for Weibull Distribution Quadratic Regression Model with Right Censored Data

The likelihood for n independent observations has the form

$$\begin{split} L(\beta_0,\beta_1,\beta_2,\sigma) &= \prod_{i=1}^n L_i(\beta_0,\beta_1,\beta_2,\sigma;\mathsf{data}_i) \\ &= \prod_{i=1}^n \left\{ \frac{1}{\sigma t_i} \phi_{\mathsf{Sev}} \left\lceil \frac{\log(t_i) - \mu_i}{\sigma} \right\rceil \right\}^{\delta_i} \left\{ 1 - \Phi_{\mathsf{Sev}} \left\lceil \frac{\log(t_i) - \mu_i}{\sigma} \right\rceil \right\}^{1-\delta_i}. \end{split}$$


where $\mu_i = \beta_0 + \beta_1 x_i + \beta_2 x_i^2$,

$$\delta_i = \left\{ \begin{array}{ll} 1 & \text{ exact observation} \\ 0 & \text{ right censored observation} \end{array} \right.$$

The parameters are $\theta = (\beta_0, \beta_1, \beta_2, \sigma)$.

17 - 22

Log-quadratic Weibull Regression Model with Nonconstant $\beta=1/\sigma$ Fit to the Fatigue Data $\log[\hat{t}_p(x)]=\hat{\mu}(x)+\Phi_{\text{SeV}}^{-1}(p)\hat{\sigma}(x)$ $x=\log(\text{pseudo-stress})$ $\hat{\mu}=\hat{\beta}_0+\hat{\beta}_1x+\hat{\beta}_2x^2$, $\log(\hat{\sigma})=\hat{\beta}_0^{[\sigma]}+\hat{\beta}_1^{[\sigma]}x$.

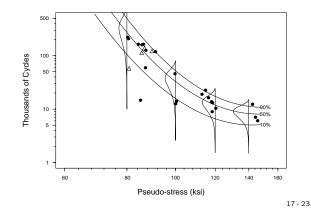

Weibull Distribution Quadratic Regression Model with Nonconstant $\beta=1/\sigma$

• The Weibull quadratic regression model is

$$\begin{split} \Pr[T \leq t] &= \Phi_{\text{SeV}}\left\{[\log(t) - \mu]/\sigma\right\}, \\ \text{where } \mu = \mu(x) &= \beta_0^{[\mu]} + \beta_1^{[\mu]} x + \beta_2^{[\mu]} x^2 \text{ and } \\ \log(\sigma) &= \log[\sigma(x)] = \beta_0^{[\sigma]} + \beta_1^{[\sigma]} x. \end{split}$$

• The failure-time log quantile function is

$$\log[t_p(x)] = \mu(x) + \Phi_{\text{sev}}^{-1}(p)\sigma(x)$$

which is \mbox{not} quadratic in x. Also

$$t_p(x) = \exp\left[\mu(x) - \mu(0)\right] \exp\left[\Phi_{\text{SeV}}^{-1}(p) \left\{\sigma(x) - \sigma(0)\right\}\right] \times t_p(0).$$

Because the coefficient in front of $t_p(\mathbf{0})$ depends on p this shows that the model is **not** an SAFT model.

Likelihood for Weibull Distribution Quadratic Regression Model with Nonconstant $\beta=1/\sigma$ and Right Censored Data


The likelihood for n independent observations has the form

$$\begin{split} &L(\beta_0^{[\mu]},\beta_1^{[\mu]},\beta_2^{[\mu]},\beta_0^{[\sigma]},\beta_1^{[\sigma]})\\ &= \prod_{i=1}^n L_i(\beta_0^{[\mu]},\beta_1^{[\mu]},\beta_2^{[\mu]},\beta_0^{[\sigma]},\beta_1^{[\sigma]}; \mathrm{data}_i)\\ &= \prod_{i=1}^n \left\{\frac{1}{\sigma_i t_i} \phi_{\mathrm{SEV}} \left[\frac{\log(t_i) - \mu_i}{\sigma_i}\right]\right\}^{\delta_i} \left\{1 - \Phi_{\mathrm{SEV}} \left[\frac{\log(t_i) - \mu_i}{\sigma_i}\right]\right\}^{1 - \delta_i}. \end{split}$$
 where $\mu_i = \beta_0^{[\mu]} + \beta_1^{[\mu]} x_i + \beta_2^{[\mu]} x_i^2 \text{ and } \sigma_i = \exp\left(\beta_0^{[\sigma]} + \beta_1^{[\sigma]} x_i\right).$

Parameters are $\boldsymbol{\theta} = (\beta_0^{[\mu]}, \beta_1^{[\mu]}, \beta_2^{[\mu]}, \beta_0^{[\sigma]}, \beta_1^{[\sigma]}).$


17 - 25

Stanford Heart Transplant Data Quadratic Log-Mean Lognormal Regression Model

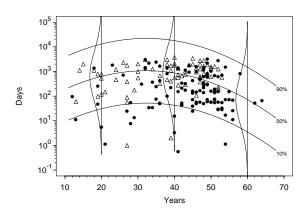

17 - 26

Stanford Heart Transplant Data Quadratic Log-Location Weibull Regression Model

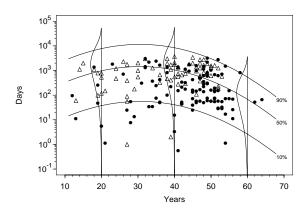

17 - 27

Extrapolation and Empirical Models

- Empirical models can be useful, providing a smooth curve to describe a population or a process.
- Should not be used to extrapolate outside of the range of one's data.
- There are many different kinds of extrapolation
 - ▶ In an explanatory variable like stress
 - ▶ To the upper tail of a distribution
 - ► To the lower tail of a distribution
- Need to get the right curve to extrapolate: look toward physical or other process theory

17 - 28

Checking Model Assumptions

- Graphical checks using generalizations of usual diagnostics (including residual analysis)
 - ► Residuals versus fitted values.
 - ▶ Probability plot of residuals.
 - ► Other residual plots.
 - ► Influence analysis (or sensitivity) analysis. (see Escobar and Meeker 1992 Biometrics).
- Most analytical tests can be suitably generalized, at least approximately, for censored data (especially using likelihood ratio tests).

Definition of Residuals

 For location-scale distributions like the normal, logistic, and smallest extreme value,

$$\hat{\epsilon}_i = \frac{y_i - \hat{y}_i}{\hat{\sigma}}$$

where \hat{y}_i is an appropriately defined fitted value (e.g., $\hat{y}_i = \hat{\mu}_i).$


 With models for positive random variables like Weibull, lognormal, and loglogistic, standardized residuals are defined

$$\exp(\hat{\epsilon}_i) = \exp\left[\frac{\log(t_i) - \log(\hat{t}_i)}{\hat{\sigma}}\right] = \left(\frac{t_i}{\hat{t}_i}\right)^{\frac{1}{\hat{\sigma}}}$$


where $\hat{t_i}=\exp(\hat{\mu}_i)$ and when t_i is a censored observation, the corresponding residual is also censored.

17 - 29

Plot of Standardized Residuals Versus Fitted Values for the Log-Quadratic Weibull Regression Model Fit to the Super Alloy Data on Log-Log Axes

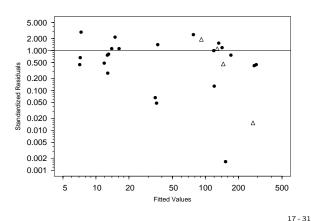

Probability Plot of the Standardized Residuals from the Log-Quadratic Weibull Regression Model Fit to the Super Alloy Data

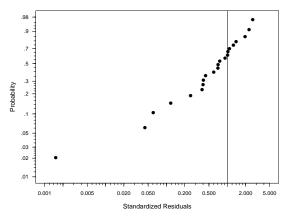

17 - 32

Empirical Regression Models and Sensitivity Analysis Objectives

- Describe a class of regression models that can be used to describe the relationship between failure time and explanatory variables.
- Describe and illustrate the use of empirical regression models.
- Illustrate the need for sensitivity analysis.
- Show how to conduct a sensitivity analysis.


17 - 33

Picciotto Yarn Failure Data (Picciotto 1970)


- Cycles to failure on specimens of yarn of different lengths.
- Subset of data at particular level of stress and particular specimen lengths (30mm, 60mm, and 90mm)
- Original data were uncensored. For purposes of illustration, the data censored at 100 thousand cycles.
- Suppose that the goal is to estimate life for 10 mm units.

17 - 34

Picciotto Yarn Failure Data Showing Fraction Failing at Each Length

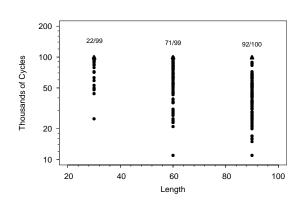


Picciotto Yarn Failure Data Multiple Weibull Probability Plot with Weibull ML Estimates

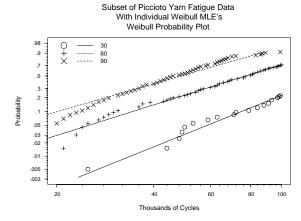

17 - 35

Picciotto Yarn Failure Data Multiple Lognormal Probability Plot with Lognormal ML Estimates

Subset of Piccioto Yarn Fatigue Data

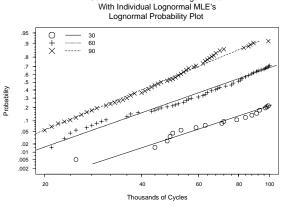


17 - 37

Suggested Strategy for Fitting Empirical Regression Models and Sensitivity Analysis

- Use data and previous experience to choose a base-line model:
 - ▶ Distribution at individual conditions
 - Relationship between explanatory variables and distributions at individual conditions
- Fit models
- Use diagnostics (e.g., residual analysis) to check models
- · Assess uncertainty
 - ▶ Confidence intervals quantify statistical uncertainty
 - Perturb and otherwise change the model and reanalyze (sensitivity analysis) to assess model uncertainty.

17 - 38


Picciotto Yarn Failure Data Multiple Lognormal Probability Plot with Lognormal ML Log-Linear Regression Model **Estimates**

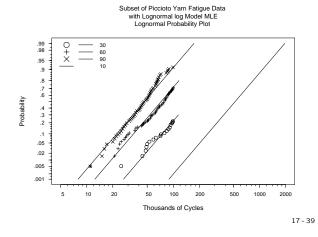


Scatter Plot of the Picciotto Yarn Failure Data with Lognormal ML Log-Linear Regression Model **Estimate Densities**

$$\log[\hat{t}_p(x)] = \hat{\beta}_0 + \hat{\beta}_1 \log(\text{Length}) + \Phi_{\text{nor}}^{-1}(p)\hat{\sigma}$$


Subset of Piccioto Yarn Fatigue Data

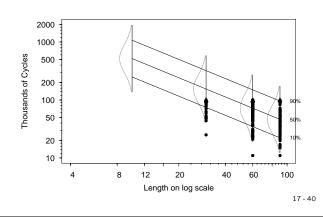

Picciotto Yarn Failure Data Log-Linear Model Residual vs Fitted Values Plot

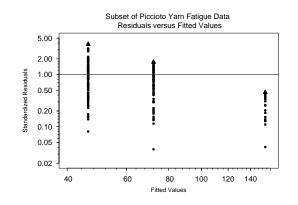


Picciotto Yarn Failure Data Multiple Lognormal Probability Plot with Lognormal ML Squareroot-Linear Regression Model **Estimates**

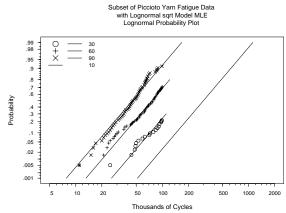


Scatter Plot of the Picciotto Yarn Failure Data with Lognormal ML Squareroot-Linear Regression Model Estimate Densities

 $\log[\hat{t}_p(x)] = \hat{\beta}_0 + \hat{\beta}_1 \sqrt{\text{Length}} + \Phi_{\text{nor}}^{-1}(p)\hat{\sigma}$

Subset of Piccioto Yarn Fatigue Data

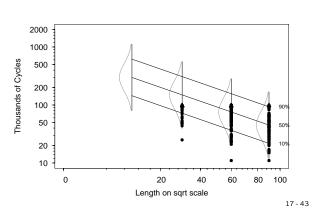

Picciotto Yarn Failure Data Squareroot-Linear Model Residual vs Fitted Values Plot

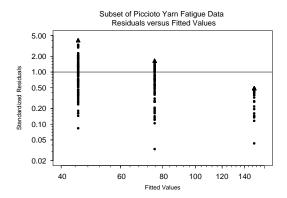

17 - 44

Examples of Monotone Increasing Power Transformations of a Positive Explanatory Variable

$$\begin{array}{cccc} \lambda & \text{Transformation} \\ -2 & x_i^* = -1/x_i^2 \\ -1 & x_i^* = -1/x_i \\ -.5 & x_i^* = -1/\sqrt{x_i} \\ -.333 & x_i^* = -1/x_i^{1/3} \\ & 0 & x_i^* \stackrel{\text{def}}{=} \log(x_i) \\ .333 & x_i^* = x_i^{1/3} \\ & .5 & x_i^* = \sqrt{x_i} \\ & 1 & x_i^* = x_i \\ & 2 & x_i^* = x_i^2 \end{array}$$

Box-Cox Transformation

 The Box-Cox family of power transformations of a positive explanatory variable is


$$x_i^* = \begin{cases} \frac{x_i^{\lambda} - 1}{\lambda} & \lambda \neq 0\\ \log(x_i) & \lambda = 0 \end{cases}$$

where x_i is the original, untransformed explanatory variable for observation i and λ is the power transformation parameter.


- The Box-Cox transformation has the following properties:
 - ▶ The transformed value x_i^* is an increasing function of x_i .
 - ▶ For fixed, x_i , x_i^* is a continuous function of λ through 0.

17 - 46


Picciotto Yarn Failure Data Relationship Sensitivity Analysis for the 0.1 Quantile at Length 30 mm

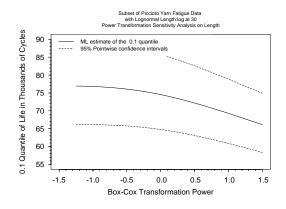

Picciotto Yarn Failure Data Relationship Sensitivity Analysis for the 0.1 Quantile at Length 10 mm

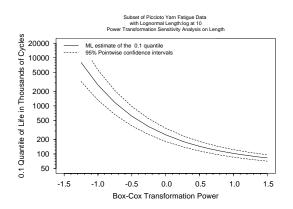


Picciotto Yarn Failure Data Profile Plot for Different Box-Cox Parameters for the Length Relationship

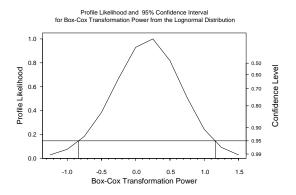


17 - 49

Picciotto Yarn Failure Data Relationship Sensitivity Analysis 0.1, 0.5, 0.9 Quantiles at 10 mm Length

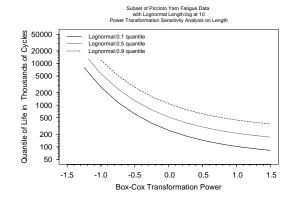

17 - 50

Picciotto Yarn Failure Data Relationship/Distribution Sensitivity Analysis 0.1 Quantile at 10 mm Length

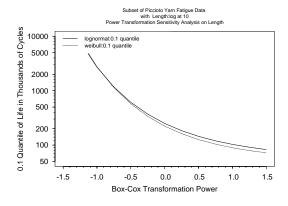


17 - 51

Glass Capacitor Failure Data


- Experiment designed to determine the effect of voltage and temperature on capacitor life.
- ullet 2 \times 4 factorial, 8 units at each combination.
- Test at each combination run until 4 of 8 units failed (Type II censoring).
- Original data from Zelen (1959).

17 - 52

Scatter Plot the Effect of Voltage and Temperature on Glass Capacitor Life (Zelen 1959)

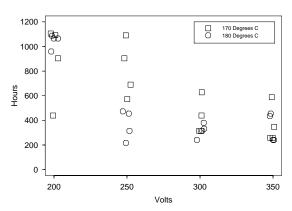

Weibull Probability Plots of Glass Capacitor Life Test Results at Individual Temperature and Voltage Test Conditions

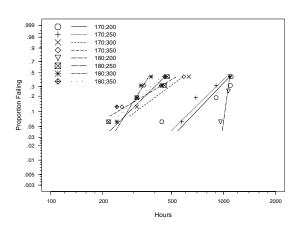

17 - 53

Two-Variable Regression Models

Additive model

 $\log[t_p(x)] = y_p(x) = \beta_0 + \beta_1 x_1 + \beta_2 x_2 + \Phi^{-1}(p)\sigma.$ Because

$$t_p(x) = \exp[y_p(x)] = \exp(\beta_1 x_1 + \beta_2 x_2) t_p(\underline{0})$$

this is an SAFT model

• The interaction model


 $\log[t_p(x)] = y_p(x) = \beta_0 + \beta_1 x_1 + \beta_2 x_2 + \beta_3 x_1 x_2 + \Phi^{-1}(p)\sigma.$ is also SAFT.

• Comparing the two models gives

$$-2\times(\mathcal{L}_1-\mathcal{L}_2) = -2\times(-244.24+244.17) = 0.14$$
 which is small relative $\chi^2_{.95,1}=3.84$


17 - 55

Weibull Probability Plots with Weibull Regression Model ML Estimates of ${\cal F}(t)$ at each Set of Conditions for the Glass Capacitor Data

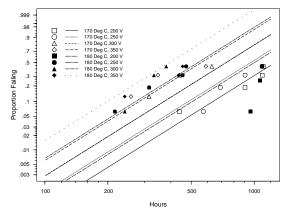

17 - 56

Estimates of Weibull $t_{0.5}$ Plotted for each Combination of the Glass Capacitor Test Conditions Points are Estimates Regression–Model Free

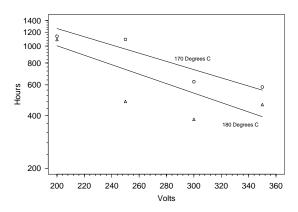

17 - 57

The Proportional Hazard Failure Time Model

The proportional hazard (PH) model assumes

$$h(t; x) = \Psi(x)h(t; x_0)$$
, for all $t > 0$.

 $h(t;x_0)$ and $F(t;x_0)$ denote the baseline hazard function and cdf of the model.

The PH model implies (some details later):


- $S(t;x) = [S(t;x_0)]^{\Psi(x)}$ or $1 F(t;x) = [1 F(t;x_0)]^{\Psi(x)}$. If $\Psi(x) \neq 1$, F(t;x) and $F(t;x_0)$ do not cross and the model is accelerating if $\Psi(x) > 1$ and decelerating if $\Psi(x) < 1$.
- ullet From $1-F(t;x)=[1-F(t;x_0)]^{\Psi(x)}$ and taking logs (twice):

 $\log \left\{-\log \left[1-F(t;x)\right]\right\}-\log \left\{-\log \left[1-F(t;x_0)\right]\right\}=\log \left[\Psi(x)\right].$


Thus in a Weibull probability scale F(t;x) and $F(t;x_0)$ are equidistant. In particular, Weibull plots of F(t;x) and $F(t;x_0)$ are translation of each other along the probability axis.

17 - 58

Weibull Probability Plot of Two Members from a PH Model with a Baseline Lognormal Distribution

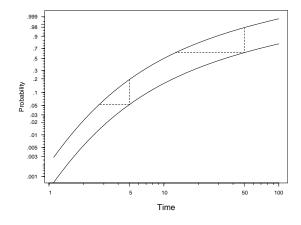

Proportional Hazard Model (Lognormal Baseline) as a Time Transformation

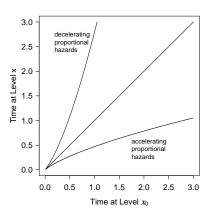

Interpreting PH Models as a Failure Time Transformation.

Suppose that $T(x_0) \sim F(t;x_0)$ and define the time transformation:

$$T(x) = F^{-1}\left(1 - \{1 - F[T(x_0); x_0]\}^{\frac{1}{\Psi(x)}}; x_0\right).$$

It can be shown that:

ullet T(x) and $T(x_0)$ follow the PH relationship

$$h(t;x) = \Psi(x)h(t;x_0).$$

ullet T(x) is a monotone transformation of $T(x_0)$ such that

$$T(x)$$
 < $T(x_0)$ if $\Psi(x) > 1$, accelerating $T(x) = T(x_0)$ if $\Psi(x) = 1$, identity transform $T(x) > T(x_0)$ if $\Psi(x) < 1$, decelerating

17 - 61

Some Comments on the Proportional Hazard Failure Time Model


Here we consider the proportional hazards, PH, model

$$h(t; x) = \Psi(x)h(t; x_0)$$
, for all $t > 0$.

- In general, the PH model does not preserve the baseline distribution. For example, if $T(x_0)$ has a lognormal distribution then T(x) has a power lognormal distribution.
- The semiparametric model without a particular specification of $h(t; x_0)$ is known as **Cox's** proportional hazards model.

17 - 62

Weibull Probability Plot of Two Members from a PH/SAFT Model with a Baseline Weibull Distribution

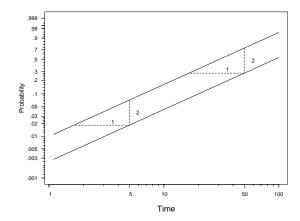

17 - 63

Contrasting SAFT and PH Models

The scale failure time model $t_p(x)=t_p(x_0)/\Psi(x)$ and the PH model $h(t;x)=\Psi(x)h(t;x_0)$ are equivalent if only if the baseline distribution is Weibull.

In other words, the Weibull distribution is the only baseline distribution for which a SAFT model is also a a PH model, and vice versa.

Heuristic argument: Consider $F(t;x_1)$ and $F(t;x_2)$. The Weibull probability plots of these two cdfs are translation of each other in both the probability and the $\log(t)$ scale if and only if the plots are straight parallel lines.

17 - 64

Statistical Methods for the Semiparametric (Cox) PH Model

Data: n units, $t_{(1)},\ldots,t_{(r)}$ ordered failure times with n-r censored observations (usually multiply censored).

- $\mathcal{RS}_i = \mathcal{RS}(t_{(i)} \varepsilon)$ is the **risk set** just before the failure at time $t_{(i)}$.
- ullet Each unit has a vector $oldsymbol{x}_i$ of explanatory variables (often called covariates).

Cox PH Model Likelihood (Probability of the Data)

- The probability that individual i dies in $[t,t+\Delta t]$ is $h(t;x_i)\Delta t = h(t;x_0)\Delta t \Psi(x_i) = h(t;x_0)\exp(x_i'\beta)\Delta t$ where $\Psi(x_i) = \exp(x_i'\beta) = \exp(\beta_1x_1+\cdots+\beta_kx_k)$ and $x_0=0$
- If a death occurs at time t, the probability that it was individual i is

$$L_i = \frac{h(t; \boldsymbol{x}_i) \Delta t}{\sum_{\ell \in \mathcal{RS}_i} h(t; \boldsymbol{x}_\ell) \Delta t} = \frac{\exp(\boldsymbol{x}_i' \boldsymbol{\beta})}{\sum_{\ell \in \mathcal{RS}_i} \exp(\boldsymbol{x}_\ell' \boldsymbol{\beta})}$$

Conditional on the observed failure times, the joint probability of the data is

$$L(\beta) = \prod_{i=1}^{r} \frac{\exp(x_i'\beta)}{\sum_{\ell \in \mathcal{RS}_i} \exp(x_\ell'\beta)}$$

ullet Need mild conditions on x_i and the censoring mechanism.

Comments on the Cox PH Model Likelihood

- Cox (1972) called $L(\beta)$ a conditional likelihood.
- $L(\beta)$ is not a true likelihood, but there is justification for treating it as such.
- ullet With no censoring, Kalbfleisch and Prentice (1973) show that L(eta) can be justified as a marginal likelihood based on ranks of the observed failures. Argument can be extended to Type II censoring.
- Cox (1975) provided a partial likelihood justification.
- Asymptotic theory shows that the estimates obtained from maximizing $L(\beta)$ have high efficiency.
- ullet There are some technical difficulties when there are ties observations. Approximations for L(eta) generally used.

17 - 67

Estimating $h(t; x_0)$ [or $S(t; x_0)$ or $F(t; x_0)$]

- Basic idea is to substitute $\hat{\beta}$ for β and maximize the probability of the data (after adjustment for the explanatory variables), as in the product limit estimator.
- Let $q_i = S(t_i + \varepsilon; x_0)$, $i = 1, \ldots, r$ for the r failure times and let $q_j = S(t_j + \varepsilon; x_0)$, $j = r + 1, \ldots, n$ for the n r censored observations. If there are **no ties** among the failure times,


$$L(q) = \prod_{i=1}^{r} \left(q_{i-1}^{\widehat{\Psi}(x_i)} - q_i^{\widehat{\Psi}(x_i)} \right) \prod_{j=r+1}^{n} q_{j-1}^{\widehat{\Psi}(x_j)}$$

where $\widehat{\Psi}(x_i) = \exp(x_i'\widehat{\beta})$ and $q_0 \equiv 1$.

- Maximize L(q) with respect to q_i , $i=1,\ldots,r$ to get the step-function estimate of $S(t;x_0)$.
- Estimate of S(t) at x is $\hat{S}(t;x) = [\hat{S}(t;x_0]^{\hat{\Psi}(x)}]$.
- Setup more complicated when there are ties.


17 - 68

Picciotto Yarn Failure Data Cox PH Model Survival Estimates (Linear Axes)

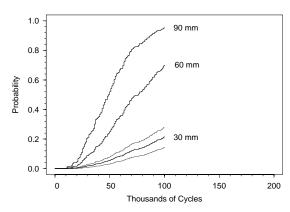


17 - 69

Picciotto Yarn Failure Data Cox PH Model Survival Estimates (on Weibull Probability Scales)

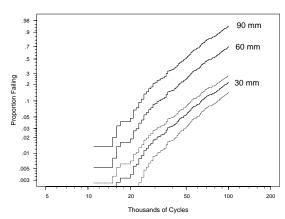


17 - 70

Picciotto Yarn Failure Data Cox PH Model Schoenfeld Residuals versus Time

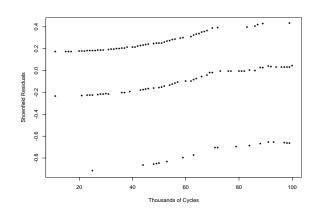

General Failure Time Transformation Graph

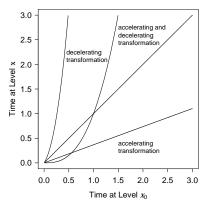

General Failure Time Transformation Model

A general time transformation model is

$$T(x) = \Upsilon[T(x_0), x]$$

where x_0 are some **baseline** conditions.

We assume that $\Upsilon\left(t,x\right)$ satisfies the following conditions:

- $\Upsilon(t,x)$ is nonnegative, i.e., $\Upsilon(t,x) \geq 0$ for all t and x.
- For fixed x, $\Upsilon(t,x)$ is monotone increasing in t.
- For all x, $\Upsilon(0,x)=0$.
- ullet For x_0 the transformation is the identity transformation, i.e., $\Upsilon(t, x_0) = t$ for all t.

This general assumed transformation model implies:

ullet The distribution of T(x) can be determined from the distribution of $T(x_0)$ and x. In particular, $t_p(x) = \Upsilon[t_p(x_0), x]$ for $0 \le p \le 1$.

General Failure Time Transformation Model

- In a plot of $T(x_0)$ versus T(x)
 - ightharpoonup T(x) entirely below the diagonal line implies acceleration.
 - lacktriangledown T(x) entirely above the diagonal line implies deceleration.
 - \blacktriangleright Other T(x)s imply acceleration sometimes and deceleration other times. The cdfs of T(x) and $T(x_0)$ cross.
 - ▶ Scale time transformations and proportional hazard model are special cases.

17 - 74

17 - 73

Other Topics in Failure-Time Regression

- Models with non-location-scale distributions.
- Nonlinear relationship regression model.
- Fatigue-limit regression model.
- Special topics in regression: random effects models, nonparametric SAFT regression models, parametric PH regression models.