

136 m

surveyed length

0.82%

crack density (segmented area)

1128 m

total crack length

545

cracks measured

207/274

crack-bearing frames

0.10%


vegetation coverage

This report summarises an automated condition survey of the runway, captured in a single drone pass at roughly 1.25 mm per pixel. Cracks are picked out by a crack-specialised segmentation model and vegetation by its colour; every finding is tied to a position along the runway (its chainage) so the results read as a map rather than a list. The aim is to show, at a glance, where the surface needs attention first — in line with the routine pavement-monitoring expectations of ICAO Annex 14, CAA CAP 168 and the ASTM D5340 distress framework.

Across the 136 m surveyed, the system found 545 cracks (about 1128 m of cracking in total) on 207 of 274 frames, giving an overall crack density of 0.82% of the imaged surface, with vegetation showing in 85 frames. The pages that follow walk through how the analysis works, where the worst stretches are, and what we can and cannot yet measure.

A note on scope, in the interest of honesty: crack density here is a reliable way to rank and track problem areas, but we deliberately do not publish a per-crack width, an ASTM severity grade or a numeric PCI. Motion blur and the runway's grooved texture make millimetre width measurement untrustworthy on this footage (the Limitations page explains why and how to fix it). Foreign-object debris, rubber deposits and marking condition are out of scope for this survey — the ASTM coverage matrix sets out exactly what was and wasn't assessed.


From a single drone pass to a located, prioritised survey.

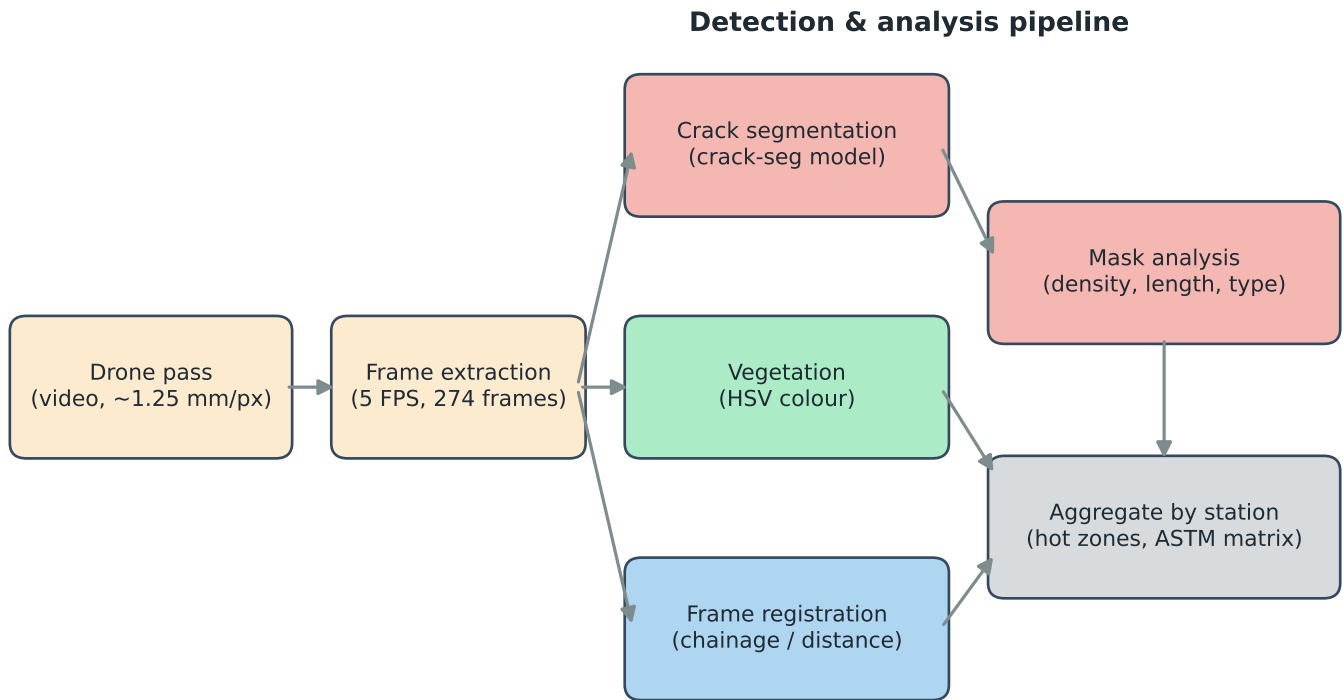

1. Capture & frames. The runway is flown in one continuous pass and the video is sampled at 5 frames per second, giving 274 high-resolution stills at about 1.25 mm per pixel.
2. Crack detection. Each frame is run through a crack-specialised segmentation model that outlines cracks as thin shapes rather than just boxes — so we measure the area actually covered by cracking, not the rectangle around it.
3. Vegetation. Greenery (plants growing through joints and along edges) is separated from the grey asphalt by colour, which is robust and needs no training.
4. Measurement. From each crack outline we derive its length and orientation (longitudinal, transverse or interconnected 'alligator'), and per frame we compute crack and vegetation coverage.
5. Location (chainage). Because the frames are a continuous pass, we recover how far the drone moved between frames by aligning them, turning frame numbers into real distance along the runway.
6. Reporting. Findings are aggregated by station into hot zones, checked against the ASTM D5340 distress catalogue, and written up as this report.

Spatial distress map (by chainage)


Distance along the runway pass, recovered by frame registration.

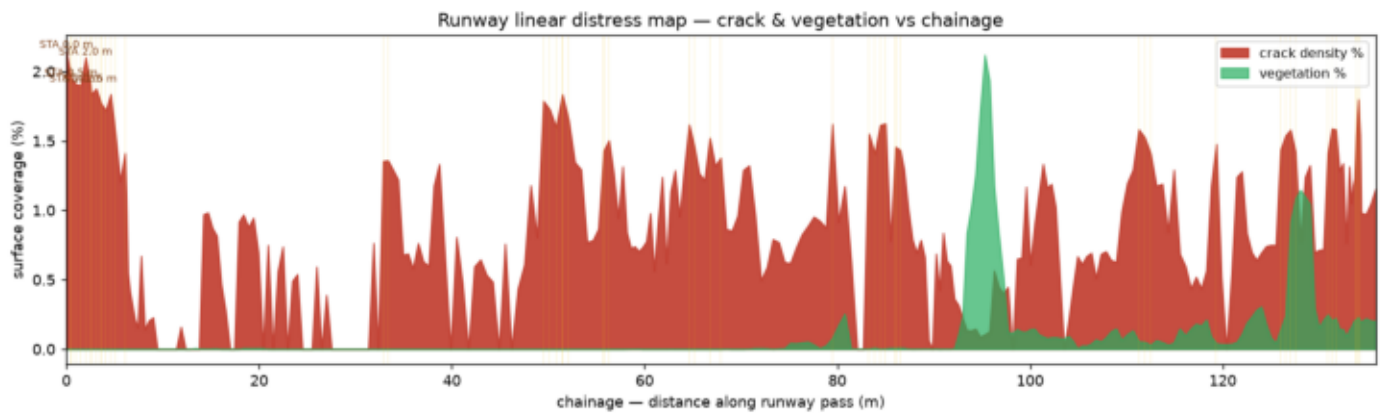


Priority crack hot zones (station · density):

STA	0.0 m	2.15%
STA	2.0 m	2.10%
STA	0.5 m	1.95%
STA	1.0 m	1.91%
STA	2.5 m	1.91%
STA	1.5 m	1.90%
STA	3.1 m	1.88%
STA	4.6 m	1.84%

v1 bounding-box proxy vs crack-seg true-area mask.

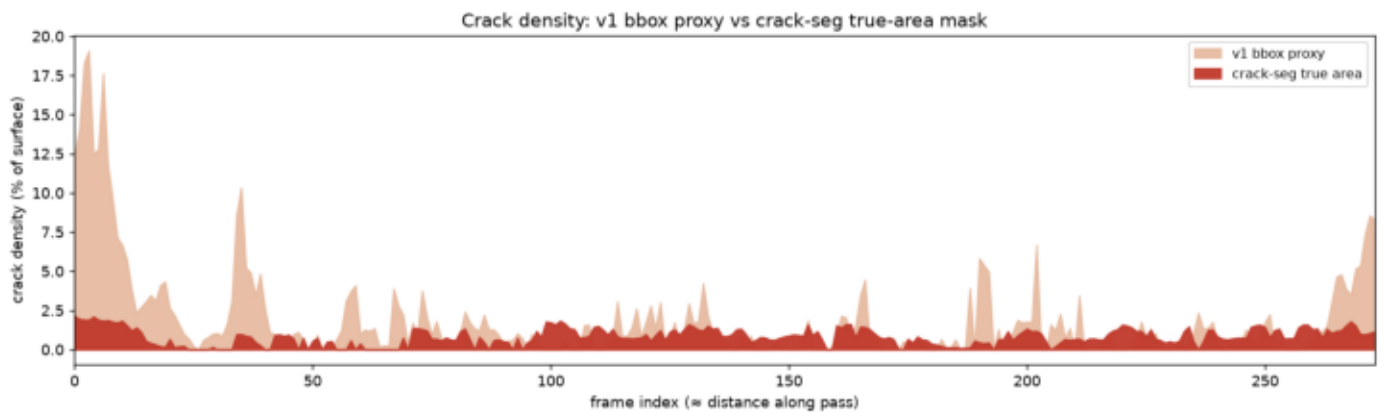

A simple bounding box around a crack greatly overstates how much surface the crack actually covers. Outlining the crack instead (the darker band) measures the real affected area. The crack-specialised model is also more sensitive than the original detector, picking up finer cracking right across the surface — so read these density figures as a sensitive screening index rather than an exact inventory.

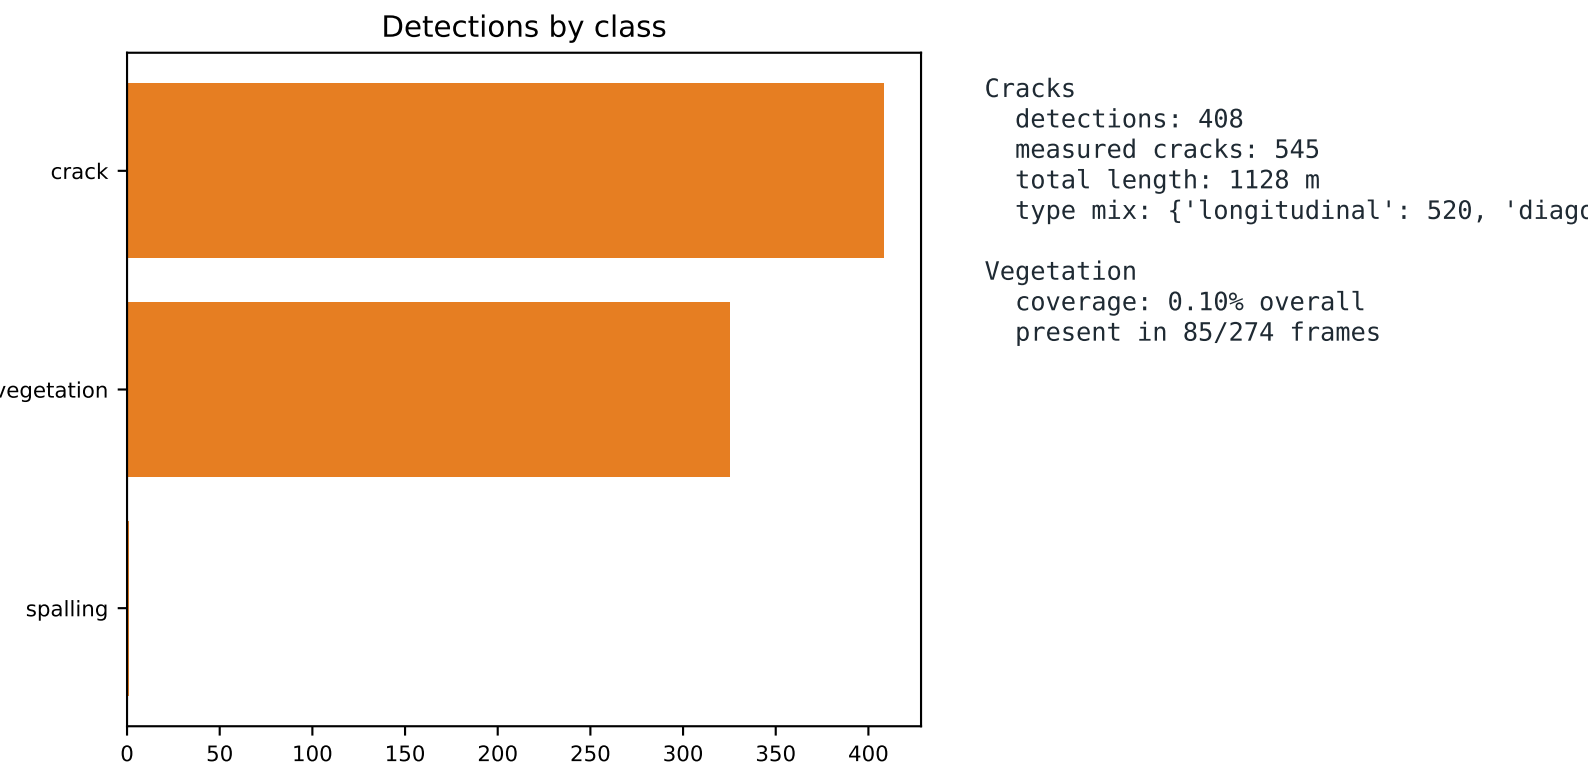

Crack type is from skeleton orientation (geometry is robust);
vegetation from a green colour threshold (separable from asphalt).

ASTM D5340 coverage matrix

What this survey assesses, and what needs more.

item	status	note
Cracking (long./trans.) density, length, location, type	ASSESSED	
Vegetation encroachment coverage % + hot zones (operational)	ASSESSED	
Patching detector class present; not validated here	PARTIAL	
Crack width / severity / PCI blur + groove texture (see Limitations)	NOT REPORTED	
FOD needs a trained FOD model (FOD-A)	OUT OF SCOPE	
Rubber deposits needs TDZ location + friction data	OUT OF SCOPE	
Raveling / weathering texture; unreliable on blurred RGB	OUT OF SCOPE	
Marking condition colour threshold catches shoulder/verge	OUT OF SCOPE	
Ponding / drainage dry survey	N/A	

red = segmented crack

frame_000001.jpg — STA 0.0 m — 2.15% density



frame_000005.jpg — STA 2.0 m — 2.10% density



red = segmented crack

frame_000002.jpg — STA 0.5 m — 1.95% density



frame_000003.jpg — STA 1.0 m — 1.91% density



We think it's important to be clear about the edges of this survey.

Why there is no per-crack width, ASTM severity grade or PCI score:

The honest answer is that this footage cannot support a trustworthy millimetre crack width. Motion blur from the moving drone and the runway's grooved texture both smear the thin edge of a crack — the very thing a width measurement depends on. We tried three different methods and each failed in its own way: a general segmentation model traced a broad region rather than the crack line (giving an impossible ~46 mm 'width'); a contrast-based method simply measured the groove spacing (~5 mm everywhere); and even the crack-specialised model, while it finds cracks well, produces masks too coarse for millimetre width. Since width drives ASTM severity and PCI, we don't report those rather than publish a number we can't stand behind.

What you can rely on in this report: where the cracking is and how it's concentrated (density and hot zones), how much there is and how it runs (count, location, length and type), vegetation coverage, and the distance-along-runway referencing that ties it all to a position.

How to unlock certified-style width, severity and PCI next time:

- capture sharper imagery — slower or stop-and-stare passes, or deblurring — so crack edges stay crisp, and/or
- use a crack-fine-tuned segmenter; then width-based severity and PCI become trustworthy.

Two smaller caveats: accuracy figures (precision/recall) would need a human to verify a sample of frames, and a single straight pass gives a strip down the runway rather than a full-width map of the whole surface.

Distress list — cracks by chainage

1-92 of 545

id	STA(m)	frame	type	len(m)	id	STA(m)	frame	type	len(m)
1	0.0	frame_000001.jpg	longitudinal	2.61	47	5.1	frame_000012.jpg	alligator	3.26
2	0.0	frame_000001.jpg	longitudinal	2.55	48	5.6	frame_000013.jpg	alligator	3.45
3	0.0	frame_000001.jpg	longitudinal	1.56	49	5.6	frame_000013.jpg	longitudinal	0.32
4	0.0	frame_000001.jpg	longitudinal	2.40	50	5.6	frame_000013.jpg	alligator	2.33
5	0.5	frame_000002.jpg	longitudinal	2.19	51	6.1	frame_000014.jpg	longitudinal	1.87
6	0.5	frame_000002.jpg	longitudinal	2.62	52	6.1	frame_000014.jpg	alligator	3.93
7	0.5	frame_000002.jpg	longitudinal	1.47	53	6.1	frame_000014.jpg	alligator	3.15
8	1.0	frame_000003.jpg	longitudinal	2.39	54	6.1	frame_000014.jpg	alligator	3.54
9	1.0	frame_000003.jpg	longitudinal	2.54	55	6.2	frame_000015.jpg	longitudinal	2.02
10	1.0	frame_000003.jpg	longitudinal	1.65	56	6.2	frame_000015.jpg	longitudinal	2.23
11	1.0	frame_000003.jpg	longitudinal	1.93	57	6.4	frame_000016.jpg	longitudinal	2.30
12	1.5	frame_000004.jpg	longitudinal	2.28	58	6.6	frame_000017.jpg	longitudinal	1.93
13	1.5	frame_000004.jpg	longitudinal	2.54	59	6.8	frame_000018.jpg	longitudinal	1.74
14	1.5	frame_000004.jpg	longitudinal	1.59	60	7.1	frame_000019.jpg	longitudinal	1.31
15	2.0	frame_000005.jpg	longitudinal	2.71	61	7.4	frame_000020.jpg	alligator	1.53
16	2.0	frame_000005.jpg	longitudinal	2.65	62	7.8	frame_000021.jpg	longitudinal	0.66
17	2.0	frame_000005.jpg	longitudinal	1.73	63	7.8	frame_000021.jpg	longitudinal	0.60
18	2.5	frame_000006.jpg	longitudinal	2.27	64	7.8	frame_000021.jpg	longitudinal	2.34
19	2.5	frame_000006.jpg	longitudinal	2.57	65	8.1	frame_000022.jpg	longitudinal	1.42
20	2.5	frame_000006.jpg	longitudinal	1.63	66	8.6	frame_000023.jpg	longitudinal	1.70
21	2.5	frame_000006.jpg	longitudinal	1.65	67	9.0	frame_000024.jpg	longitudinal	1.94
22	2.6	frame_000007.jpg	longitudinal	2.56	68	11.9	frame_000030.jpg	longitudinal	0.87
23	2.6	frame_000007.jpg	longitudinal	2.39	69	14.2	frame_000035.jpg	longitudinal	2.52
24	2.6	frame_000007.jpg	longitudinal	1.79	70	14.2	frame_000035.jpg	longitudinal	1.70
25	3.1	frame_000008.jpg	longitudinal	2.57	71	14.7	frame_000036.jpg	longitudinal	2.13
26	3.1	frame_000008.jpg	diagonal	2.51	72	14.7	frame_000036.jpg	longitudinal	2.68
27	3.1	frame_000008.jpg	longitudinal	2.36	73	15.2	frame_000037.jpg	longitudinal	2.10
28	3.1	frame_000008.jpg	longitudinal	1.55	74	15.6	frame_000038.jpg	longitudinal	1.69
29	3.6	frame_000009.jpg	longitudinal	2.31	75	15.6	frame_000038.jpg	longitudinal	2.19
30	3.6	frame_000009.jpg	alligator	3.15	76	16.1	frame_000039.jpg	longitudinal	1.23
31	3.6	frame_000009.jpg	longitudinal	1.87	77	16.5	frame_000040.jpg	longitudinal	0.71
32	3.6	frame_000009.jpg	longitudinal	1.76	78	17.9	frame_000043.jpg	longitudinal	2.62
33	4.1	frame_000010.jpg	longitudinal	1.95	79	18.4	frame_000044.jpg	longitudinal	2.68
34	4.1	frame_000010.jpg	alligator	3.09	80	18.9	frame_000045.jpg	longitudinal	2.66
35	4.1	frame_000010.jpg	alligator	3.12	81	19.4	frame_000046.jpg	longitudinal	2.69
36	4.1	frame_000010.jpg	longitudinal	1.77	82	19.4	frame_000046.jpg	longitudinal	2.26
37	4.6	frame_000011.jpg	longitudinal	1.12	83	19.9	frame_000047.jpg	longitudinal	2.11
38	4.6	frame_000011.jpg	longitudinal	2.25	84	20.9	frame_000049.jpg	longitudinal	2.62
39	4.6	frame_000011.jpg	alligator	3.80	85	21.9	frame_000051.jpg	longitudinal	2.00
40	4.6	frame_000011.jpg	alligator	3.42	86	22.5	frame_000052.jpg	longitudinal	2.48
41	4.6	frame_000011.jpg	alligator	4.07	87	23.4	frame_000054.jpg	longitudinal	2.02
42	5.1	frame_000012.jpg	longitudinal	0.64	88	24.0	frame_000055.jpg	longitudinal	2.32
43	5.1	frame_000012.jpg	alligator	3.85	89	26.0	frame_000059.jpg	longitudinal	2.23
44	5.1	frame_000012.jpg	longitudinal	1.94	90	27.0	frame_000061.jpg	longitudinal	1.45
45	5.1	frame_000012.jpg	alligator	3.21	91	31.9	frame_000070.jpg	longitudinal	2.30
46	5.1	frame_000012.jpg	longitudinal	0.73	92	32.9	frame_000072.jpg	longitudinal	2.59

Distress list — cracks by chainage

93-184 of 545

id	STA(m)	frame	type	len(m)	id	STA(m)	frame	type	len(m)
93	32.9	frame_000072.jpg	longitudinal	0.98	139	49.5	frame_000100.jpg	longitudinal	0.95
94	32.9	frame_000072.jpg	longitudinal	2.31	140	49.5	frame_000100.jpg	longitudinal	2.44
95	33.4	frame_000073.jpg	longitudinal	2.64	141	49.5	frame_000100.jpg	longitudinal	1.75
96	33.4	frame_000073.jpg	longitudinal	1.91	142	49.5	frame_000100.jpg	longitudinal	2.29
97	33.4	frame_000073.jpg	longitudinal	2.17	143	49.5	frame_000100.jpg	longitudinal	2.69
98	33.9	frame_000074.jpg	longitudinal	2.05	144	50.2	frame_000101.jpg	longitudinal	2.54
99	33.9	frame_000074.jpg	longitudinal	2.61	145	50.2	frame_000101.jpg	longitudinal	0.24
100	34.4	frame_000075.jpg	longitudinal	2.09	146	50.2	frame_000101.jpg	longitudinal	2.20
101	34.4	frame_000075.jpg	longitudinal	2.07	147	50.2	frame_000101.jpg	longitudinal	1.98
102	34.4	frame_000075.jpg	longitudinal	2.23	148	50.2	frame_000101.jpg	longitudinal	2.64
103	34.9	frame_000076.jpg	longitudinal	2.53	149	50.8	frame_000102.jpg	longitudinal	2.57
104	34.9	frame_000076.jpg	longitudinal	0.74	150	50.8	frame_000102.jpg	longitudinal	2.19
105	35.5	frame_000077.jpg	longitudinal	2.48	151	50.8	frame_000102.jpg	longitudinal	2.30
106	35.5	frame_000077.jpg	longitudinal	2.17	152	51.5	frame_000103.jpg	longitudinal	2.69
107	36.0	frame_000078.jpg	longitudinal	2.42	153	51.5	frame_000103.jpg	longitudinal	2.60
108	36.0	frame_000078.jpg	longitudinal	2.25	154	51.5	frame_000103.jpg	longitudinal	1.52
109	36.5	frame_000079.jpg	longitudinal	2.54	155	51.5	frame_000103.jpg	longitudinal	2.08
110	36.5	frame_000079.jpg	longitudinal	2.14	156	51.5	frame_000103.jpg	longitudinal	2.29
111	37.0	frame_000080.jpg	longitudinal	2.40	157	52.1	frame_000104.jpg	longitudinal	2.56
112	37.0	frame_000080.jpg	longitudinal	0.29	158	52.1	frame_000104.jpg	longitudinal	2.11
113	37.6	frame_000081.jpg	longitudinal	2.44	159	52.1	frame_000104.jpg	longitudinal	1.98
114	37.6	frame_000081.jpg	longitudinal	2.26	160	52.1	frame_000104.jpg	longitudinal	1.38
115	38.1	frame_000082.jpg	longitudinal	2.56	161	52.1	frame_000104.jpg	longitudinal	2.29
116	38.1	frame_000082.jpg	longitudinal	2.19	162	52.1	frame_000104.jpg	longitudinal	2.32
117	38.1	frame_000082.jpg	longitudinal	1.91	163	52.8	frame_000105.jpg	longitudinal	2.62
118	38.7	frame_000083.jpg	longitudinal	2.04	164	52.8	frame_000105.jpg	longitudinal	1.90
119	38.7	frame_000083.jpg	longitudinal	2.54	165	52.8	frame_000105.jpg	longitudinal	2.19
120	38.7	frame_000083.jpg	longitudinal	2.10	166	53.4	frame_000106.jpg	longitudinal	2.45
121	39.3	frame_000084.jpg	longitudinal	2.09	167	53.4	frame_000106.jpg	longitudinal	1.76
122	39.3	frame_000084.jpg	longitudinal	1.59	168	53.4	frame_000106.jpg	longitudinal	1.85
123	40.5	frame_000086.jpg	longitudinal	1.18	169	53.4	frame_000106.jpg	longitudinal	2.42
124	40.5	frame_000086.jpg	longitudinal	1.94	170	54.0	frame_000107.jpg	longitudinal	2.38
125	41.1	frame_000087.jpg	longitudinal	1.72	171	54.6	frame_000108.jpg	longitudinal	2.08
126	42.3	frame_000089.jpg	longitudinal	2.34	172	54.6	frame_000108.jpg	longitudinal	0.61
127	43.0	frame_000090.jpg	longitudinal	2.52	173	55.2	frame_000109.jpg	longitudinal	2.43
128	43.6	frame_000091.jpg	longitudinal	2.30	174	55.2	frame_000109.jpg	longitudinal	1.22
129	44.2	frame_000092.jpg	longitudinal	2.06	175	55.8	frame_000110.jpg	longitudinal	2.66
130	45.5	frame_000094.jpg	longitudinal	2.21	176	55.8	frame_000110.jpg	longitudinal	2.24
131	45.5	frame_000094.jpg	longitudinal	1.75	177	55.8	frame_000110.jpg	longitudinal	2.24
132	46.9	frame_000096.jpg	longitudinal	1.92	178	55.8	frame_000110.jpg	longitudinal	1.77
133	47.5	frame_000097.jpg	longitudinal	2.08	179	56.3	frame_000111.jpg	longitudinal	2.57
134	48.2	frame_000098.jpg	longitudinal	2.22	180	56.3	frame_000111.jpg	longitudinal	2.25
135	48.2	frame_000098.jpg	longitudinal	1.92	181	56.3	frame_000111.jpg	longitudinal	2.29
136	48.2	frame_000098.jpg	longitudinal	1.53	182	56.8	frame_000112.jpg	longitudinal	2.52
137	48.8	frame_000099.jpg	longitudinal	1.63	183	56.8	frame_000112.jpg	longitudinal	1.76
138	48.8	frame_000099.jpg	longitudinal	2.35	184	56.8	frame_000112.jpg	longitudinal	2.09

Distress list — cracks by chainage

185-276 of 545

id	STA(m)	frame	type	len(m)
185	57.3	frame_000113.jpg	longitudinal	1.30
186	57.3	frame_000113.jpg	longitudinal	2.64
187	57.3	frame_000113.jpg	longitudinal	2.17
188	57.3	frame_000113.jpg	longitudinal	1.50
189	57.7	frame_000114.jpg	longitudinal	2.30
190	57.7	frame_000114.jpg	longitudinal	2.56
191	57.7	frame_000114.jpg	longitudinal	1.83
192	57.7	frame_000114.jpg	longitudinal	1.82
193	58.1	frame_000115.jpg	longitudinal	2.60
194	58.1	frame_000115.jpg	longitudinal	2.14
195	58.6	frame_000116.jpg	longitudinal	2.41
196	59.0	frame_000117.jpg	longitudinal	2.52
197	59.0	frame_000117.jpg	longitudinal	2.13
198	59.0	frame_000117.jpg	longitudinal	1.56
199	59.4	frame_000118.jpg	longitudinal	2.33
200	59.4	frame_000118.jpg	longitudinal	2.43
201	59.8	frame_000119.jpg	longitudinal	2.58
202	60.2	frame_000120.jpg	longitudinal	2.47
203	60.2	frame_000120.jpg	longitudinal	2.28
204	60.2	frame_000120.jpg	longitudinal	1.59
205	60.6	frame_000121.jpg	longitudinal	2.43
206	60.6	frame_000121.jpg	longitudinal	2.17
207	60.6	frame_000121.jpg	longitudinal	1.43
208	61.0	frame_000122.jpg	longitudinal	2.41
209	61.4	frame_000123.jpg	longitudinal	2.60
210	61.4	frame_000123.jpg	longitudinal	0.85
211	61.4	frame_000123.jpg	longitudinal	2.27
212	61.8	frame_000124.jpg	longitudinal	2.41
213	61.8	frame_000124.jpg	longitudinal	2.02
214	61.8	frame_000124.jpg	longitudinal	2.36
215	62.3	frame_000125.jpg	longitudinal	2.55
216	62.7	frame_000126.jpg	longitudinal	2.54
217	62.7	frame_000126.jpg	longitudinal	1.97
218	62.7	frame_000126.jpg	longitudinal	1.53
219	63.2	frame_000127.jpg	longitudinal	2.56
220	63.2	frame_000127.jpg	longitudinal	2.27
221	63.2	frame_000127.jpg	longitudinal	1.75
222	63.2	frame_000127.jpg	longitudinal	2.44
223	63.6	frame_000128.jpg	longitudinal	2.47
224	63.6	frame_000128.jpg	longitudinal	1.13
225	63.6	frame_000128.jpg	longitudinal	2.31
226	64.1	frame_000129.jpg	longitudinal	2.17
227	64.1	frame_000129.jpg	longitudinal	2.57
228	64.1	frame_000129.jpg	longitudinal	0.67
229	64.1	frame_000129.jpg	longitudinal	1.91
230	64.6	frame_000130.jpg	longitudinal	1.17

id	STA(m)	frame	type	len(m)
231	64.6	frame_000130.jpg	longitudinal	2.17
232	64.6	frame_000130.jpg	longitudinal	1.79
233	64.6	frame_000130.jpg	longitudinal	2.53
234	65.1	frame_000131.jpg	longitudinal	2.53
235	65.1	frame_000131.jpg	longitudinal	1.49
236	65.1	frame_000131.jpg	longitudinal	1.02
237	65.1	frame_000131.jpg	longitudinal	1.91
238	65.7	frame_000132.jpg	longitudinal	2.61
239	65.7	frame_000132.jpg	longitudinal	1.79
240	65.7	frame_000132.jpg	longitudinal	1.74
241	66.2	frame_000133.jpg	longitudinal	2.58
242	66.2	frame_000133.jpg	longitudinal	1.35
243	66.2	frame_000133.jpg	longitudinal	2.13
244	66.8	frame_000134.jpg	longitudinal	2.38
245	66.8	frame_000134.jpg	longitudinal	1.62
246	66.8	frame_000134.jpg	longitudinal	0.85
247	66.8	frame_000134.jpg	longitudinal	2.30
248	67.3	frame_000135.jpg	longitudinal	2.30
249	67.3	frame_000135.jpg	longitudinal	2.13
250	67.9	frame_000136.jpg	longitudinal	2.56
251	67.9	frame_000136.jpg	longitudinal	1.88
252	67.9	frame_000136.jpg	longitudinal	2.01
253	67.9	frame_000136.jpg	longitudinal	2.24
254	68.5	frame_000137.jpg	longitudinal	2.53
255	68.5	frame_000137.jpg	longitudinal	2.17
256	68.5	frame_000137.jpg	longitudinal	2.34
257	69.1	frame_000138.jpg	longitudinal	2.27
258	69.1	frame_000138.jpg	longitudinal	2.55
259	69.7	frame_000139.jpg	longitudinal	2.12
260	69.7	frame_000139.jpg	longitudinal	1.36
261	70.2	frame_000140.jpg	longitudinal	2.62
262	70.2	frame_000140.jpg	longitudinal	2.27
263	70.2	frame_000140.jpg	longitudinal	1.71
264	70.8	frame_000141.jpg	longitudinal	2.32
265	70.8	frame_000141.jpg	longitudinal	2.38
266	70.8	frame_000141.jpg	longitudinal	2.10
267	70.8	frame_000141.jpg	longitudinal	1.92
268	71.5	frame_000142.jpg	longitudinal	1.75
269	71.5	frame_000142.jpg	longitudinal	1.74
270	72.1	frame_000143.jpg	longitudinal	1.89
271	72.7	frame_000144.jpg	longitudinal	2.02
272	72.7	frame_000144.jpg	longitudinal	1.81
273	73.3	frame_000145.jpg	longitudinal	2.31
274	73.3	frame_000145.jpg	longitudinal	2.03
275	73.3	frame_000145.jpg	longitudinal	2.16
276	73.9	frame_000146.jpg	longitudinal	2.53

Distress list — cracks by chainage

Runway Surface Condition Report

277-368 of 545

id	STA(m)	frame	type	len(m)	id	STA(m)	frame	type	len(m)
277	73.9	frame_000146.jpg	longitudinal	2.27	323	86.0	frame_000166.jpg	transverse	0.57
278	74.5	frame_000147.jpg	longitudinal	0.33	324	86.0	frame_000166.jpg	longitudinal	2.32
279	74.5	frame_000147.jpg	longitudinal	2.02	325	86.5	frame_000167.jpg	longitudinal	2.61
280	75.1	frame_000148.jpg	longitudinal	0.89	326	86.5	frame_000167.jpg	transverse	0.58
281	75.1	frame_000148.jpg	longitudinal	2.09	327	86.5	frame_000167.jpg	longitudinal	1.90
282	75.7	frame_000149.jpg	longitudinal	1.47	328	86.5	frame_000167.jpg	longitudinal	2.01
283	75.7	frame_000149.jpg	longitudinal	2.40	329	86.9	frame_000168.jpg	longitudinal	2.53
284	76.3	frame_000150.jpg	longitudinal	2.48	330	86.9	frame_000168.jpg	longitudinal	1.66
285	76.3	frame_000150.jpg	longitudinal	2.07	331	86.9	frame_000168.jpg	longitudinal	0.70
286	77.0	frame_000151.jpg	longitudinal	2.56	332	87.3	frame_000169.jpg	longitudinal	2.18
287	77.0	frame_000151.jpg	longitudinal	2.33	333	87.3	frame_000169.jpg	longitudinal	1.29
288	77.0	frame_000151.jpg	longitudinal	1.50	334	87.3	frame_000169.jpg	longitudinal	2.02
289	77.6	frame_000152.jpg	longitudinal	2.55	335	87.8	frame_000170.jpg	longitudinal	2.56
290	77.6	frame_000152.jpg	longitudinal	2.20	336	87.8	frame_000170.jpg	longitudinal	2.31
291	77.6	frame_000152.jpg	longitudinal	2.13	337	87.8	frame_000170.jpg	longitudinal	0.63
292	78.2	frame_000153.jpg	longitudinal	2.60	338	88.2	frame_000171.jpg	longitudinal	2.51
293	78.8	frame_000154.jpg	longitudinal	2.52	339	88.7	frame_000172.jpg	longitudinal	1.87
294	78.8	frame_000154.jpg	longitudinal	2.23	340	88.7	frame_000172.jpg	longitudinal	1.99
295	79.5	frame_000155.jpg	longitudinal	2.58	341	88.7	frame_000172.jpg	longitudinal	1.89
296	79.5	frame_000155.jpg	longitudinal	2.47	342	88.7	frame_000172.jpg	longitudinal	0.43
297	79.5	frame_000155.jpg	longitudinal	2.28	343	89.1	frame_000173.jpg	longitudinal	1.83
298	80.1	frame_000156.jpg	longitudinal	0.99	344	89.1	frame_000173.jpg	longitudinal	0.90
299	80.1	frame_000156.jpg	longitudinal	2.62	345	89.5	frame_000174.jpg	diagonal	0.22
300	80.1	frame_000156.jpg	longitudinal	2.13	346	90.2	frame_000176.jpg	longitudinal	3.02
301	80.8	frame_000157.jpg	longitudinal	1.60	347	90.6	frame_000177.jpg	longitudinal	1.58
302	80.8	frame_000157.jpg	longitudinal	2.29	348	91.0	frame_000178.jpg	longitudinal	1.16
303	80.8	frame_000157.jpg	longitudinal	1.80	349	91.0	frame_000178.jpg	longitudinal	1.55
304	81.4	frame_000158.jpg	longitudinal	1.78	350	91.4	frame_000179.jpg	longitudinal	2.06
305	81.4	frame_000158.jpg	diagonal	0.87	351	91.7	frame_000180.jpg	longitudinal	2.35
306	83.3	frame_000161.jpg	alligator	3.77	352	92.1	frame_000181.jpg	longitudinal	1.74
307	83.3	frame_000161.jpg	longitudinal	0.94	353	92.6	frame_000182.jpg	alligator	1.82
308	83.9	frame_000162.jpg	longitudinal	2.71	354	93.0	frame_000183.jpg	longitudinal	1.52
309	83.9	frame_000162.jpg	longitudinal	1.43	355	93.4	frame_000184.jpg	longitudinal	1.13
310	83.9	frame_000162.jpg	alligator	3.52	356	93.9	frame_000185.jpg	longitudinal	0.97
311	84.4	frame_000163.jpg	longitudinal	1.98	357	94.3	frame_000186.jpg	longitudinal	1.02
312	84.4	frame_000163.jpg	longitudinal	2.72	358	94.8	frame_000187.jpg	longitudinal	0.73
313	84.4	frame_000163.jpg	longitudinal	1.90	359	95.3	frame_000188.jpg	longitudinal	0.79
314	84.4	frame_000163.jpg	longitudinal	0.95	360	95.8	frame_000189.jpg	longitudinal	1.23
315	85.0	frame_000164.jpg	longitudinal	2.38	361	96.3	frame_000190.jpg	longitudinal	0.80
316	85.0	frame_000164.jpg	transverse	0.39	362	96.3	frame_000190.jpg	longitudinal	2.03
317	85.0	frame_000164.jpg	longitudinal	2.13	363	96.8	frame_000191.jpg	longitudinal	1.92
318	85.0	frame_000164.jpg	longitudinal	1.14	364	97.2	frame_000192.jpg	longitudinal	1.70
319	85.5	frame_000165.jpg	longitudinal	2.55	365	97.7	frame_000193.jpg	longitudinal	1.62
320	85.5	frame_000165.jpg	transverse	0.46	366	97.7	frame_000193.jpg	longitudinal	1.87
321	85.5	frame_000165.jpg	longitudinal	2.25	367	98.7	frame_000195.jpg	longitudinal	2.02
322	86.0	frame_000166.jpg	longitudinal	2.38	368	98.7	frame_000195.jpg	longitudinal	2.17

Distress list — cracks by chainage

369-460 of 545

id	STA(m)	frame	type	len(m)	id	STA(m)	frame	type	len(m)
369	99.1	frame_000196.jpg	longitudinal	2.31	415	111.9	frame_000222.jpg	longitudinal	2.55
370	99.6	frame_000197.jpg	longitudinal	2.67	416	111.9	frame_000222.jpg	longitudinal	2.19
371	99.6	frame_000197.jpg	longitudinal	2.39	417	111.9	frame_000222.jpg	longitudinal	2.10
372	99.6	frame_000197.jpg	longitudinal	1.57	418	112.5	frame_000223.jpg	longitudinal	2.50
373	100.0	frame_000198.jpg	longitudinal	2.33	419	112.5	frame_000223.jpg	longitudinal	2.45
374	100.5	frame_000199.jpg	longitudinal	2.11	420	112.5	frame_000223.jpg	longitudinal	1.80
375	100.5	frame_000199.jpg	longitudinal	1.51	421	112.5	frame_000223.jpg	longitudinal	2.09
376	100.9	frame_000200.jpg	longitudinal	2.53	422	113.1	frame_000224.jpg	longitudinal	1.47
377	100.9	frame_000200.jpg	longitudinal	2.15	423	113.1	frame_000224.jpg	longitudinal	1.08
378	101.3	frame_000201.jpg	longitudinal	2.62	424	113.1	frame_000224.jpg	longitudinal	1.60
379	101.3	frame_000201.jpg	longitudinal	1.53	425	113.1	frame_000224.jpg	longitudinal	2.18
380	101.3	frame_000201.jpg	longitudinal	2.34	426	113.7	frame_000225.jpg	longitudinal	2.07
381	101.8	frame_000202.jpg	longitudinal	2.48	427	113.7	frame_000225.jpg	longitudinal	1.57
382	101.8	frame_000202.jpg	longitudinal	2.08	428	113.7	frame_000225.jpg	longitudinal	1.89
383	101.8	frame_000202.jpg	longitudinal	2.14	429	114.3	frame_000226.jpg	longitudinal	2.59
384	101.8	frame_000202.jpg	longitudinal	2.00	430	114.3	frame_000226.jpg	longitudinal	2.39
385	102.2	frame_000203.jpg	longitudinal	1.91	431	114.9	frame_000227.jpg	longitudinal	2.67
386	102.2	frame_000203.jpg	longitudinal	2.55	432	114.9	frame_000227.jpg	longitudinal	2.09
387	102.2	frame_000203.jpg	longitudinal	2.36	433	114.9	frame_000227.jpg	longitudinal	2.15
388	102.7	frame_000204.jpg	longitudinal	1.94	434	115.5	frame_000228.jpg	longitudinal	2.59
389	102.7	frame_000204.jpg	longitudinal	2.11	435	115.5	frame_000228.jpg	longitudinal	2.25
390	102.7	frame_000204.jpg	longitudinal	1.89	436	115.5	frame_000228.jpg	longitudinal	0.29
391	103.1	frame_000205.jpg	longitudinal	1.97	437	116.1	frame_000229.jpg	longitudinal	2.45
392	104.0	frame_000207.jpg	longitudinal	1.15	438	116.7	frame_000230.jpg	longitudinal	2.01
393	104.5	frame_000208.jpg	longitudinal	1.96	439	117.2	frame_000231.jpg	longitudinal	2.13
394	104.9	frame_000209.jpg	longitudinal	1.99	440	117.8	frame_000232.jpg	longitudinal	1.99
395	104.9	frame_000209.jpg	longitudinal	2.13	441	118.3	frame_000233.jpg	longitudinal	2.01
396	105.4	frame_000210.jpg	longitudinal	2.26	442	118.3	frame_000233.jpg	longitudinal	2.07
397	105.9	frame_000211.jpg	longitudinal	2.50	443	118.8	frame_000234.jpg	longitudinal	2.27
398	106.3	frame_000212.jpg	longitudinal	2.60	444	118.8	frame_000234.jpg	longitudinal	2.42
399	106.8	frame_000213.jpg	longitudinal	2.44	445	118.8	frame_000234.jpg	longitudinal	2.28
400	107.4	frame_000214.jpg	longitudinal	2.56	446	119.3	frame_000235.jpg	longitudinal	2.35
401	107.9	frame_000215.jpg	longitudinal	2.51	447	119.3	frame_000235.jpg	longitudinal	2.52
402	108.4	frame_000216.jpg	longitudinal	2.29	448	119.3	frame_000235.jpg	longitudinal	2.64
403	108.4	frame_000216.jpg	longitudinal	2.03	449	119.8	frame_000236.jpg	longitudinal	1.93
404	108.9	frame_000217.jpg	longitudinal	2.26	450	120.9	frame_000238.jpg	longitudinal	1.85
405	109.5	frame_000218.jpg	longitudinal	0.84	451	121.5	frame_000239.jpg	longitudinal	1.77
406	109.5	frame_000218.jpg	longitudinal	2.27	452	121.5	frame_000239.jpg	longitudinal	2.53
407	110.1	frame_000219.jpg	longitudinal	1.33	453	122.0	frame_000240.jpg	longitudinal	2.06
408	110.1	frame_000219.jpg	longitudinal	1.64	454	122.0	frame_000240.jpg	longitudinal	0.65
409	110.1	frame_000219.jpg	longitudinal	2.35	455	122.0	frame_000240.jpg	longitudinal	1.44
410	110.7	frame_000220.jpg	longitudinal	1.97	456	122.5	frame_000241.jpg	longitudinal	2.51
411	110.7	frame_000220.jpg	longitudinal	2.13	457	123.0	frame_000242.jpg	longitudinal	2.40
412	111.3	frame_000221.jpg	longitudinal	2.55	458	123.5	frame_000243.jpg	longitudinal	2.07
413	111.3	frame_000221.jpg	longitudinal	2.47	459	124.0	frame_000244.jpg	longitudinal	2.44
414	111.9	frame_000222.jpg	longitudinal	2.44	460	124.5	frame_000245.jpg	longitudinal	2.50

Distress list — cracks by chainage

461-545 of 545

id	STA(m)	frame	type	len(m)
461	125.0	frame_000246.jpg	longitudinal	2.54
462	125.0	frame_000246.jpg	longitudinal	2.17
463	125.5	frame_000247.jpg	longitudinal	2.23
464	125.5	frame_000247.jpg	longitudinal	2.35
465	126.0	frame_000248.jpg	longitudinal	2.45
466	126.0	frame_000248.jpg	longitudinal	1.53
467	126.0	frame_000248.jpg	longitudinal	2.14
468	126.5	frame_000249.jpg	longitudinal	2.57
469	126.5	frame_000249.jpg	longitudinal	2.01
470	126.5	frame_000249.jpg	longitudinal	2.30
471	126.5	frame_000249.jpg	longitudinal	2.15
472	127.0	frame_000250.jpg	longitudinal	2.50
473	127.0	frame_000250.jpg	longitudinal	2.32
474	127.0	frame_000250.jpg	longitudinal	2.53
475	127.5	frame_000251.jpg	longitudinal	2.44
476	127.5	frame_000251.jpg	longitudinal	2.13
477	127.5	frame_000251.jpg	longitudinal	2.33
478	128.0	frame_000252.jpg	longitudinal	2.54
479	128.0	frame_000252.jpg	longitudinal	2.25
480	128.5	frame_000253.jpg	longitudinal	2.52
481	128.5	frame_000253.jpg	longitudinal	2.12
482	128.5	frame_000253.jpg	longitudinal	1.63
483	129.0	frame_000254.jpg	longitudinal	2.54
484	129.0	frame_000254.jpg	longitudinal	2.01
485	129.0	frame_000254.jpg	longitudinal	1.95
486	129.0	frame_000254.jpg	longitudinal	1.76
487	129.5	frame_000255.jpg	longitudinal	2.55
488	130.0	frame_000256.jpg	longitudinal	2.50
489	130.4	frame_000257.jpg	longitudinal	2.45
490	130.4	frame_000257.jpg	longitudinal	2.00
491	130.9	frame_000258.jpg	longitudinal	2.67
492	130.9	frame_000258.jpg	longitudinal	2.33
493	130.9	frame_000258.jpg	longitudinal	2.48
494	131.3	frame_000259.jpg	longitudinal	2.59
495	131.3	frame_000259.jpg	longitudinal	1.13
496	131.3	frame_000259.jpg	longitudinal	2.57
497	131.3	frame_000259.jpg	longitudinal	2.26
498	131.7	frame_000260.jpg	longitudinal	2.39
499	131.7	frame_000260.jpg	longitudinal	2.28
500	131.7	frame_000260.jpg	longitudinal	2.64
501	131.7	frame_000260.jpg	longitudinal	2.32
502	132.1	frame_000261.jpg	longitudinal	2.33
503	132.1	frame_000261.jpg	longitudinal	2.17
504	132.1	frame_000261.jpg	longitudinal	0.24
505	132.1	frame_000261.jpg	longitudinal	0.34
506	132.5	frame_000262.jpg	longitudinal	2.25

id	STA(m)	frame	type	len(m)
507	132.5	frame_000262.jpg	longitudinal	2.58
508	132.5	frame_000262.jpg	longitudinal	1.79
509	132.5	frame_000262.jpg	longitudinal	1.80
510	132.8	frame_000263.jpg	longitudinal	2.25
511	133.1	frame_000264.jpg	longitudinal	2.60
512	133.1	frame_000264.jpg	longitudinal	2.26
513	133.1	frame_000264.jpg	longitudinal	2.14
514	133.3	frame_000265.jpg	longitudinal	2.27
515	133.3	frame_000265.jpg	longitudinal	1.82
516	133.3	frame_000265.jpg	longitudinal	1.91
517	133.5	frame_000266.jpg	longitudinal	2.56
518	133.5	frame_000266.jpg	longitudinal	2.02
519	133.7	frame_000267.jpg	longitudinal	2.54
520	133.7	frame_000267.jpg	longitudinal	1.86
521	133.7	frame_000267.jpg	longitudinal	1.46
522	133.7	frame_000267.jpg	longitudinal	2.25
523	133.8	frame_000268.jpg	longitudinal	2.88
524	133.8	frame_000268.jpg	longitudinal	1.19
525	133.8	frame_000268.jpg	longitudinal	0.82
526	133.8	frame_000268.jpg	longitudinal	1.34
527	134.0	frame_000269.jpg	longitudinal	2.45
528	134.0	frame_000269.jpg	longitudinal	2.29
529	134.0	frame_000269.jpg	longitudinal	1.39
530	134.0	frame_000269.jpg	longitudinal	1.60
531	134.2	frame_000270.jpg	longitudinal	2.47
532	134.2	frame_000270.jpg	longitudinal	1.55
533	134.2	frame_000270.jpg	longitudinal	2.38
534	134.2	frame_000270.jpg	longitudinal	2.69
535	134.4	frame_000271.jpg	longitudinal	2.34
536	134.4	frame_000271.jpg	longitudinal	2.77
537	134.4	frame_000271.jpg	longitudinal	1.73
538	134.9	frame_000272.jpg	longitudinal	2.59
539	134.9	frame_000272.jpg	longitudinal	2.38
540	135.3	frame_000273.jpg	longitudinal	1.71
541	135.3	frame_000273.jpg	longitudinal	2.28
542	135.3	frame_000273.jpg	longitudinal	2.69
543	135.8	frame_000274.jpg	longitudinal	2.31
544	135.8	frame_000274.jpg	longitudinal	2.31
545	135.8	frame_000274.jpg	longitudinal	2.68