

Packet Index and Revision Control

Six artifacts assembled from CAD, network, electrical, and RFI exports


Page	Artifact	Review focus
1	Index	Rev C and Rev B warning
2	Floor plan	Rooms, dimensions, doors, egress, and callouts
3	Rack elevation	Rack units and device names
4	Network topology	Arrow direction, VLANs, subnets, and dashed path
5	Panel schedule	Circuit/load/breaker/emergency fields
6	RFI markup	Revision cloud, answer, and final field states

Superseded source warning

Rev B labels Lab B door as D-214A. Rev C changes the corridor door to D-214B and adds card reader CR-6 on the corridor side. Rev C controls.

Floor Plan A2.14 - Suite 214

Room dimensions, egress, and callout binding

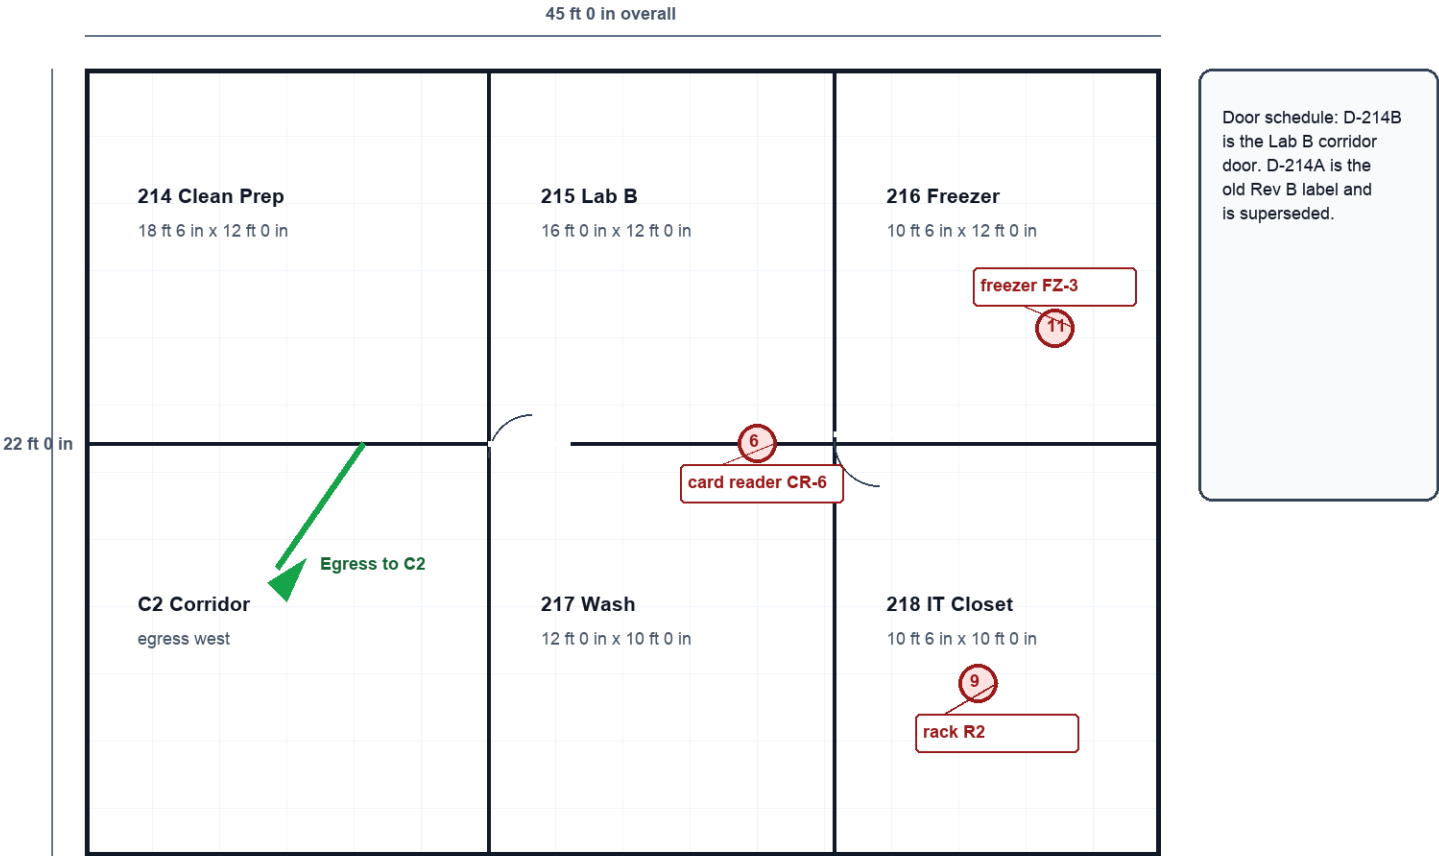

DOOR AND ROOM COORDINATION SCHEDULE

Room/door	Rev C field condition	Linked artifact
214 Clean Prep	tablet dock on D214-01	rack port CS-2/01
215 Lab B / D-214B	CR-6 corridor side; panel L2-15	RFI-214B final
216 Freezer	FZ-3 monitor at callout 11	VLAN 240 + L2-17
218 IT Closet	rack R2, UPS A	panel L2-19

Field measurement note
Overall suite width is 45 ft 0 in. Overall depth is 22 ft 0 in. Door D-214B is the only door label revised by RFI-214B.

Rack Elevation R2

U positions, devices, and patch mapping

U42

U42

Core switch CS-2
48p PoE

U36

U36

Patch panel PP-7
lab drops 214-218

U30

U30

Firewall FW-02
HA secondary

U24

U24

UPS A
2.2 kVA

U18

U18

Freezer monitor GW-3
Modbus gateway

U12

U12

NVR camera bridge
VLAN 240

U6

U0


Port	Drop	Room	Device	VLAN
CS-2/01	D214-01	214 Clean Prep	tablet dock	210
CS-2/07	D215-03	215 Lab B	card reader CR-6	230
CS-2/12	D216-02	216 Freezer	FZ-3 monitor	240
CS-2/19	D218-01	218 IT Closet	FW-02 mgmt	99

Rack note

Firewall FW-02 occupies U30-U31. Core switch CS-2 is U42-U43. NVR camera bridge belongs to VLAN 240, not VLAN 230.

Network Topology N1.07

Arrows, VLANs, subnets, and optional path

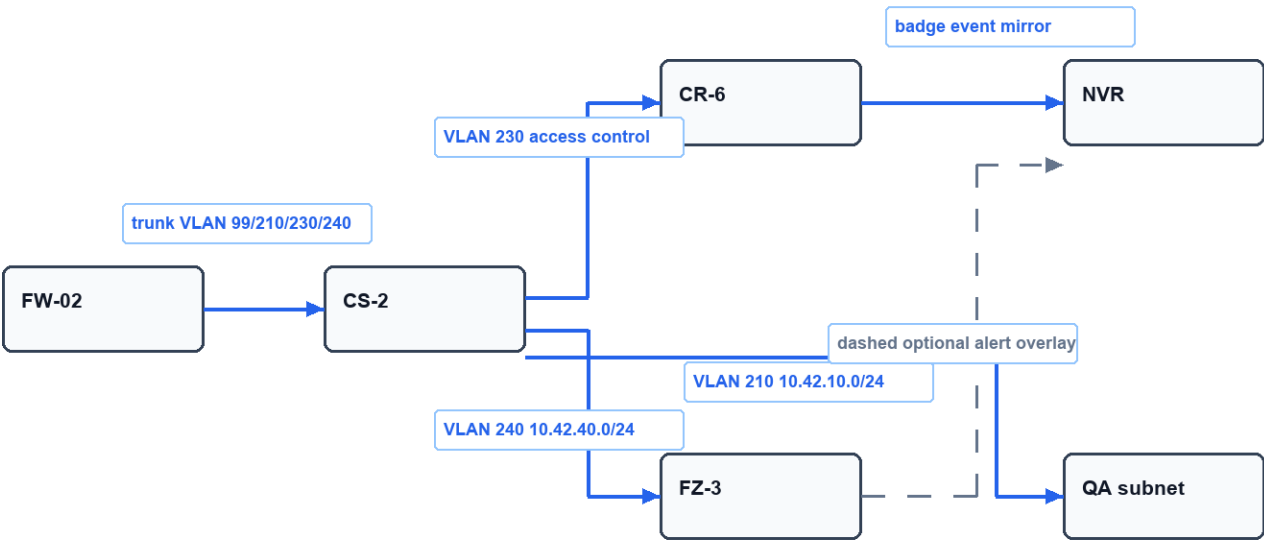

Subnet note

VLAN 240 maps to freezer and camera telemetry subnet 10.42.40.0/24. VLAN 230 is access control. VLAN 210 is QA devices.

PORT AND FIREWALL RULE EXTRACT

Rule/port	Source	Destination	VLAN	State
ACL-230-06	CR-6	NVR event mirror	230 to 240	permit one-way
ACL-240-11	FZ-3	QA subnet telemetry	240 to 210	deny except broker
TRK-CS2-FW02	CS-2	FW-02	99/210/230/240	tagged trunk
OPT-CAM	FZ-3 optional overlay	NVR	240	dashed / not base scope

Electrical Panel LP-2 Schedule

Circuit/load/breaker/emergency fields

Circuit	Load	Breaker	Emergency?	Room	Note
L2-11	Bench outlets B	20A/1P	No	215 Lab B	GFCI
L2-13	Autoclave AC-1	30A/2P	No	217 Wash	dedicated
L2-15	Door controller DC-6	20A/1P	Yes	215 Lab B	feeds CR-6
L2-17	Freezer FZ-3	20A/1P	Yes	216 Freezer	monitor required
L2-19	Rack R2 UPS	20A/1P	Yes	218 IT Closet	UPS A
L2-21	Spare	20A/1P	No	-	hold for Rev D

Panel note

Emergency circuits are L2-15, L2-17, and L2-19. L2-17 is Freezer FZ-3 and must match callout 11 on the floor plan.

LOAD SUMMARY AND EMERGENCY BRANCH CHECK

Branch	Connected load	Emergency load	Reviewer note
Normal receptacles	3.2 kVA	0.0 kVA	bench + autoclave only
Access control	0.4 kVA	0.4 kVA	DC-6 on L2-15
Cold storage	0.7 kVA	0.7 kVA	FZ-3 on L2-17
IT / UPS	1.1 kVA	1.1 kVA	R2 UPS on L2-19
Spare capacity	2.6 kVA	-	L2-21 held for Rev D

- ☒ Emergency branch labels match floor plan callouts
- ☐ L2-21 released for construction
- ☐ Freezer monitor moved to normal power


RFI-214B Markup and Final Answer

Revision cloud, answer, and final field states

RFI	Discipline	Opened	Answered	Status
214B	Access control / architectural	2026-06-09	2026-06-12	Issued Rev C

Question: Door label conflict. CAD Rev B shows D-214A at Lab B corridor. Field sticker and security rough-in show D-214B. Which label controls for access control schedule?

Response: Use D-214B for the Lab B corridor door. Add CR-6 card reader on corridor side. Update access control schedule and panel LP-2 circuit L2-15. Rev C dated 2026-06-12 controls.

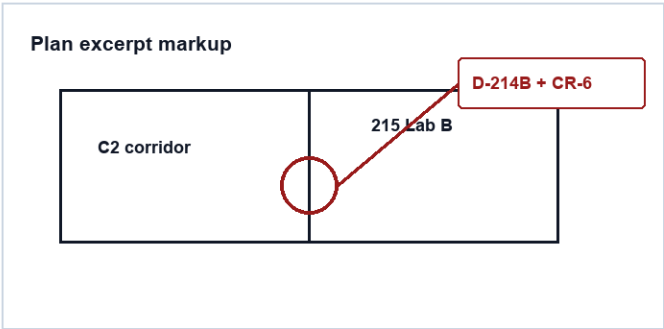

Field	Rev B	Rev C final
Door label	D-214A	D-214B
Reader	none	CR-6 corridor side
Circuit	unassigned	L2-15
Schedule status	draft	issued

Signoff
Answered by A. Verma, Architect of Record. Security reviewer initials: TN. Contractor acknowledged in field log 2026-06-13.