



ACUREN

NONDESTRUCTIVE EXAMINATION

Acuren Group Inc.

2 - 240 Taiganova Crescent
Fort McMurray, AB, Canada T9K 0T4
www.acuren.com

Phone: 780.790.1776
Fax: 780.790.9061



A Higher Level of Reliability

Client: **Suncor Energy Inc.**
Suncor Oil Sands
Fort McMurray, AB

PAGE: 1 of 5

DATE: February 24, 2026

ACUREN JOB #: 272-J280794

REPORT #: **UT-BELKAR-26-052**

CONTRACT/PO: SUENTQ00169932 WO: 300648577

ATTENTION: **Condition Monitoring Group**

WORK LOCATION: Plant 57

PROJECT: Corrosion 2026

ITEM(S) EXAMINED: **CML 1.52, 1.29 & 4.09**

PART #: See results MATERIAL: Stainless Steel THICKNESS: Various

SCOPE: Perform UT Thickness scans as per request.

TYPE OF INSPECTION: Ultrasonic

TEST DETAILS:

ACCEPTANCE STANDARD: Client's Information

REVISION: N/A

PROCEDURE/TECHNIQUE: CAN-UT-14T001

REVISION: 12

TYPE: Thickness

METHOD: Contact

INSTRUMENT: Olympus

MODEL: 38 DL Plus

S/N: 193347201

CAL DUE: February 15, 2027

CAL. BLOCK:

S/N:

CABLE-TYPE: Coaxial

LENGTH: 5ft

CAL. BLOCK: Step Block

S/N: **UT-1883 SS(1"-.5")**

COUPLANT: Sono 600

Probe & Technique Details:

	TEST ANGLE (°)	PROBE TYPE	CRYSTAL SIZE	FREQ. (MHZ)	SERIAL NUMBER	DAMPING Ω	TEST FROM	REFERENCE REFLECTOR	TRANSFER VALUE	REFERENCE		SCAN dB	RANGE
										dB	% FSH		
1													
2	0	D799	.312"	5	1527747	N/A	OD	Backwall	0	65	80	N/A	2.00"
3													
4													

TEST SURFACE CONDITION: Bare

TEST SURFACE TEMPERATURE: 86F & 140F & 40F

RESULTS:

Circuit:
57-008U 1,3-3
CML
1.52, 1.29 & 4.09

Client acknowledges receipt and custody of the report or other work ("Deliverable"). Client agrees that it is responsible for assuring that acceptance standards, specifications and criteria in the Deliverable and Statement of Work ("SOW") are correct. Client acknowledges that Acuren is providing the Deliverable according to the SOW, and not any other standards. Client acknowledges that it is responsible for the failure of any items inspected to meet standards, and for remediation. Client has 15 business days following the date Acuren provides the Deliverable to inspect it, identify deficiencies in writing, and provide written rejection, or else the Deliverable will be deemed accepted. The Deliverable and other services provided by Acuren are governed by a Master Services Agreement ("MSA"). If the parties have not entered into an MSA, then the Deliverable and services are governed by the SOW and the "Acuren Standard Service Terms" (www.acuren.com/serviceterms) in effect when the services were ordered.

CLIENT:

CLIENT PRINTED NAME

CLIENT SIGNATURE

ACCEPTED & ACKNOWLEDGED BY

ACUREN

Bellen

TECHNICIAN:

Karl Bellen

1st Technician

CGSB UT1

CGSB Reg. #29875

2nd Technician

CGSB UT1



CGSB Reg. #0000

REVIEWER:

JOSHUA ROBERTSON
#28293

DTR No.: N/A

(Generated Using: CAN-QUA-02F007 R10 - 12/09/2021)

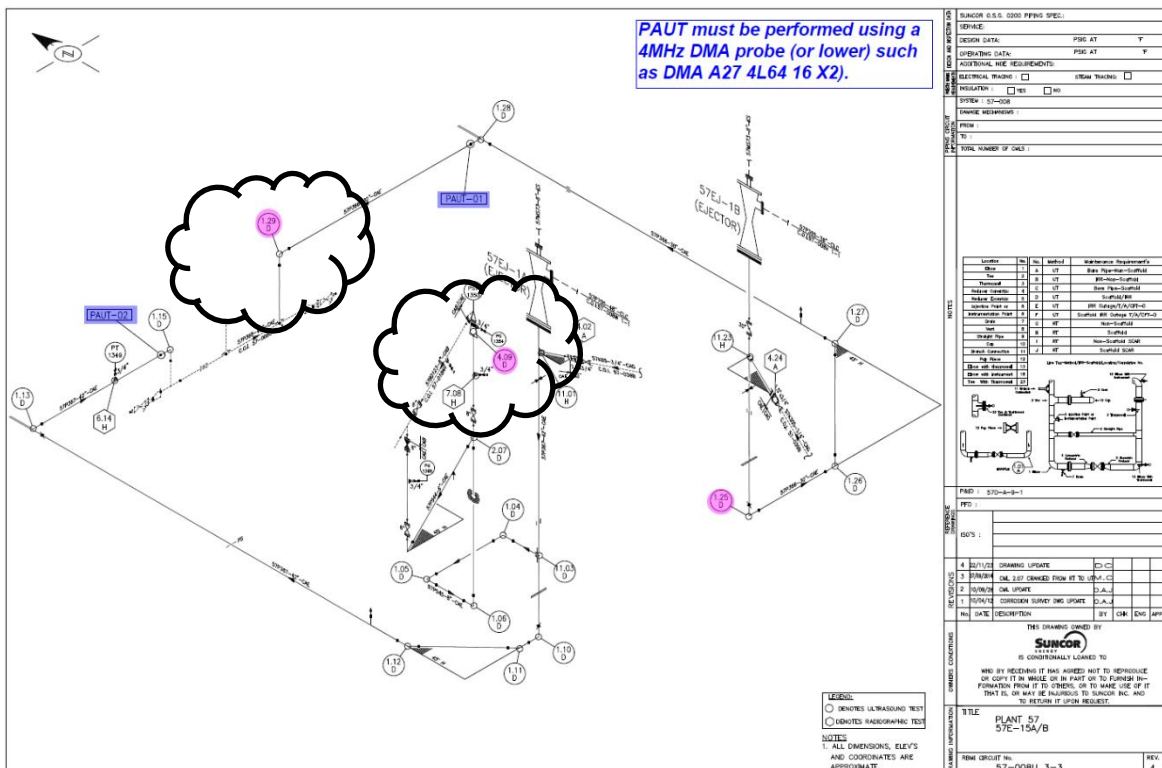


CML 1.52 ELBOW:

A 4"x4" GRID SCAN WAS PERFORMED AT CML 1.52 ELBOW. "A-M" STARTS AT THE TOP AND GOES CLOCKWISE WITH RESPECT TO FLOW. "1-12" GOES WITH THE FLOW.



CML 1.52 ELBOW													
4"x4"	A	B	C	D	E	F	G	H	I	J	K	L	M
UPSTREAM WELD													
EXTRADOS			INTRADOS						EXTRADOS				
1	0.367	0.373	0.369	0.372	0.378	0.375	0.377	0.371	0.365	0.369	0.373	0.371	0.369
2	0.363	0.362	0.364	0.368	0.377	0.381	0.376	0.381	0.374	0.371	0.370	0.363	0.363
3	0.365	0.360	0.364	0.372	0.379	0.377	0.365	0.377	0.379	0.372	0.367	0.361	0.362
4	0.364	0.361	0.360	0.373	0.375	0.379	0.358	0.375	0.385	0.376	0.366	0.359	0.361
5	0.370	0.359	0.357	0.372	0.381	0.364	0.362	0.379	0.382	0.374	0.362	0.360	0.366
6	0.361	0.358	0.359	0.370	0.378	0.362	0.359	0.373	0.382	0.380	0.363	0.358	0.364
7	0.361	0.359	0.360	0.375	0.382	0.368	0.362	0.366	0.383	0.379	0.364	0.362	0.362
8	0.364	0.358	0.364	0.376	0.380	0.370	0.368	0.374	0.387	0.376	0.365	0.360	0.366
9	0.361	0.357	0.363	0.373	0.382	0.369	0.366	0.377	0.379	0.375	0.368	0.361	0.363
10	0.367	0.359	0.361	0.371	0.378	0.379	0.373	0.378	0.378	0.370	0.369	0.363	0.372
11	0.363	0.359	0.366	0.372	0.373	0.381	0.375	0.378	0.375	0.372	0.368	0.361	0.370
12	0.365	0.365	0.364	0.371	0.370	0.373	0.373	0.372	0.372	0.369	0.371	0.365	0.368
DOWN STREAM WELD													




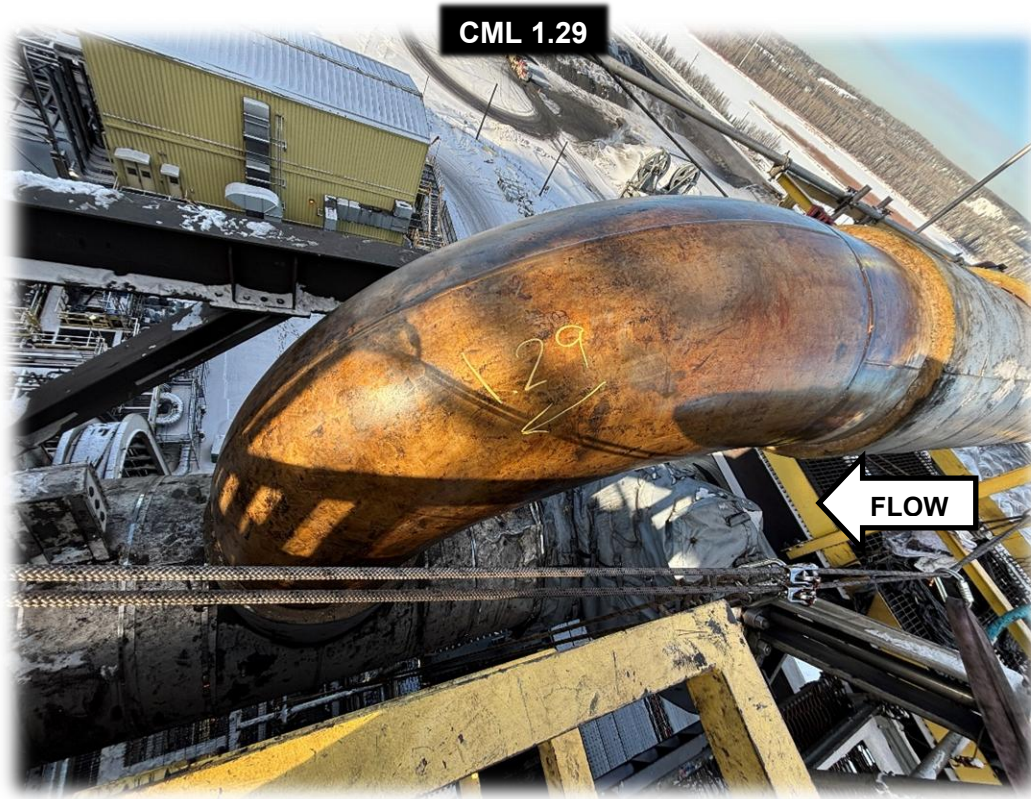


UT REPORT - ELBOW

	DATE (MM/DD/YYYY):	02/24/2026	METHOD:	Corrosion ☐	Erosion ☒
	COMPANY:	ACUREN	MATERIAL:	Carbon Steel ☐	Stainless Steel ☒
	TECHNICIAN:	Karl Bellen	ADDITIONAL INFORMATION: SURFACE TEMP 40F & 150F		
	ASSISTANT:				

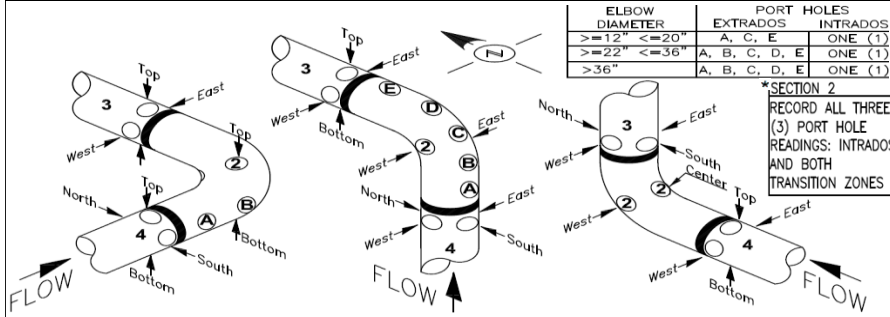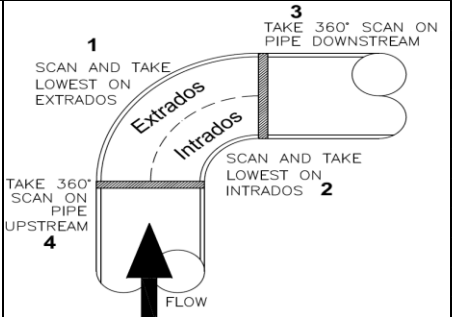PORT HOLES - CORROSION													FULL SCAN - EROSION				
																	
CIRCUIT	CML	SECTION	DIAM.	A	B	C	D	E	NORTH	SOUTH	EAST	WEST	TOP	BOTTOM	CENTER	HIGH	COMMENTS
57-008U 1-3	1.52	1	16"						0.357								40F
		2	16"										0.358			SEE GRID	
		3	16"													N/A FLANGE	
		4	16"													N/A FLANGE	
57-008U 3-3	1.29	1	30"										0.342			0.374	150F
		2	30"													0.371	
		3	30"						0.372			0.287				0.388	
		4	30"							0.382						0.403	

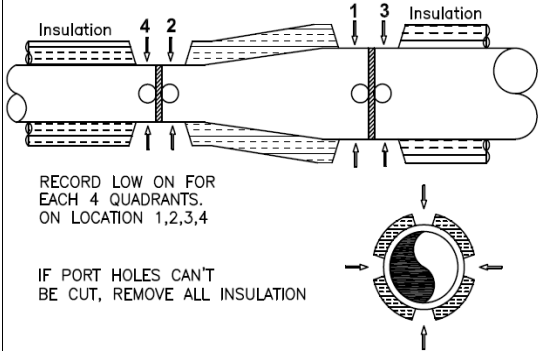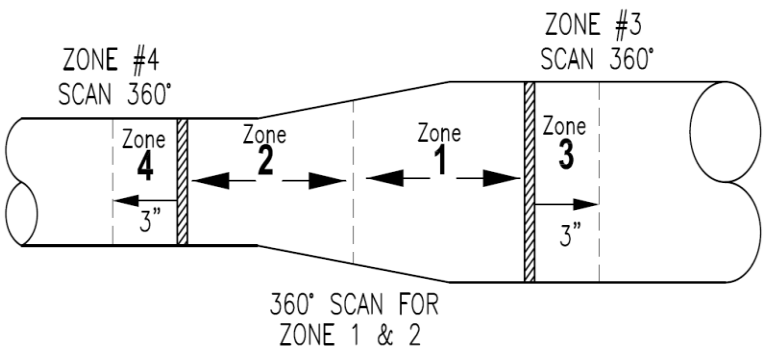

UT REPORT - REDUCER											
		DATE (MM/DD/YYYY):		02/24/2026		METHOD: Corrosion ☐		Erosion ☒			
		COMPANY:		ACUREN		MATERIAL: Carbon Steel ☐		Stainless Steel ☒			
		TECHNICIAN:		Karl Bellen		ADDITIONAL INFORMATION:		SURFACE TEMP 40F			
		ASSISTANT:									
PORT HOLES - CORROSION						FULL SCAN - EROSION					
											
CIRCUIT	CML	ZONE	DIAM.	NORTH	SOUTH	EAST	WEST	TOP	BOTTOM	HIGH	COMMENTS
57-008U 3-3	4.09	1	8"	0.296						0.325	
		2	6"		0.326					0.365	
		3	8"		0.318					0.340	
		4	6"								N/A FLANGE