

**Acuren Group Inc.**

2 - 240 Taiganova Crescent
Fort McMurray, AB, Canada T9K 0T4
www.acuren.com

Phone: 780.790.1776
Fax: 780.790.9061

A Higher Level of Reliability

Page 1 of 4

NONDESTRUCTIVE EXAMINATION

CLIENT: **Suncor Energy Inc.**
Suncor Oil Sands
Fort McMurray, AB

DATE: FEB 27 2026

ACUREN JOB #: 272-J280794

REPORT #: **UT-ROBJOS-26-061**

CONTRACT/PO: SUENTQ00169932

WO# 300655037

ATTENTION: **CONDITION MONITORING GROUP**

WORK LOCATION: Plant 57

PROJECT: **CORROSION 2026**

ITEM(S) EXAMINED: **CML 2.37**

PART #: See results MATERIAL: **CARBON STEEL** THICKNESS: Various

SCOPE: Perform UT thickness scans as per request.

TYPE OF INSPECTION: Ultrasonic

TEST DETAILS:

ACCEPTANCE STANDARD: Client's information

REVISION: N/A

PROCEDURE/TECHNIQUE: CAN-UT-14T001

REVISION: 12

TYPE: Thickness

METHOD: Contact

INSTRUMENT: Olympus

MODEL: 38 DL Plus

S/N: 193347201

CAL DUE: FEB 15 2027

CAL. BLOCK:

CABLE-TYPE: Coaxial

LENGTH: 3ft

CAL. BLOCK: Step block

S/N: 21-1824 CS

COUPLANT: Sono 600

Probe & Technique Details:

	TEST ANGLE (°)	PROBE TYPE	CRYSTAL SIZE	FREQ. (MHz)	SERIAL NUMBER	DAMPING Ω	TEST FROM	REFERENCE REFLECTOR	TRANSFER VALUE	REFERENCE		SCAN dB	RANGE
										dB	% FSH		
1	0	D799	3/8"	5	1566952	N/A	OD	Backwall	0	65	80	N/A	2.00
2													
3													
4													

TEST SURFACE CONDITION: BARE

TEST SURFACE TEMPERATURE: 93°F

RESULTS:

Readings, Grids & Photos on attached pages.

Circuit:

57-034C 4-7

CML:

2.37

Client acknowledges receipt and custody of the report or other work ("Deliverable"). Client agrees that it is responsible for assuring that acceptance standards, specifications and criteria in the Deliverable and Statement of Work ("SOW") are correct. Client acknowledges that Acuren is providing the Deliverable according to the SOW, and not any other standards. Client acknowledges that it is responsible for the failure of any items inspected to meet standards, and for remediation. Client has 15 business days following the date Acuren provides the Deliverable to inspect it, identify deficiencies in writing, and provide written rejection, or else the Deliverable will be deemed accepted. The Deliverable and other services provided by Acuren are governed by a Master Services Agreement ("MSA"). If the parties have not entered into an MSA, then the Deliverable and services are governed by the SOW and the "Acuren Standard Service Terms" (www.acuren.com/service/terms) in effect when the services were ordered.

CLIENT:

CLIENT PRINTED NAME

CLIENT SIGNATURE

ACCEPTED & ACKNOWLEDGED BY

ACUREN

TECHNICIAN:


JOSHUA ROBERTSON

1ST TECHNICIAN
CGSB # UT1, MT2
CGSB Reg # 28293



DTR No.: N/A

REVIEWER: **JINEIL BALLESTEROS**
CGSB# 29240

(Generated Using: CAN-QUA-02F007 R09 - 02/26/2020)

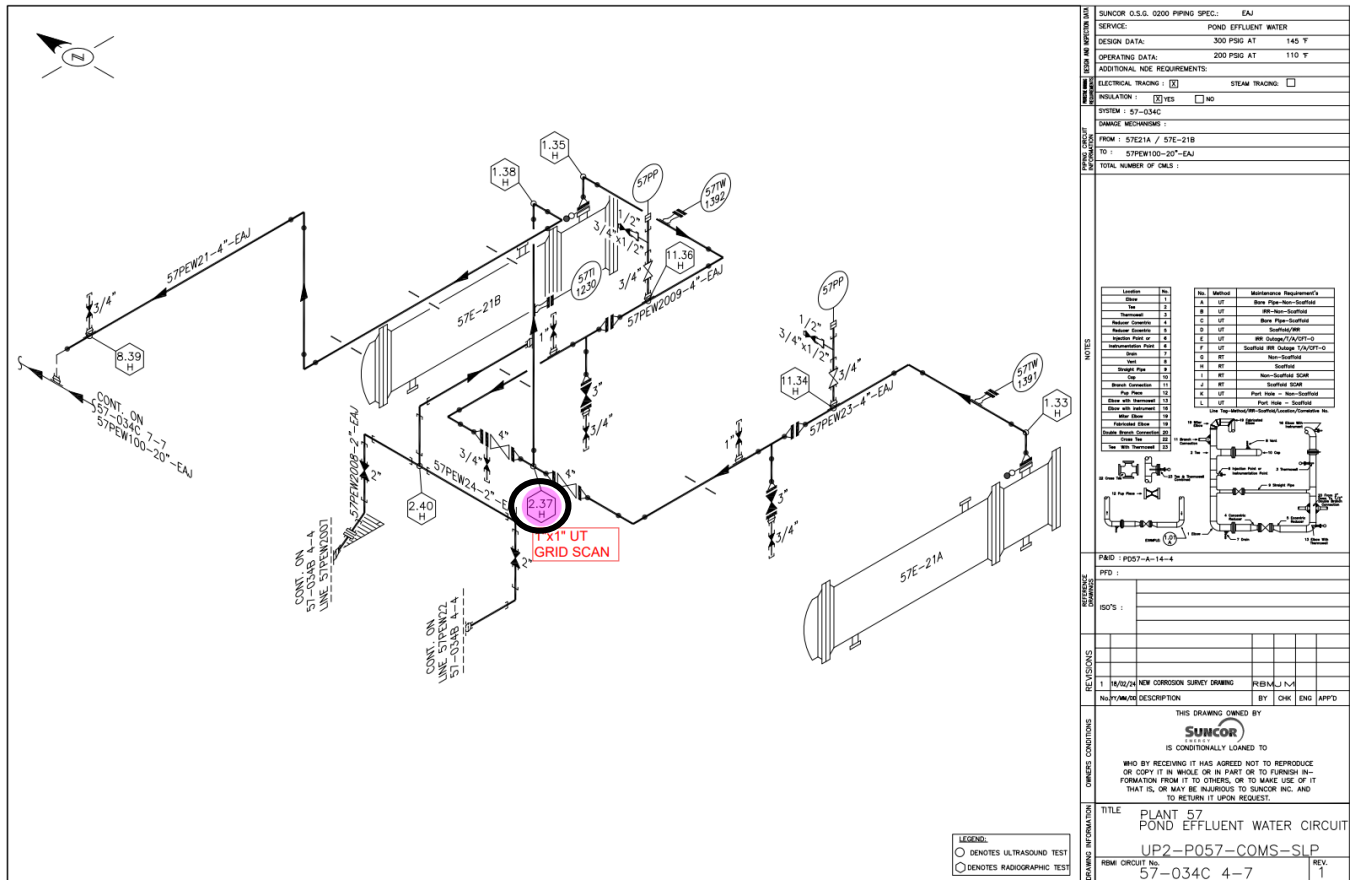

CML 2.37

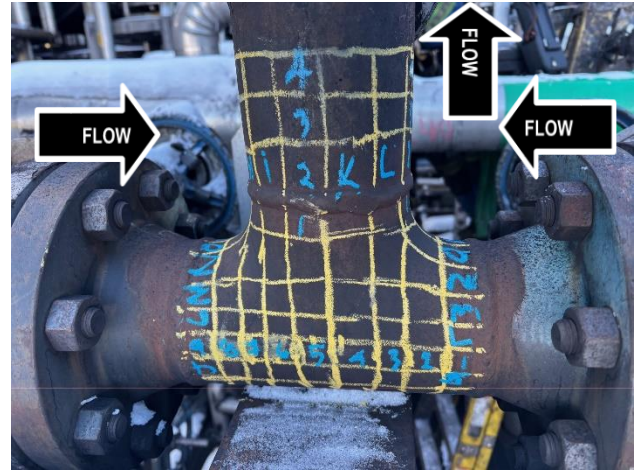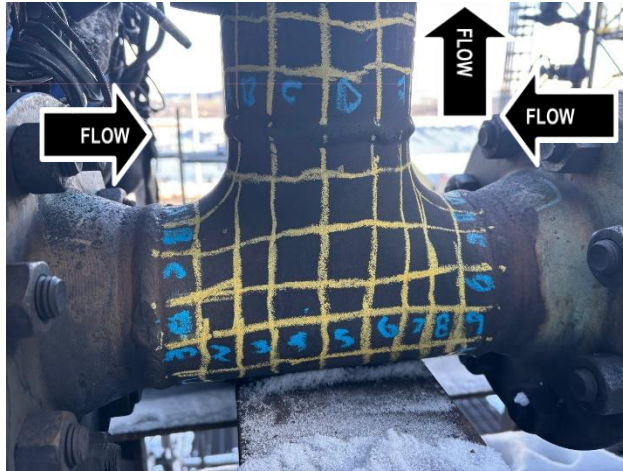

NOTE: STRUCTURAL OBSTRUCTION PRESENT ON BOTTOM OF TEE PREVENTING FULL SCAN ON BOTTOM OF SECTION 4 AND 2.

NOTE: CML 2.37 GRID STARTS ON TOP. LETTERS A-O GO CLOCKWISE WITH RESPECT TO FLOW. NUMBERS 1-9 GO WITH FLOW.

CML 2.37																
1"x1"	A	B	C	D	E	F	G	H	I	J	K	L	M	N	O	
	FLANGE															
1	0.351	0.314	0.311	0.310	0.316	0.313	0.317	0.297	0.304	0.304	0.302	0.300	0.310	0.321	0.338	SEC 1
2	0.343	0.330	0.328	0.326	0.321	0.319	0.315	0.308	0.315	0.318	0.307	0.311	0.304	0.317	0.333	
3		0.293	0.304	0.322	0.327	0.339			0.323	0.325	0.311	0.306	0.287	0.270		SEC 4
4		0.276	0.267	0.310	0.328	0.338			0.334	0.322	0.312	0.295	0.275	0.257		
5	TEE NECK	0.274	0.272	0.315	0.330	0.344			0.343	0.325	0.309	0.294	0.285	0.247	TEE NECK	SEC 4
6		0.259	0.279	0.323	0.330	0.331			0.327	0.323	0.314	0.303	0.286	0.259		
7		0.293	0.314	0.322	0.326	0.325			0.320	0.311	0.309	0.307	0.306	0.284		SEC 2
8		0.340	0.342	0.324	0.326	0.318	0.319		0.306	0.305	0.306	0.305	0.313	0.322	0.344	
9		0.330	0.307	0.300	0.306	0.302	0.305	0.301	0.303	0.293	0.288	0.292	0.295	0.311	0.329	0.339
	FLANGE															

NOTE: CML 2.37 TEE NECK GRID STARTS AT NORTH. LETTERS A-M GO CLOCKWISE WITH RESPECT TO FLOW. NUMBERS 1-4 GO WITH FLOW.

CML 2.37 TEE NECK														
1"x1"	A	B	C	D	E	F	G	H	I	J	K	L	M	
1	0.280	0.245	0.240	0.233	0.241	0.266	0.286	0.287	0.247	0.247	0.247	0.259	0.281	SEC 3
	TEE NECK WELD													
2	0.232	0.238	0.236	0.232	0.227	0.207	0.195	0.212	0.213	0.199	0.197	0.213	0.229	SEC 7
3	0.231	0.207	0.218	0.214	0.204	0.217	0.202	0.207	0.206	0.203	0.196	0.191	0.187	
4	0.186	0.197	0.209	0.219	0.209	0.172	0.194	0.204	0.199	0.200	0.200	0.208	0.184	

FLOW



ACUREN JOB # 272-J280794
 REPORT # UT-ROBJOS-26-061

UT REPORT - TEE											
		DATE (MM/DD/YYYY): 2/27/2026					AREA 1 DEPENDS ON ORIENTATION: TEE NORTH - SOUTH AREA 1 IS AT NORTH TAKE READINGS AT ARROWS. VIEW FACING NORTH. AREA 4 IS ON TOP. TEE TOP - BOTTOM AREA 1 IS AT TOP TAKE READINGS AT ARROWS. VIEW FACING BOTTOM. AREA 4 IS ON SOUTH. TEE EAST - WEST AREA 1 IS AT EAST TAKE READINGS AT ARROWS. VIEW FACING EAST. AREA 4 IS IN THE SOUTH.				
		COMPANY: ACUREN									
		TECHNICIAN: Joshua Robertson									
		ASSISTANT:									
METHOD: Corrosion ☐ Erosion ☒											
MATERIAL: Carbon Steel ☒ Stainless Steel ☐											
ADDITIONAL INFORMATION: SURFACE TEMP 93F											
CIRCUIT	CML	SECTION	DIAM.	NORTH	SOUTH	EAST	WEST	TOP	BOTTOM	HIGH	
57-034C 4-7	2.37	1	4"						0.297		
		2	4"						0.288		
		3	4"				0.233				
		4	4"			0.247					
		5	4"								*N/A FLANGE*
		6	4"								*N/A FLANGE*
		7	4"			0.172					