

List of pages in this Trip Kit

- Trip Kit Index
- Airport Information For RKJB
- Terminal Charts For RKJB
- Revision Letter For Cycle 04-2025
- Change Notices
- Notebook

General Information

Location: MUAN KOR
ICAO/IATA: RKJB / MWX
Lat/Long: N34°59.5', E126°23.0'
Elevation: 51 ft

Airport Use: Public
Daylight Savings: Not Observed
UTC Conversion: -9:00 = UTC
Magnetic Variation: 8.0°W

Fuel Types: 100 Octane (LL), Jet A-1
Customs: Yes
Airport Type: IFR
Landing Fee: Yes
Control Tower: Yes
Jet Start Unit: No
LLWS Alert: No
Beacon: Yes

Sunrise: 2212 Z
Sunset: 0924 Z

Runway Information

Runway: 01
Length x Width: 9186 ft x 148 ft
Surface Type: asphalt
TDZ-Elev: 38 ft
Lighting: Edge, ALS, Centerline, TDZ

Runway: 19
Length x Width: 9186 ft x 148 ft
Surface Type: asphalt
TDZ-Elev: 49 ft
Lighting: Edge, ALS, Centerline, TDZ
Displaced Threshold: 984 ft

Communication Information

ATIS: 127.425
Muan Tower: 118.850
Muan Tower: 118.250
Muan Ground: 121.700
Gwangju Approach: 120.475
Gwangju Approach: 130.000
Gwangju Departure: 124.700
Gwangju Departure: 124.000

RKJB/MWX
MUAN INTL

 **JEPPESSEN**
29 OCT 21 **10-2** **Eff 3 Nov 1600Z**

MUAN, KOREA
STAR

RADIO COMMUNICATIONS FAILURE PROCEDURES

IFR

1) GENERAL

- a) No person may take off unless two-way radio communications can be maintained with the Air Traffic Control.
- b) On recognition of communication failure during flight, squawk 7600 and if necessary to ensure safe altitude, climb to Minimum Sector Altitude or above to MAINTAIN obstacle clearance.

Then comply with the following procedure:

2) VFR condition

If the failure occurs in VFR conditions, or if VFR conditions are encountered after the failure, each pilot shall continue the flight under VFR and land as soon as practicable.

3) IFR condition

If the failure occurs in IFR conditions, or if paragraph 2 of this section cannot be complied with, each pilot shall continue the flight according to the following:

ARRIVAL

Runway 01 in use

- 1) Proceed to OLBES IAF, OVGEN IAF or PEGRO IAF as advised or instructed by ATC and commence descent and approach as close as possible to the expect further clearance time (EFC) issued by ATC or estimated time of arrival (ETA) filed in the flight plan; and
- 2) Land, if possible, within 30 minutes after ETA or the last acknowledged EFC or ETA, whichever is later.

Runway 19 in use

- 1) Proceed to GUPLA IAF or DOVRA IAF as advised or instructed by ATC and commence descent and approach as close as possible to the expect further clearance time (EFC) issued by ATC or estimated time of arrival (ETA) filed in the flight plan; and
- 2) Land, if possible, within 30 minutes after ETA or the last acknowledged EFC or ETA, whichever is later.

RKJB/MWX
MUAN INTL

JEPPESSEN
29 OCT 21 **(10-2A)** **Eff 3 Nov 1600Z**


MUAN, KOREA
RNAV STAR

ATIS
127.425

Apt Elev
51

Alt Set: hPa Trans level: FL140
RNAV 1 operation GNSS required
ATS surveillance service required.

KAMIT 2C (KAMIT 2C) [KAMI2C]
MANGI 2C (MANGI 2C) [MANG2C]
MANGI 2H (MANGI 2H) [MANG2H]
RNAV ARRIVALS
(RWY 01)

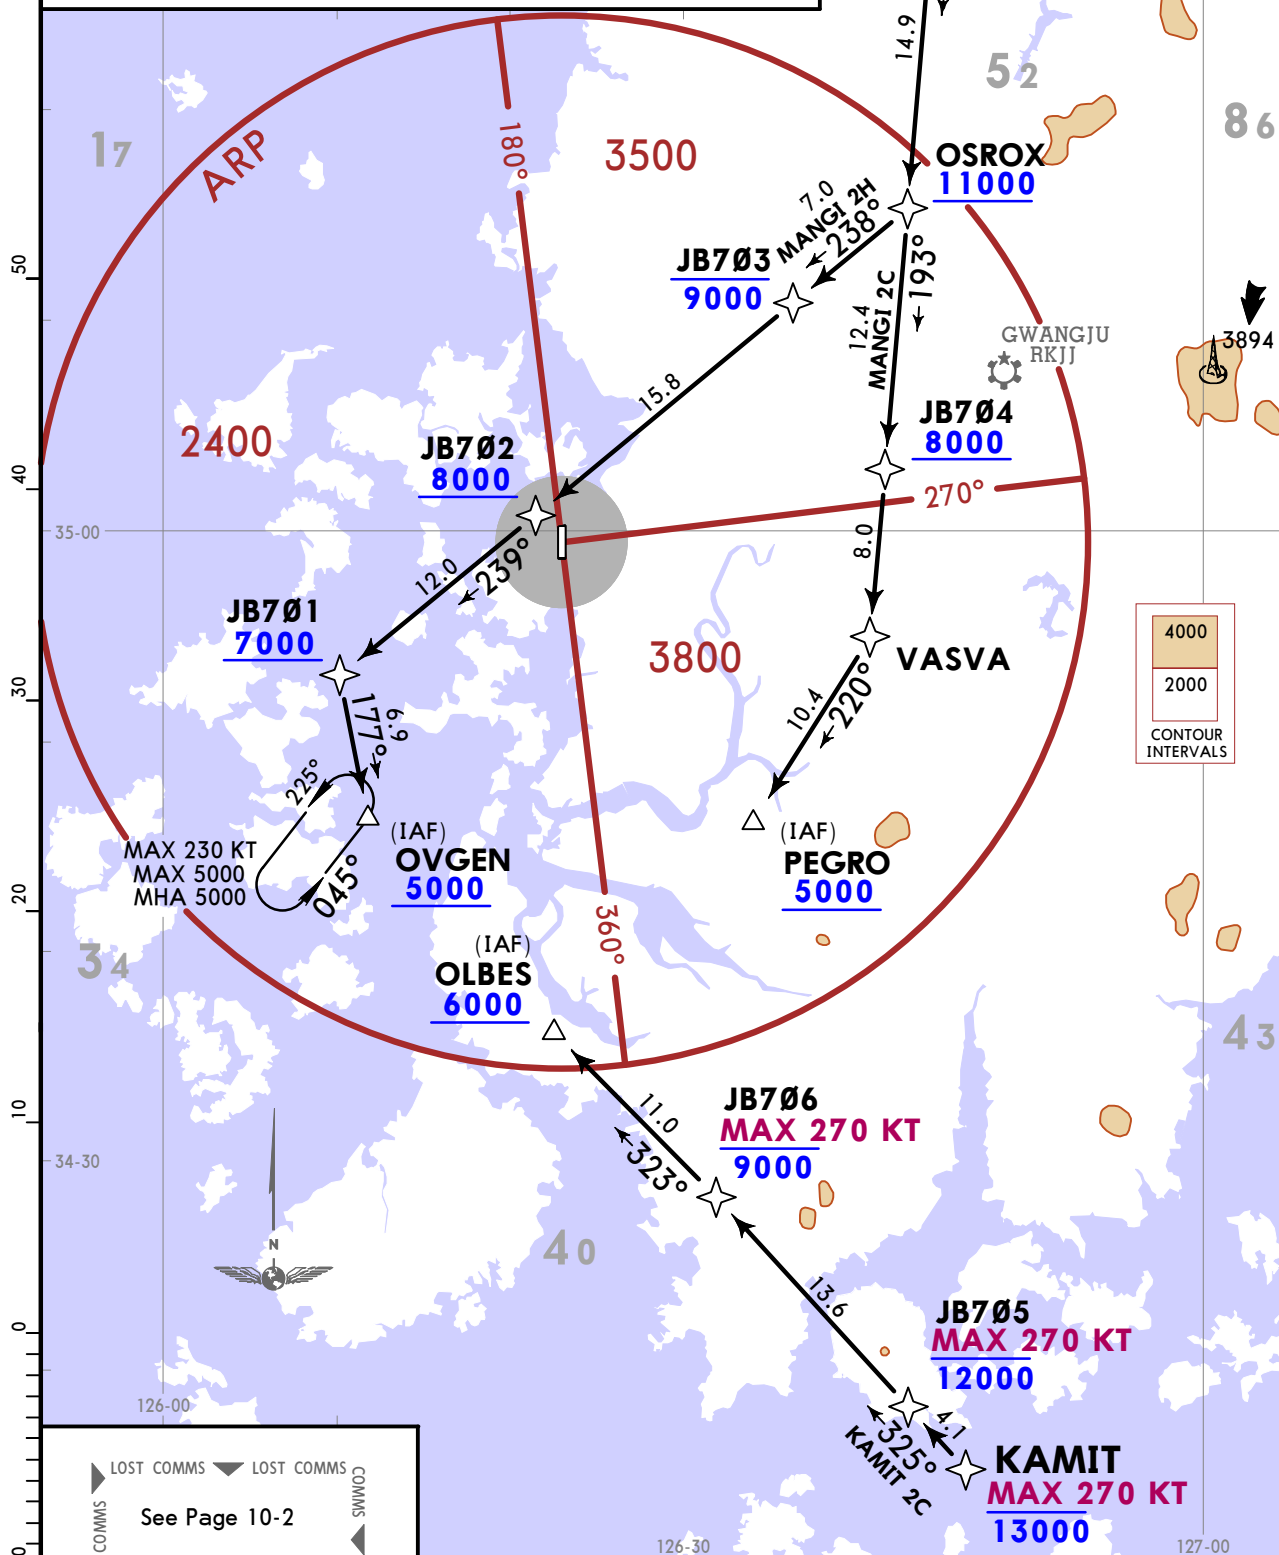


STAR	ROUTING
KAMIT 2C	KAMIT - JB705 - JB706 - OLBES.
MANGI 2C	MANGI - OSROX - JB704 - VASVA - PEGRO.
MANGI 2H	MANGI - OSROX - JB703 - JB702 - JB701 - OVGEN.

RKJB/MWX
MUAN INTL

JEPPESSEN
29 OCT 21 **10-2B** **Eff 3 Nov 1600Z**

MUAN, KOREA
RNAV STAR

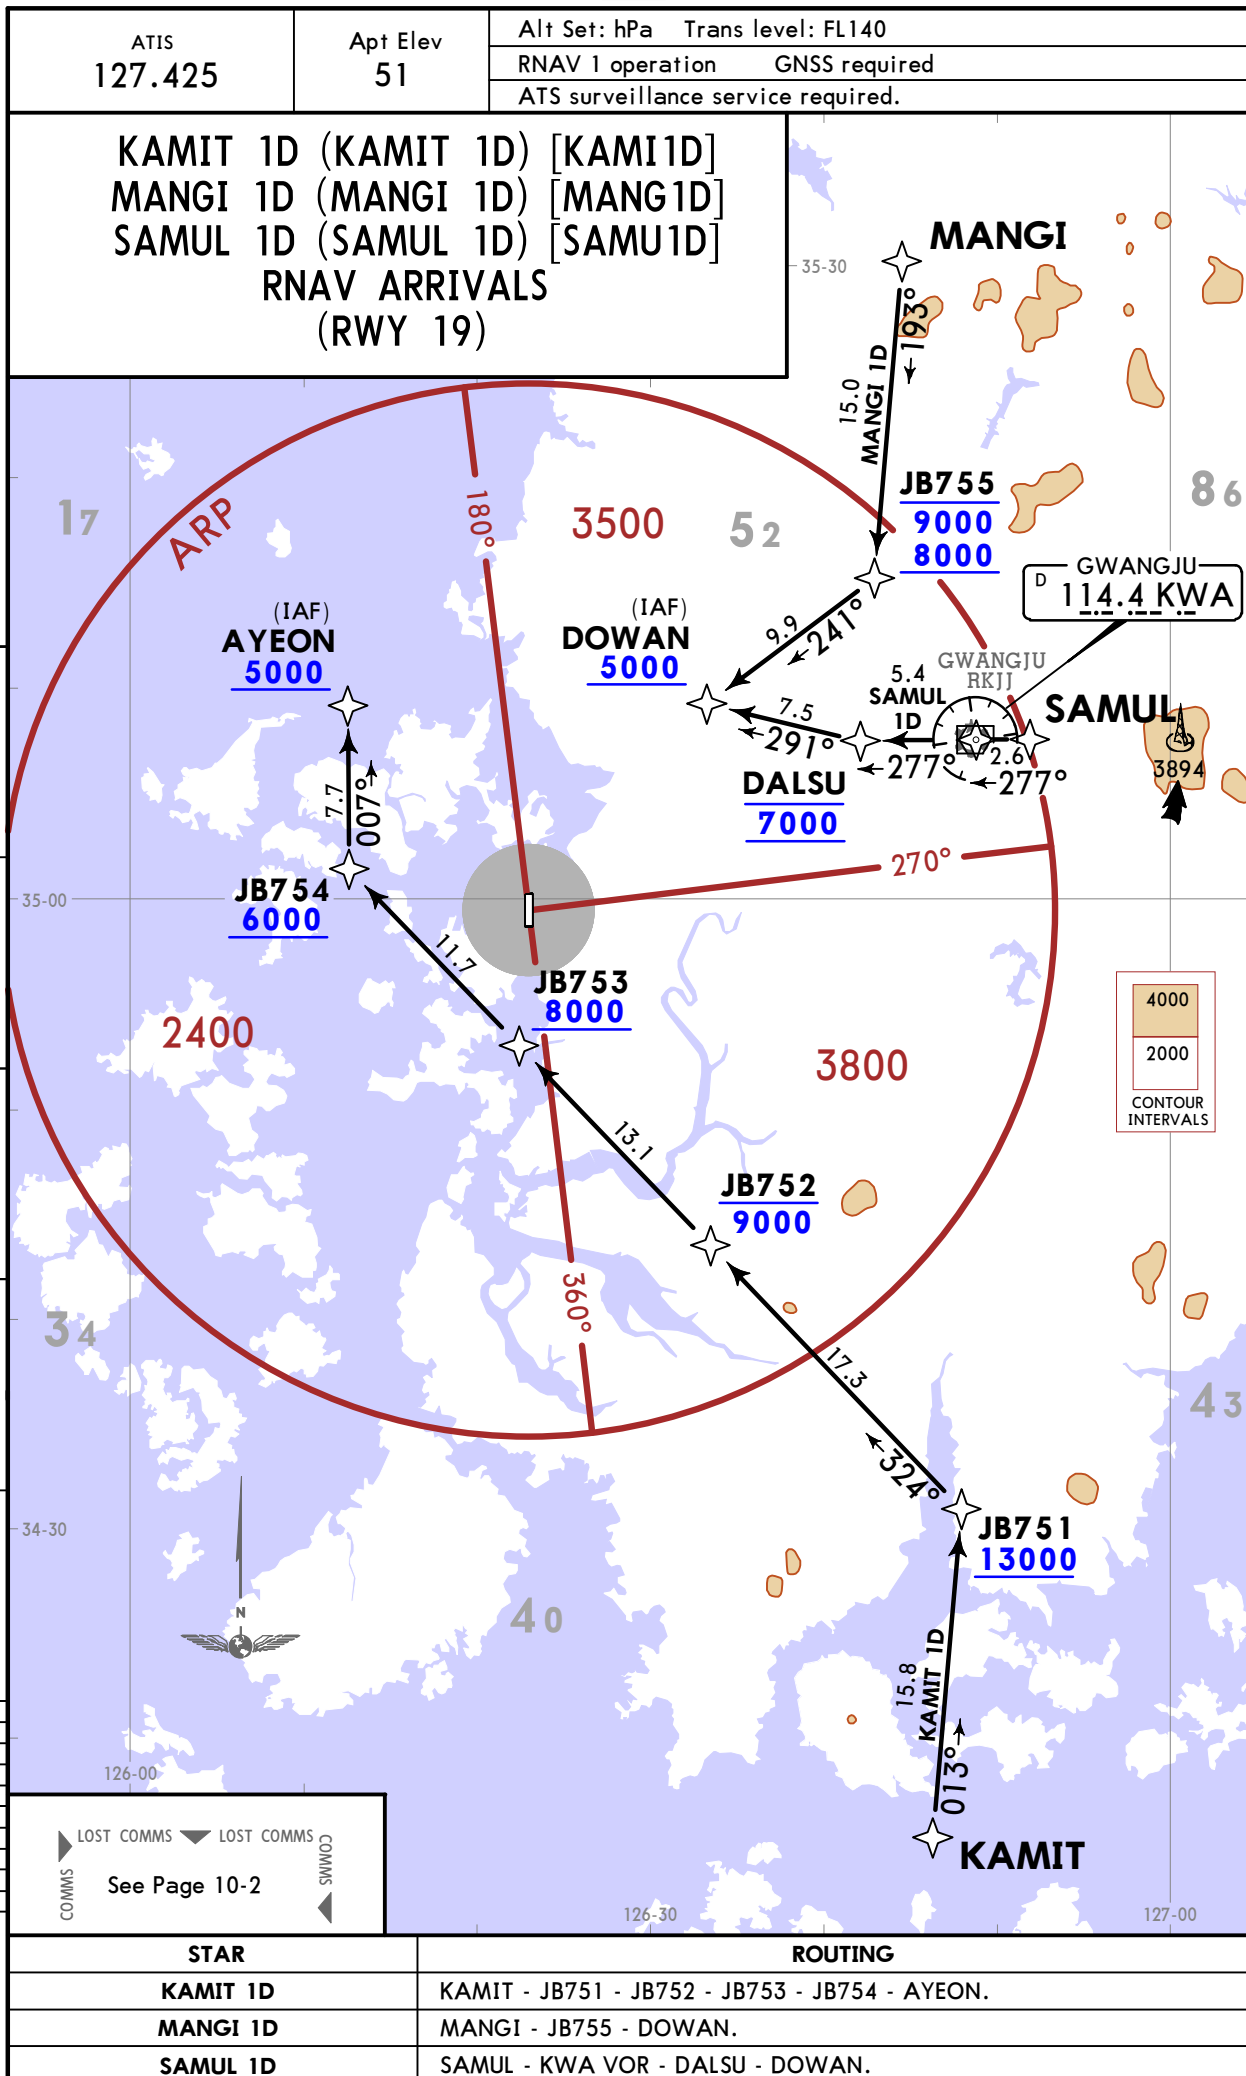

RKJB/MWX
MUAN INTL

 **JEPPESSEN**
29 OCT 21 **10-3** **Eff 3 Nov 1600Z**

MUAN, KOREA
SID

RADIO COMMUNICATIONS FAILURE PROCEDURES

IFR

1) GENERAL

- a) No person may take off unless two-way radio communications can be maintained with the Air Traffic Control.
- b) On recognition of communication failure during flight, squawk 7600 and if necessary to ensure safe altitude, climb to Minimum Sector Altitude or above to MAINTAIN obstacle clearance.

Then comply with the following procedure:

2) VFR condition

If the failure occurs in VFR conditions, or if VFR conditions are encountered after the failure, each pilot shall continue the flight under VFR and land as soon as practicable.

3) IFR condition

If the failure occurs in IFR conditions, or if paragraph 2 of this section cannot be complied with, each pilot shall continue the flight according to the following:

DEPARTURE

a) Under Pilot Navigation

Runway 01 in use

- RNAV MAKSA 1N, RNAV DOTOL 1N, KWA 3N:

Proceed by the route, altitude/flight level assigned at the last ATC clearance received.

Runway 19 in use

- RNAV MAKSA 1S, RNAV MAKSA 6S, RNAV DOTOL 1S, KWA 3S, IPDAS 3S:

Proceed by the route, altitude/flight level assigned in the last ATC clearance received.

b) Under RADAR Vectoring

- 1) Proceed by the direct route from the point of radio failure to the fix, route or airway specified in the vector clearance;
- 2) In the absence of an assigned route, proceed by the route that ATC has advised may be expected in a further clearance; or
- 3) In the absence of an assigned route or a route that ATC has advised may be expected in a further clearance, by the route filed in the flight plan; and
- 4) MAINTAIN minimum enroute altitude (MEA) or the altitude/flight level cleared in the last ATC clearance received, whichever is higher, for 20 minutes; then
- 5) Continue the flight with altitude/flight level filed in the flight plan.


RKJB/MWX
MUAN INTL

JEPPESSEN
29 OCT 21 10-3A Eff 3 Nov 1600Z

MUAN, KOREA
RNAV SID

GWANGJU Departure 124.0 124.7	Apt Elev 51	Trans alt: 14000
		RNAV 1 operation GNSS required
		ATS surveillance service required.

DOTOL 1N (DOTOL 1N) [DOT01N]
MAKSA 1N (MAKSA 1N) [MAKS1N]
RNAV DEPARTURES
(RWY 01)

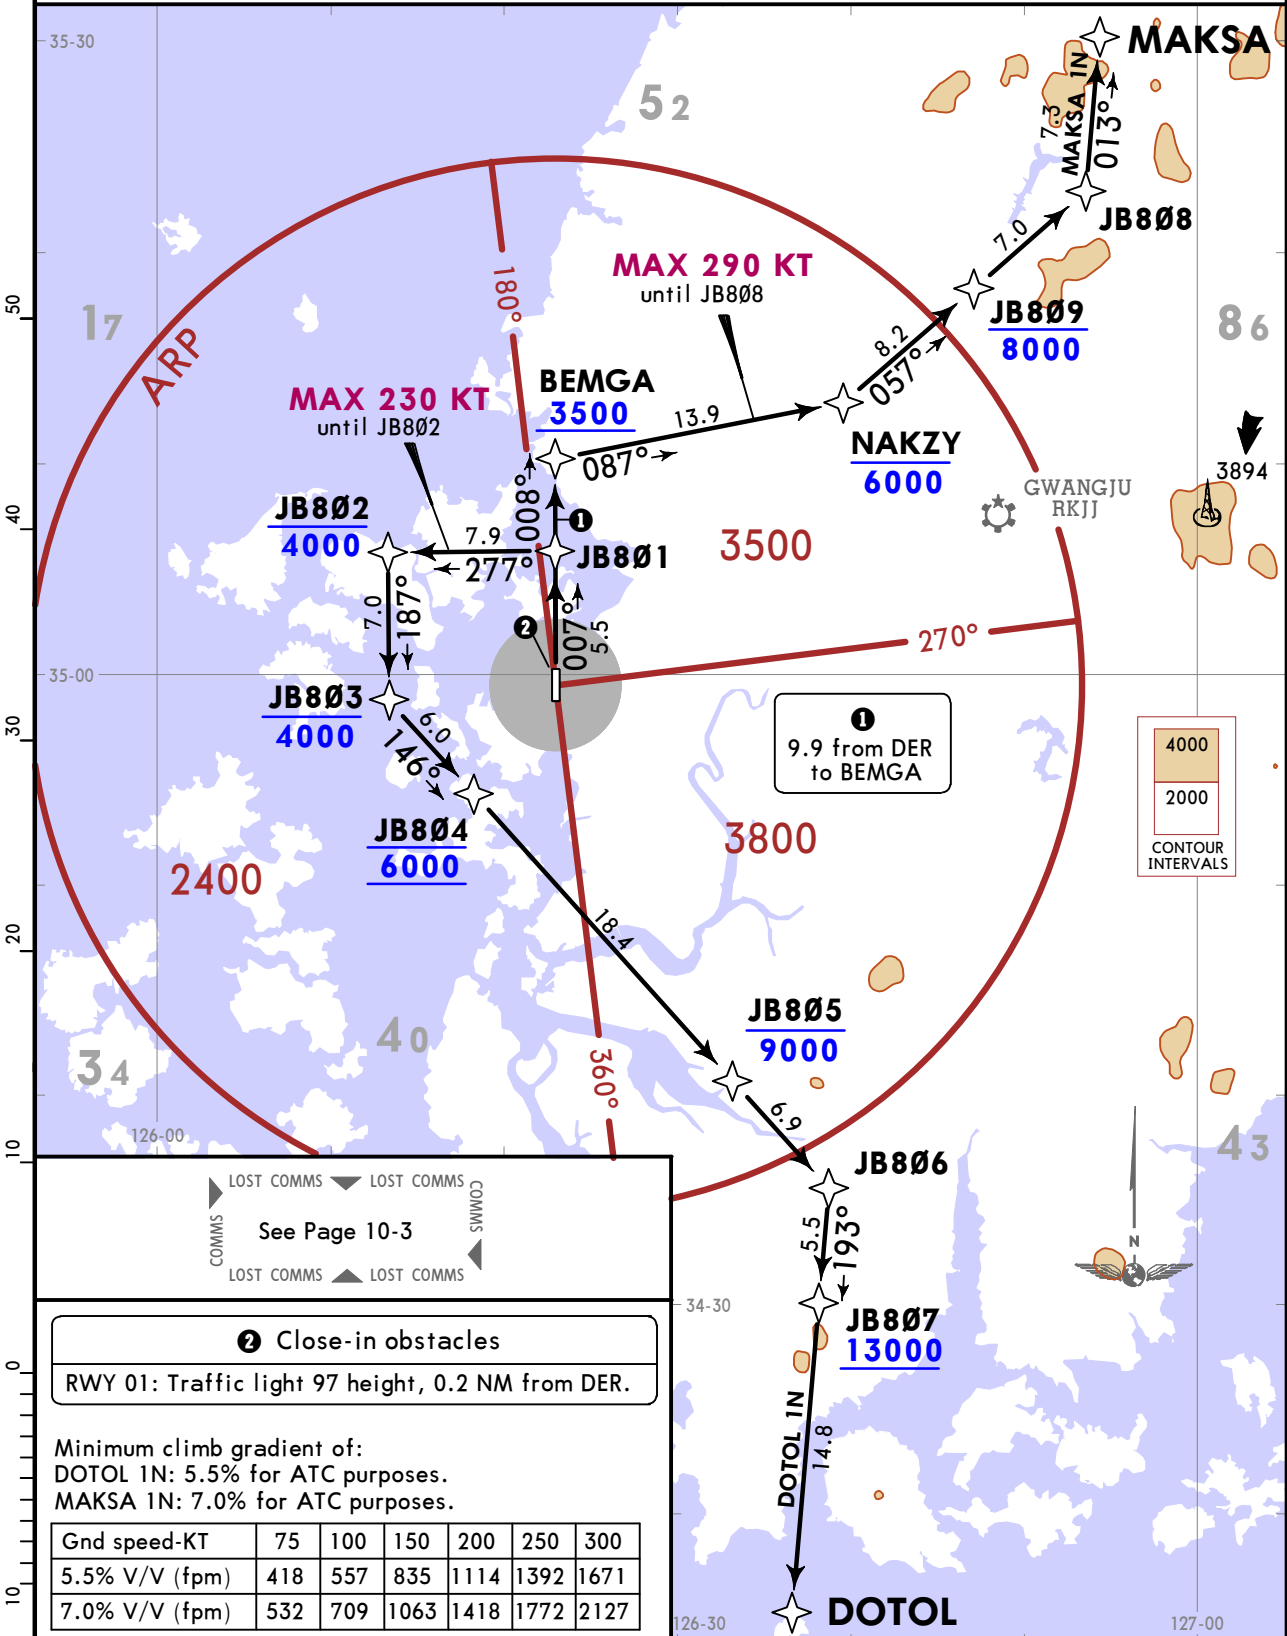

SID	INITIAL CLIMB
DOTOL 1N	JB801 - JB802 - JB803 - JB804 - JB805 - JB806 - JB807 - DOTOL.
MAKSA 1N	BEMGA - NAKZY - JB809 - JB808 - MAKSA.

RKJB/MWX
MUAN INTL

JEPPESSEN
29 OCT 21 **(10-3B)** **Eff 3 Nov 1600Z**

MUAN, KOREA
RNAV SID

GWANGJU Departure
124.0 124.7


Apt Elev
51

Trans alt: 14000

RNAV 1 operation GNSS required

ATS surveillance service required.

DOTOL 1S (DOTOL 1S) [DOT01S]
MAKSA 1S (MAKSA 1S) [MAKS1S]
MAKSA 6S (MAKSA 6S) [MAKS6S] RNAV DEPARTURES
(RWY 19)

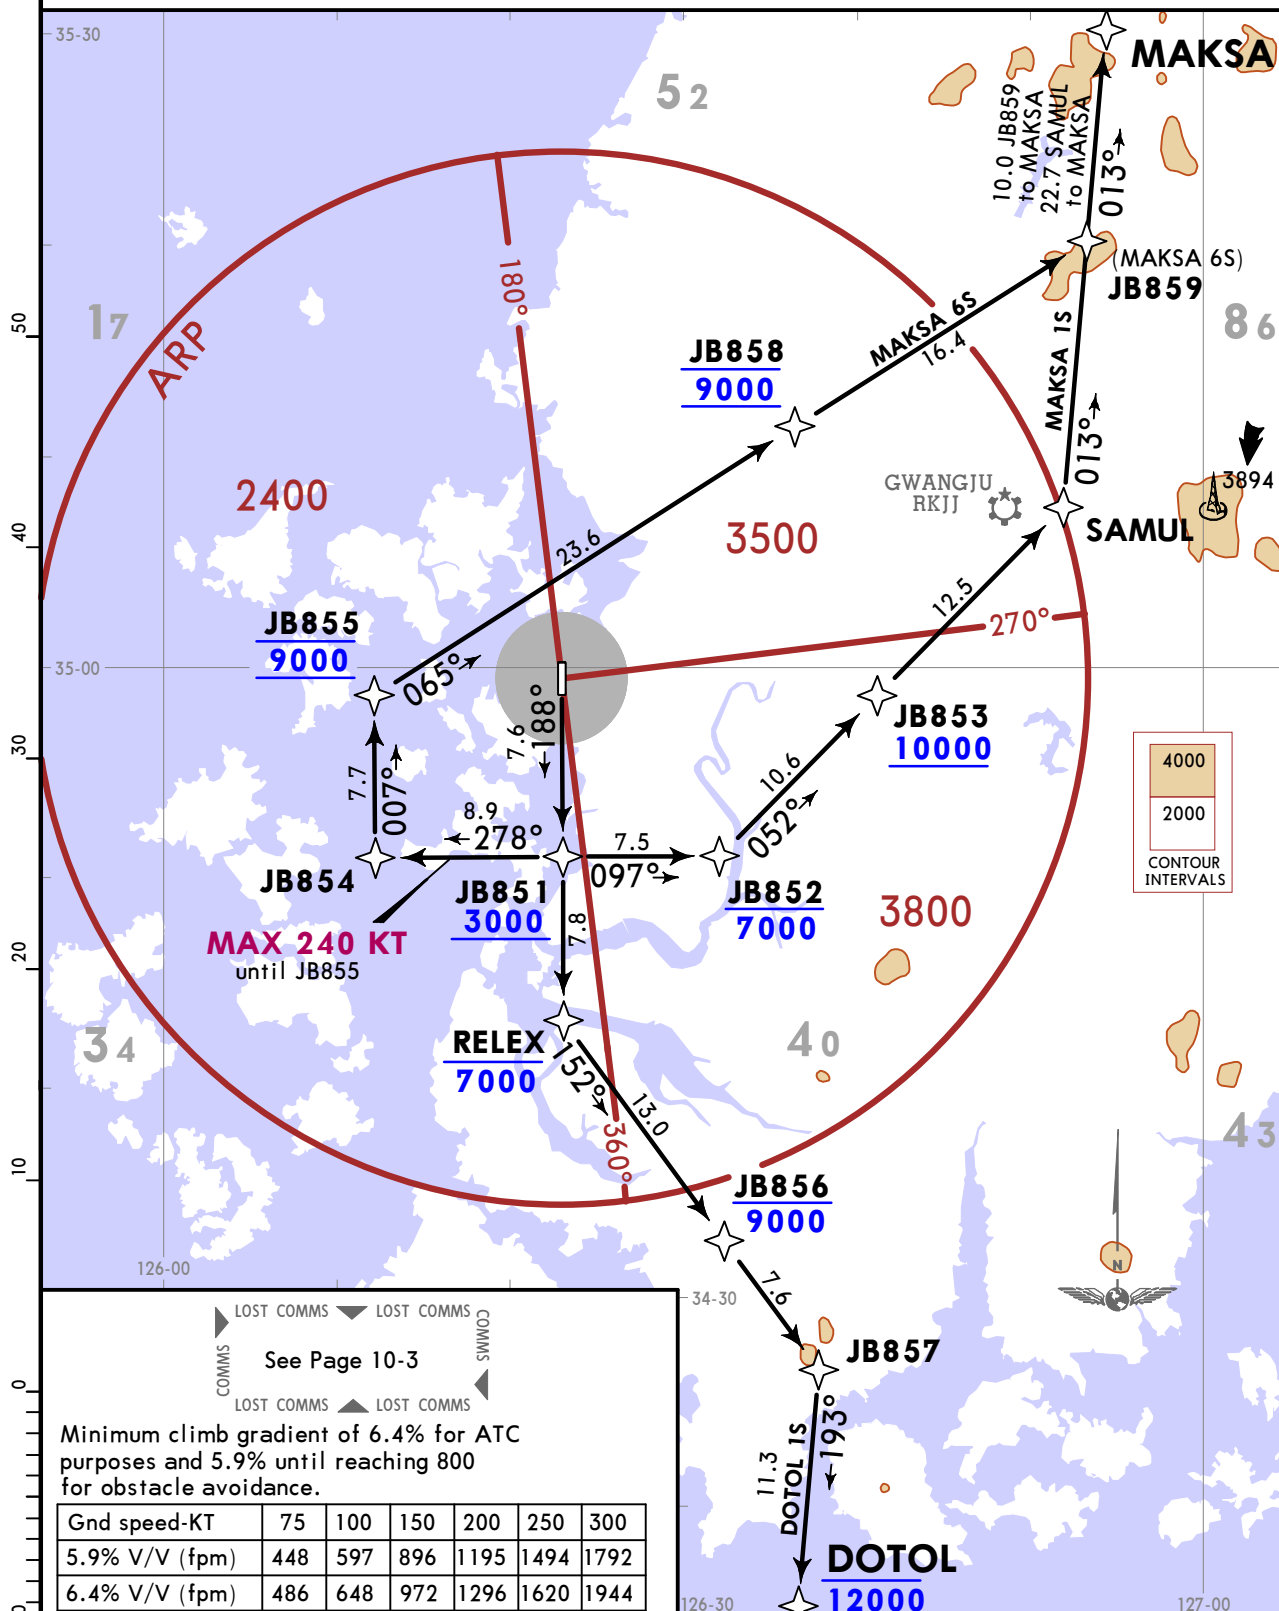

SID	INITIAL CLIMB
DOTOL 1S	JB851 - RELEX - JB856 - JB857 - DOTOL.
MAKSA 1S	JB851 - JB852 - JB853 - SAMUL - MAKSA.
MAKSA 6S	JB851 - JB854 - JB855 - JB858 - JB859 - MAKSA.

CHANGES: MSA.

© JEPPESSEN, 2019, 2021. ALL RIGHTS RESERVED.

RKJB/MWX
MUAN INTL

JEPPESSEN
22 JUL 22 10-3C

MUAN, KOREA
SID


GWANGJU Departure
124.0 124.7

Apt Elev
51

Trans alt: 14000

GWANGJU 3N DEPARTURE
(KWA 3N)
(RWY 01)

SPEED RESTRICTION
Departure turns are limited to maximum of 240 KT until KWA VOR.

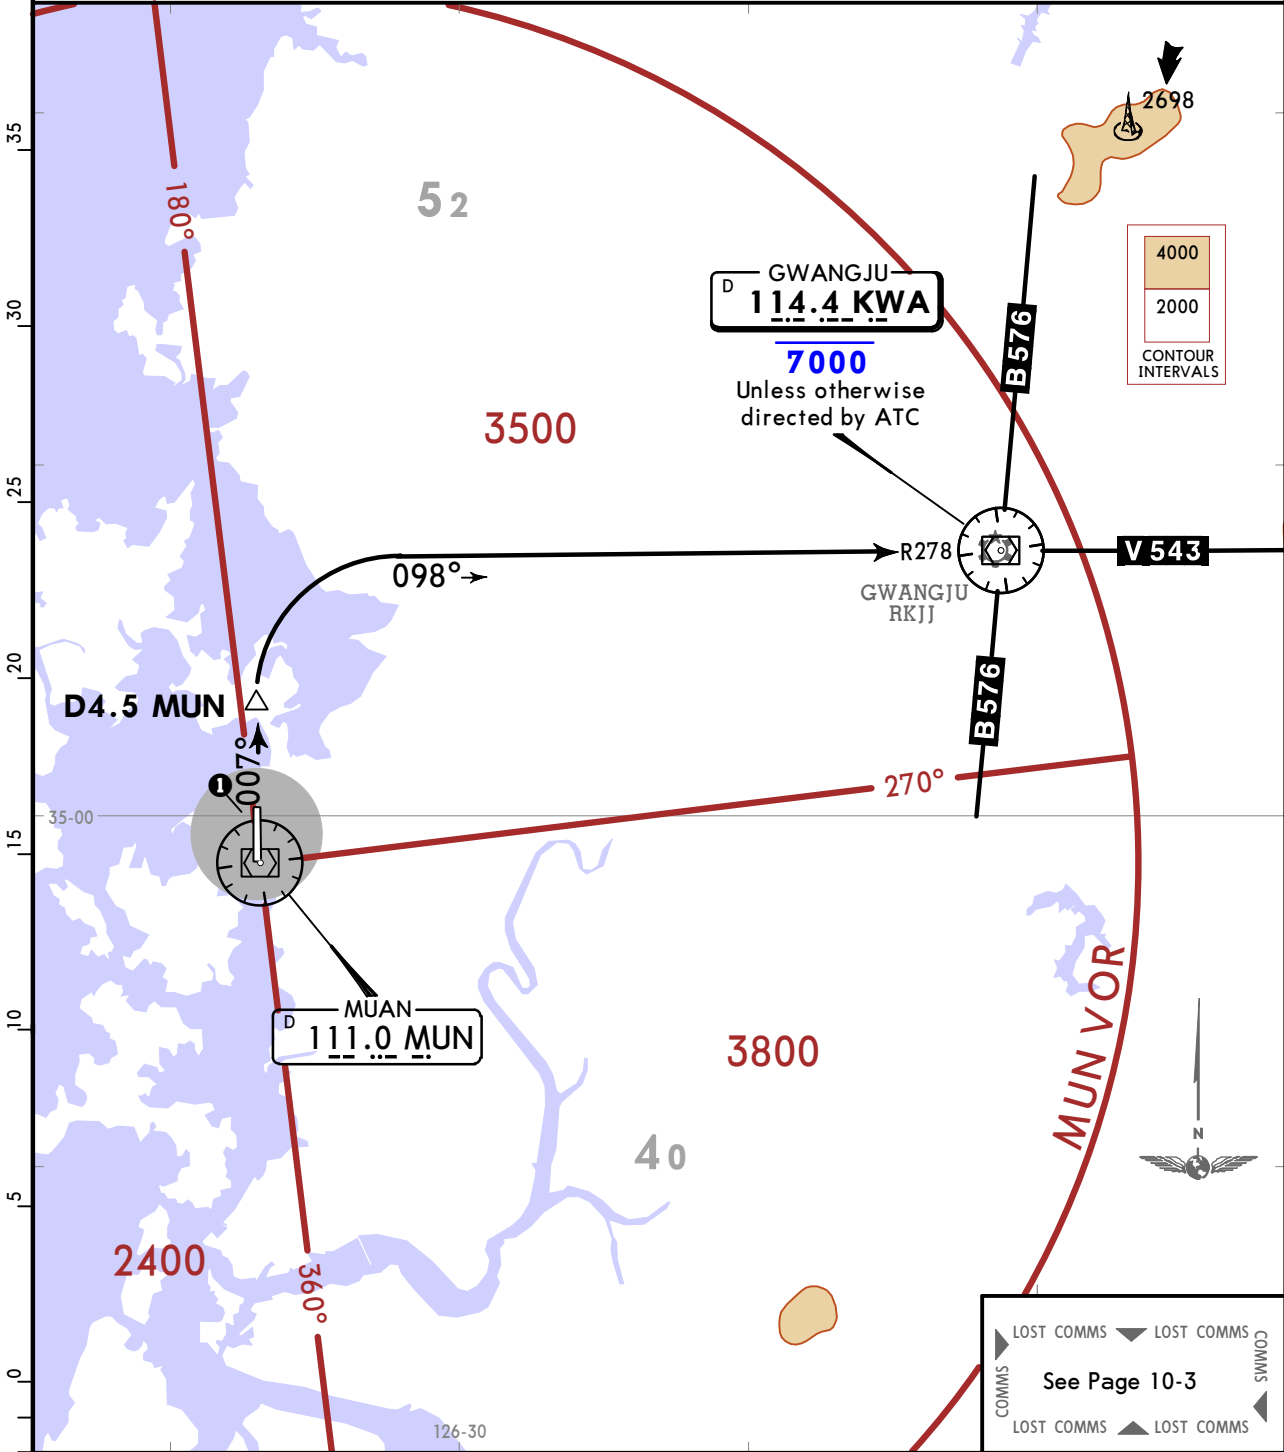

Minimum climb gradient of 5.6% until joining the assigned airway for ATC purposes.

Gnd speed-KT	75	100	150	200	250	300
5.6% V/V (fpm)	425	567	851	1134	1418	1701

1 Close-in obstacles

RWY 01: Traffic light 97 height, 0.2 NM from DER.

INITIAL CLIMB

Climb to MUN R007/D4.5 then turn RIGHT to intercept KWA R278, join B-576 or V-543 as assigned. Cross KWA VOR at or below 7000 unless otherwise directed by ATC.

CHANGES: Waypoint DALSU removed.

© JEPPESSEN, 2019, 2022. ALL RIGHTS RESERVED.

Trans alt: 14000

RKJB/MWX

MUAN, KOREA
MUAN INTL

**CONSTRUCTION WORK FOR RUNWAY EXTENSION
(SUP 005/24 AIRAC)**

1. INTRODUCTION

Construction work for runway extension at RKJB will be conducted as follows.

2. PERIOD

From 1600 UTC 21 FEB 2024 to 1500 UTC 20 JUL 2025.


3. WORKING AREAS (Refer to 5. Diagram)

Nr	Position	Nr	Position
①	N35 00.2 E 126 22.9	⑤	N35 01.0 E 126 23.0
②	N35 00.6 E 126 22.9	⑥	N35 00.6 E 126 23.0
③	N35 00.6 E 126 22.9	⑦	N35 00.6 E 126 23.1
④	N35 01.0 E 126 22.9	⑧	N35 00.2 E 126 23.1

4. REMARKS

- 1. There is a possibility that moving vehicles may pass by the working areas.
- 2. Operational restrictions (change of runway end safety area, clearway, blast pad, taxiway, closed area related to the working area) will be notified by further publications.
- 3. Obstacles information related to the working areas will be notified by NOTAM.
- 4. All vehicles in working area will be marked and lighted.
- 5. Any change to the contents of these pages will be notified by NOTAM.

5. DIAGRAM

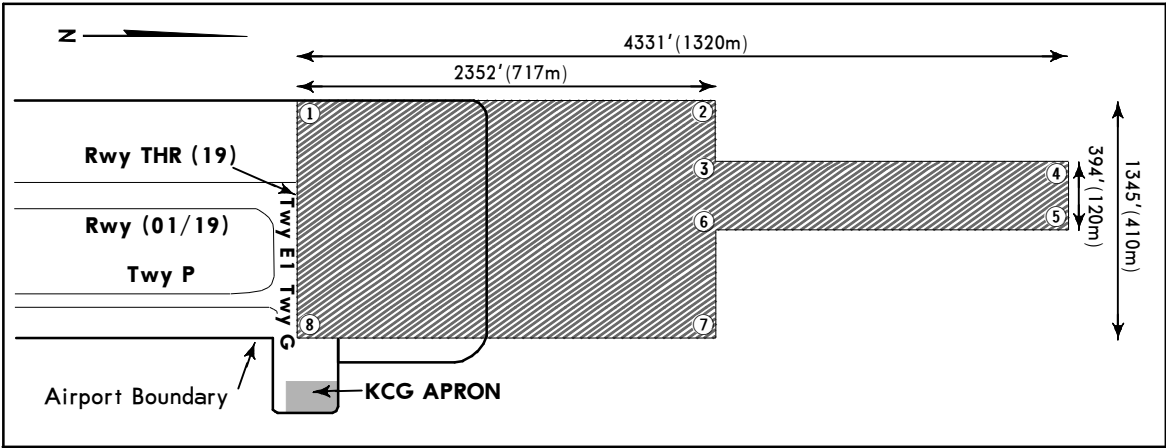

RKJB/MWX



MUAN, KOREA
MUAN INTL

RUNWAY CONSTRUCTION

1. UNAVAILABILITY OF STRIP AND RESA FOR RWY 19 - SUP(051/24)

- 1.1 Rwy 19 STRIP (984'(300m) x 197'(60m) from threshold) and runway end safety area will be unavailable due to construction work for Rwy extension.
- 1.2 From 1500 UTC 18 SEP 2024 to 1500 UTC 30 APR 2025

2. CHANGE OF TWY E1 CENTER LINE MARKING AND RIGHT EDGE MARKING & RIGHT EDGE LIGHT - SUP(053/24)

- 2.1 Twy E1 center line marking and right edge marking & right edge light of Rwy direction will be realigned to left. Usable width of Twy E1 is changed from 92'(28m) to 72'(22m).
- 2.2 From 1500 UTC 18 SEP 2024 to 1500 UTC 30 APR 2025

3. 180° TURNING MARKING ON RWY 19 - SUP(055/24)

- 3.1 180° turning marking will be on threshold Rwy 19.
- 3.2 From 1500 UTC 18 SEP 2024 to 1500 UTC 30 APR 2025

4. REMARKS


- 4.1 During working period, pilots should exercise caution and follow ATC's instruction.
- 4.2 Work by equipments & vehicles will be conducted in the area as shown in RWY CONSTRUCTION (TEMP).
- 4.3 Any change to the contents of these charts will be notified by NOTAM.

RKJB/MWX

MUAN, KOREA
MUAN INTL

RWY CONSTRUCTION (CONTD)

5. DIAGRAM

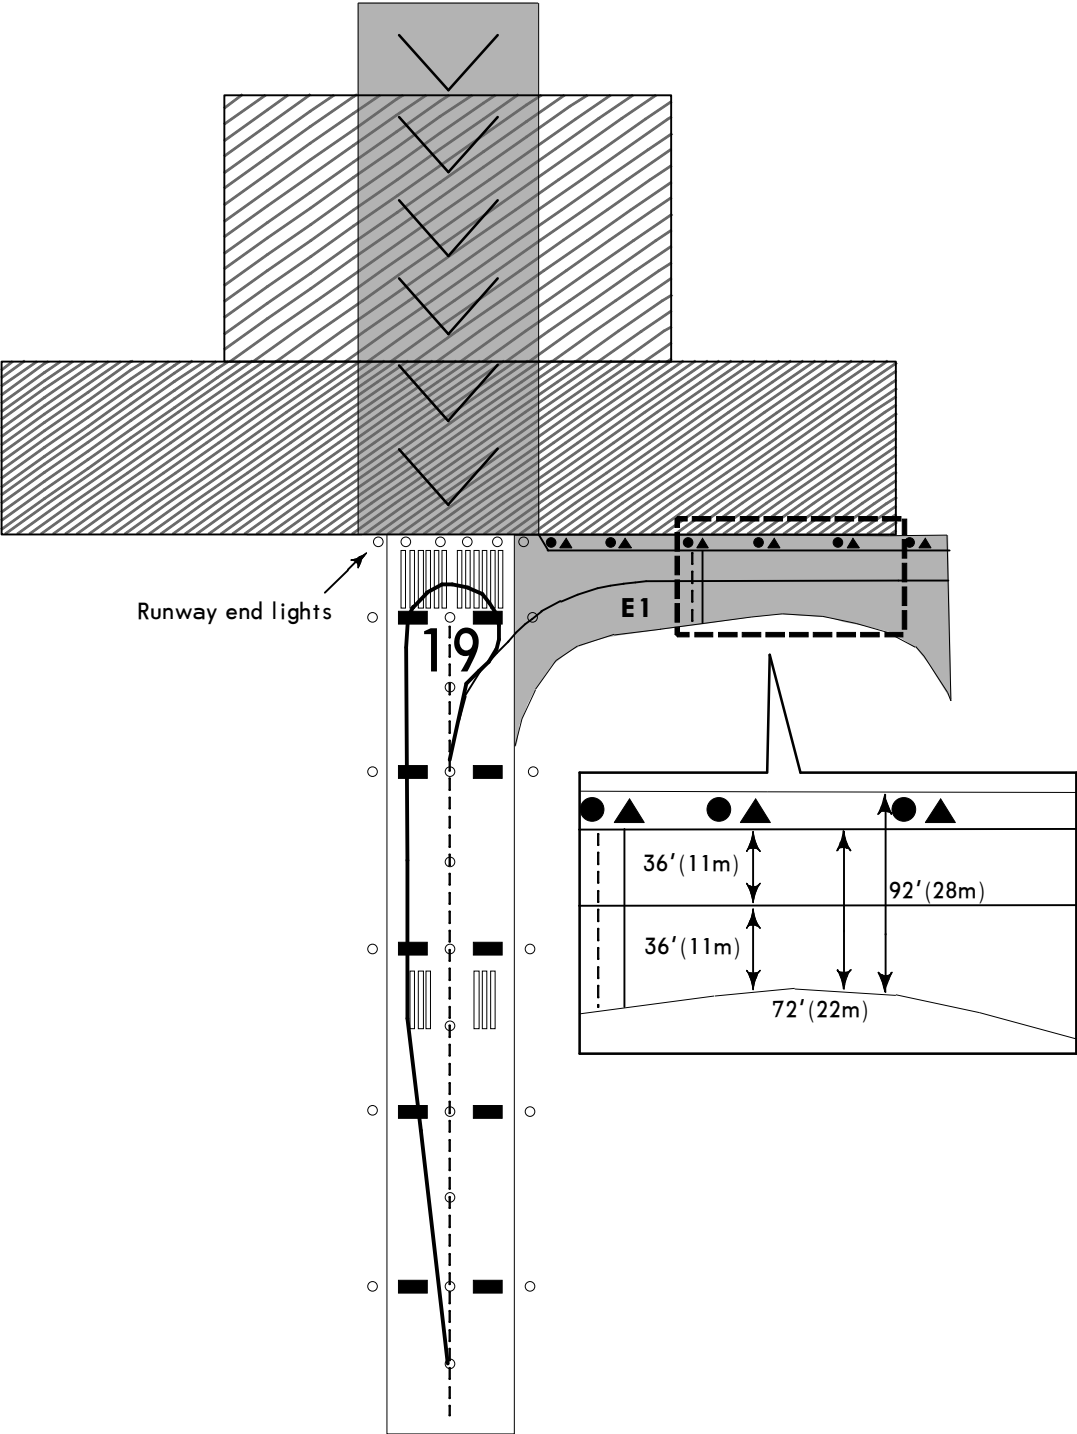

LEGEND

- ▲ Unserviceable Lights
-  STRIP 197' x 984' (60m x 300m)
-  Runway End Safety Area 295' x 492' (90m x 150m)
- Turning marking

RKJB/MWX


Apt Elev 51'
N34 59.5 E126 23.0

JEPPESSEN

12 MAY 23 10-9 Eff 17 May 1600Z

MUAN, KOREA

MUAN INTL

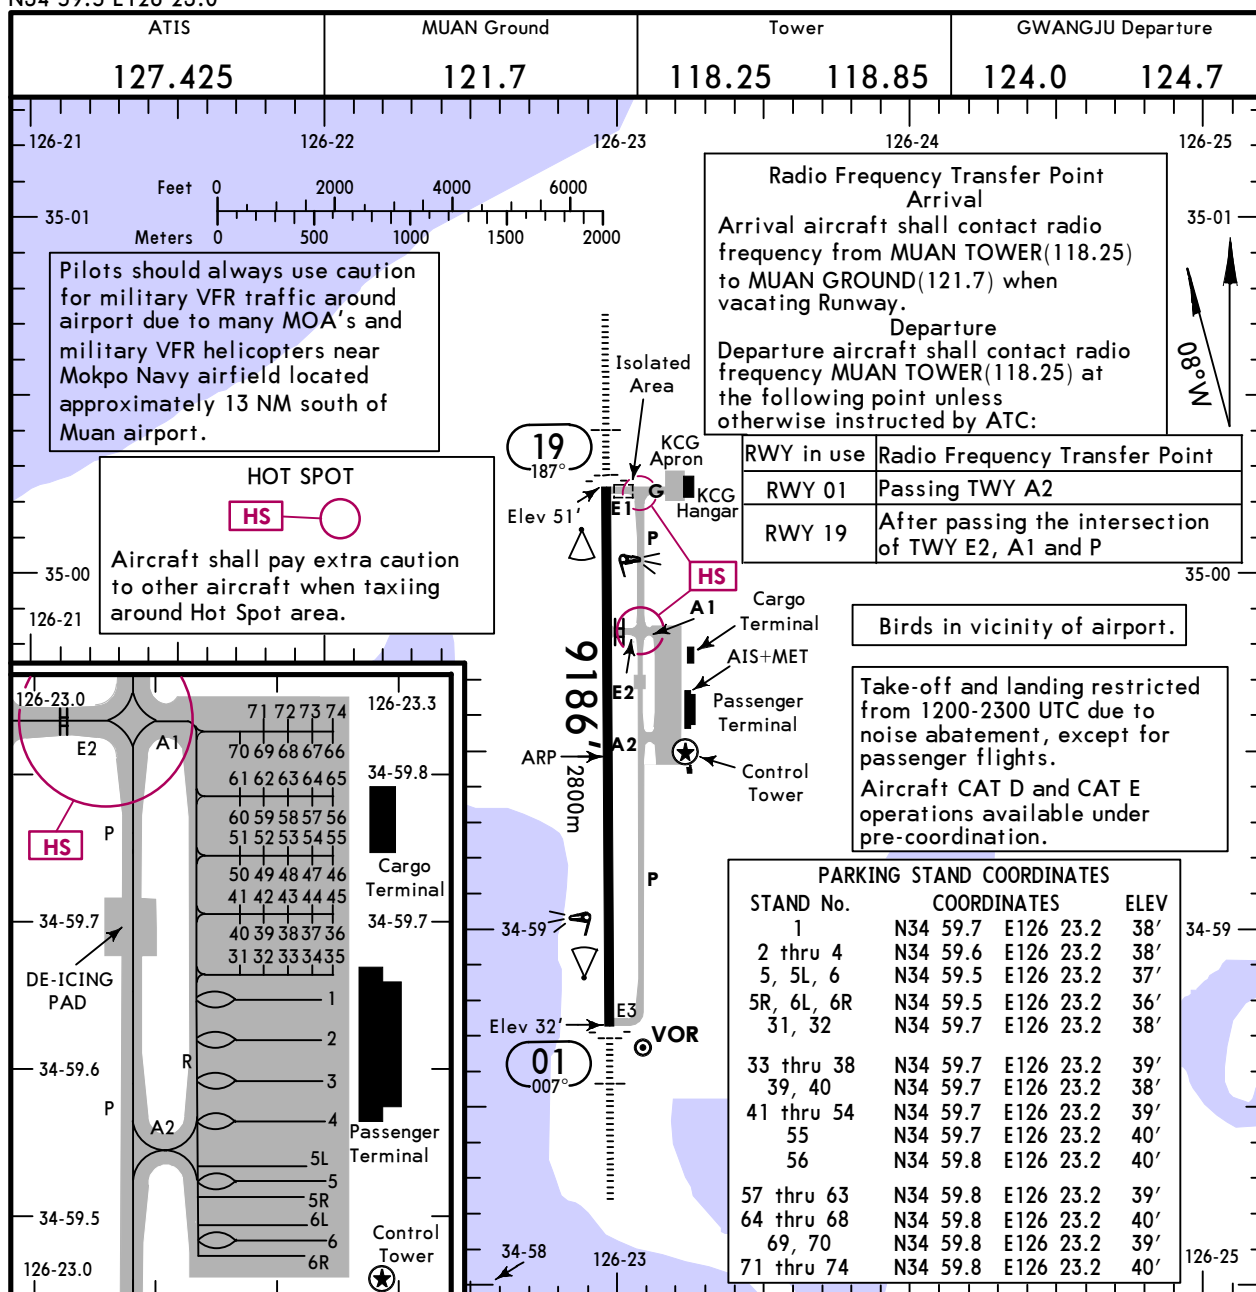

ADDITIONAL RUNWAY INFORMATION

RWY		USABLE LENGTHS			
		Threshold	Glide Slope	TAKE-OFF	WIDTH
01 19	HIRL(60m) CL(30m) TDZ 2 ALSF-I 3 PAPI-L RVR		8216' 2504m 8148' 2484m	4	148' 45m

1 Grooved.

2 length 900m

3 angle 3.0°

4 TAKE-OFF RUN AVAILABLE:
Rwy 19

From runway head 9186' (2800m)

From Twy E2 intersection 6749' (2057m)

TAKE-OFF

All Rwys

Multi Engine Aircraft With Take-off Alternate Airport Filed

RL & CL	RL & RCLM	RL or RCLM	NIL (Day Only)	Other
RVR 400m VIS 1200'			RVR 500m VIS 1600'	Available Landing Minimums

The TDZ RVR/VIS may be assessed by the pilot.

SIDs are designed in accordance with STANDARDS for FLIGHT PROCEDURE DESIGN.

For Night Operations at least RL or CL and Rwy End Lights are available.

RKJB/MWX

Apt Elev 51'
N34 59.5 E126 23.0

JEPPESSEN


20 DEC 24

10-9-0

Eff 25 Dec 1600Z

MUAN, KOREA

MUAN INTL

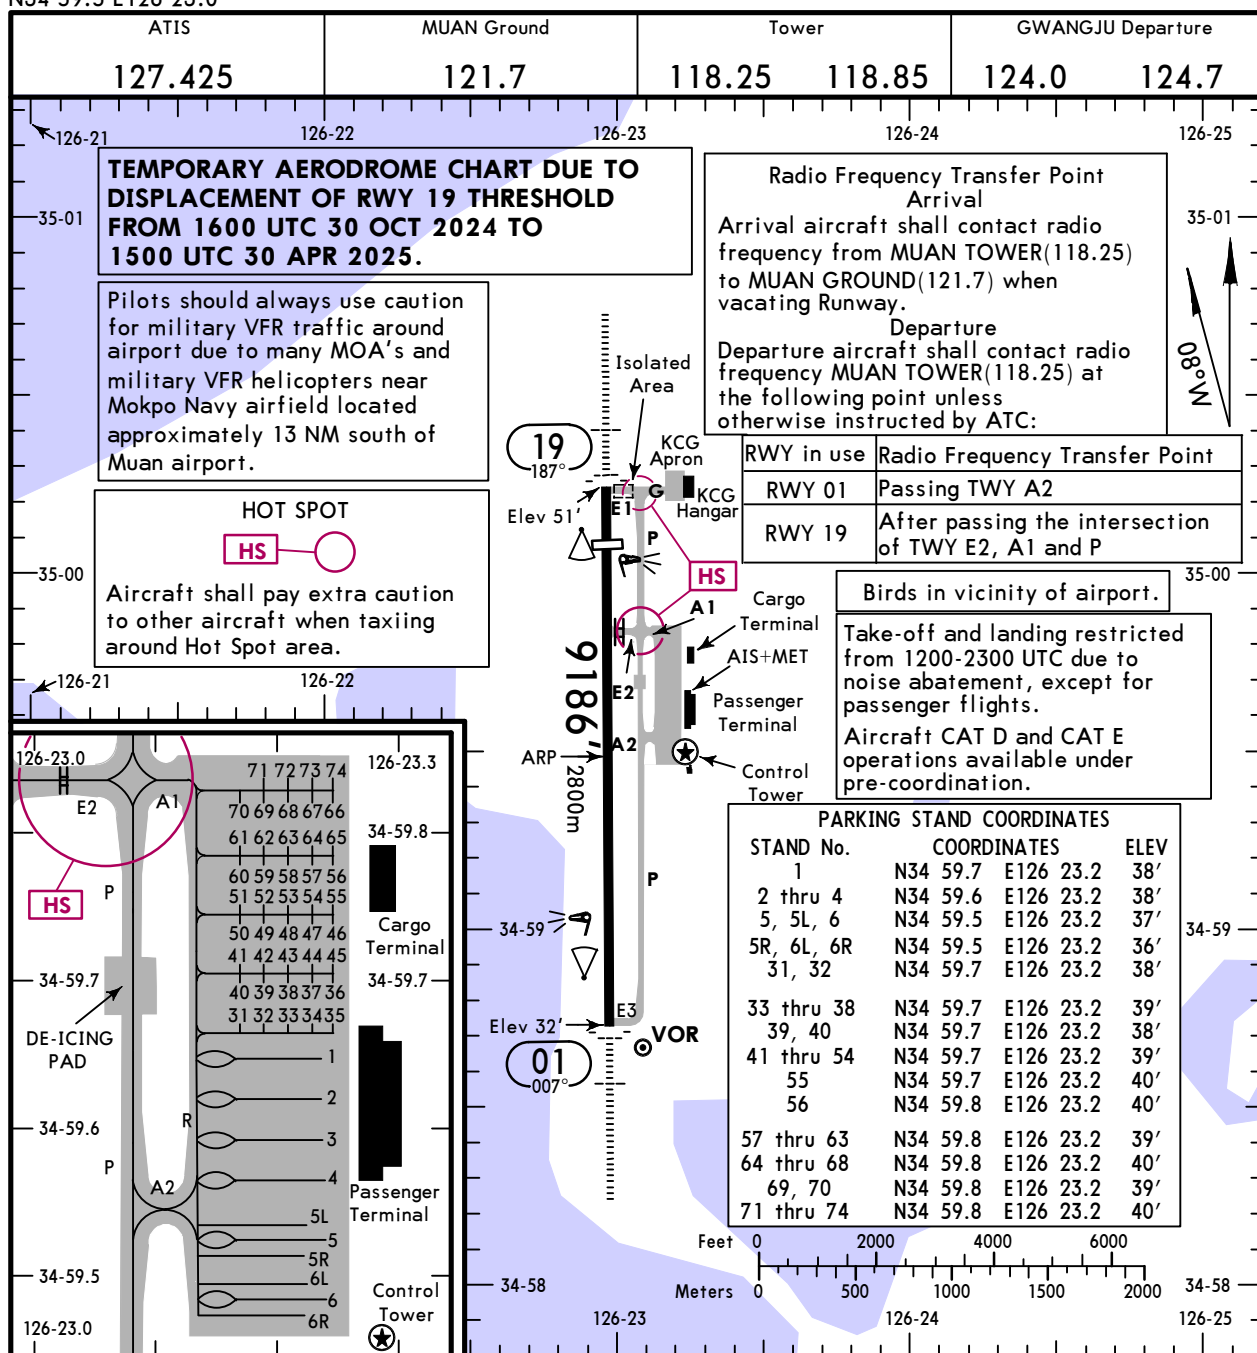

ADDITIONAL RUNWAY INFORMATION

USABLE LENGTHS

RWY		LANDING		TAKE-OFF	WIDTH
		Threshold	Glide Slope		
01	19	HIRL(60m) CL(30m) TDZ 2 ALSF-I 3 PAPI-L RVR	8216' 2504m	8202' 2500m	148'
		8202' 2500m	7164' 2184m	5 6 7	45m

1 Grooved. 2 length 900m 3 angle 3.0° 4 LDA 9177' (2797m)

5 TAKE-OFF RUN AVAILABLE:

Rwy 19

From runway head 8202' (2500m)

From Twy E2 intersection 6749' (2057m)

6 Temporary signs for TORA 8202' (2500m) and intersection Take-Off when entering Rwy 19 from Twy E1 will be installed.

7 To avoid aircraft blast, all departure aircraft for Rwy 19 shall start take-off at displaced threshold ('T' point).

State

TAKE-OFF

All Rwys

Multi Engine Aircraft With Take-off Alternate Airport Filed

RL & CL	RL & RCLM	RL or RCLM	NIL (Day Only)	Other
R/V400m R/V1200'			R/V500m R/V1600'	Available Landing Minimums

The TDZ RVR/VIS may be assessed by the pilot.

SIDs are designed in accordance with STANDARDS for FLIGHT PROCEDURE DESIGN.



For Night Operations at least RL or CL and Rwy End Lights are available.

RKJB/MWX
MUAN INTL

25 OCT 24
Eff 30 Oct 1600Z (11-1)

MUAN, KOREA
ILS Z or LOC Z Rwy 01

ATIS 127.425		GWANGJU Approach 120.475 130.0		MUAN Tower 118.25 118.85		Ground 121.7			
LOC IMUN 111.9	Final Apch Crs 007°	D5.2 IMUN 1700' (1668')	ILS DA(H) 232' (200')	Apt Elev 51' Rwy 32'		TAA 25 NM IAF			
MISSED APCH: Climb to 5000' on track 007° to JB401, then LEFT turn on track of 310° to GUPLA. Hold as published.									
Alt Set: hPa		Rwy Elev: 1 hPa		Trans level: FL140				Trans alt: 14000'	
RNAV 1 operation		1. GNSS required. 2. DME required on a LOC approach.							
3. ATC surveillance service required. 4. Circling not authorized.									

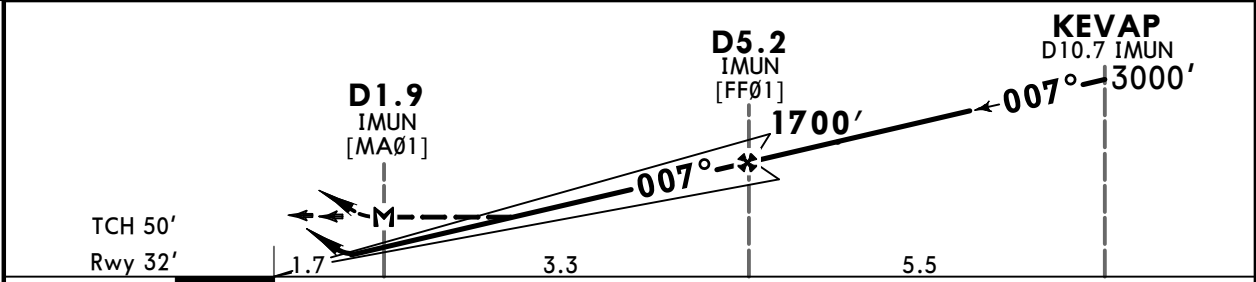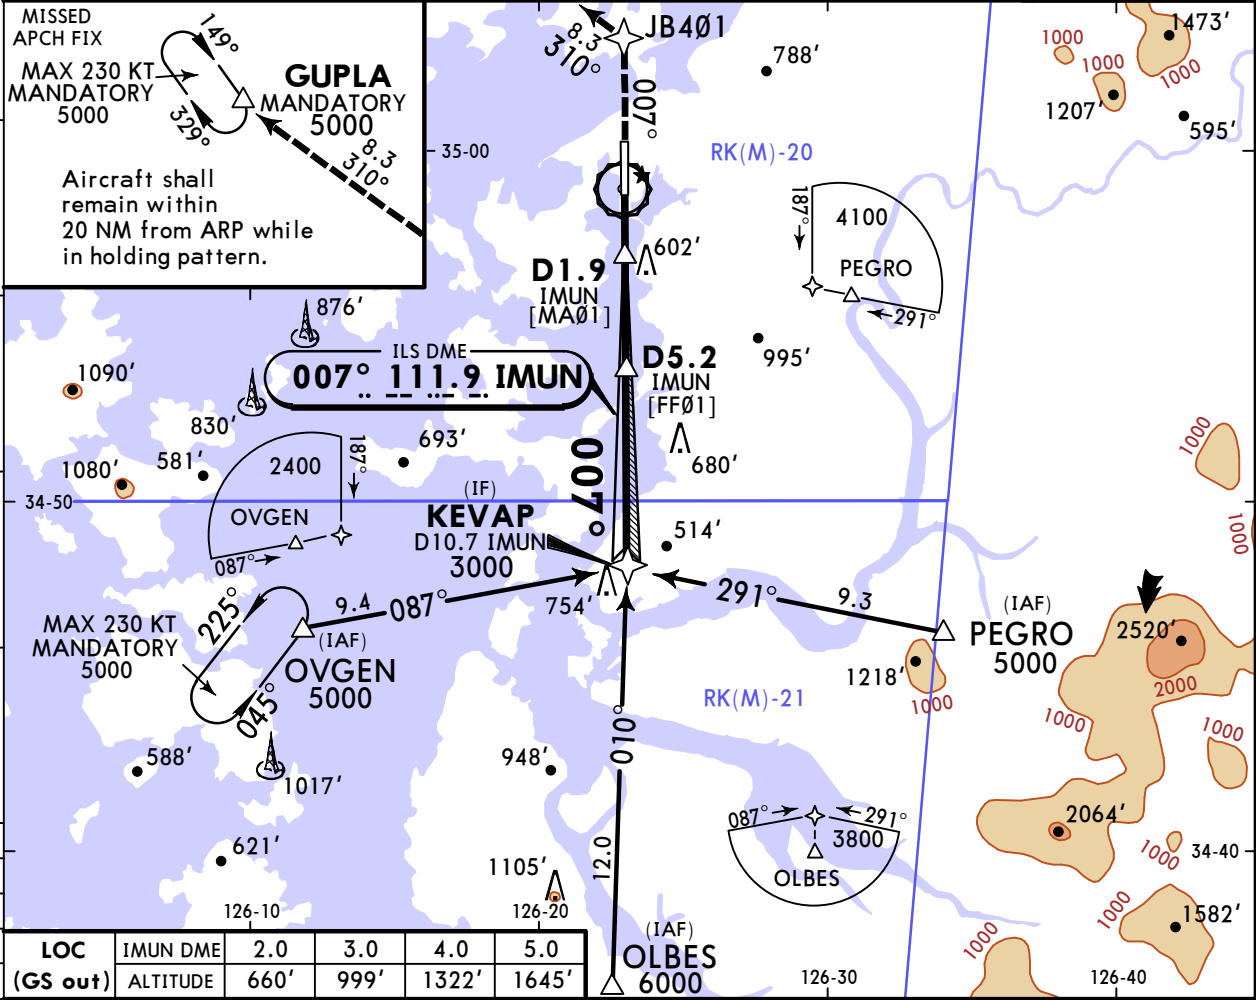

Gnd speed-Kts	70	90	100	120	140	160	ALSFI PAPI	5000' ↑ on 007° JB401
ILS GS 3.00°	372	478	531	637	743	849		
LOC Descent Angle 3.04°	376	484	538	645	753	861		
MAP at D1.9 IMUN								
Timing not authorized for defining the MAP.								


Std		ILS		STRAIGHT-IN LANDING		LOC (GS out)	
		DA(H) 232' (200')				CDFA 2 DA/MDA(H) 660' (628')	
		TDZ or CL out		ALS out		ALS out	
A	R550m	1 R550m	R1200m	R1500m			
B							
C				R2200m	R2400m		
D							
1 R750m when a Flight Director or Autopilot or HUD to DA is not used.							
2 VNAV DA(H) in lieu of MDA(H) depends on operator policy.							

RKJB/MWX
MUAN INTL


JEPPESSEN
25 OCT 24
Eff 30 Oct 1600Z (11-2)

MUAN, KOREA
ILS Y or LOC Y Rwy 01

ATIS 127.425		GWANGJU Approach 120.475 130.0		MUAN Tower 118.25 118.85		Ground 121.7
LOC IMUN 111.9	Final Apch Crs 007°	D5.2 IMUN 1700' (1668')	ILS DA(H) 232' (200')	Apt Elev 51' Rwy 32'		 MSA MUN VOR
MISSED APCH: Climb on heading 007° to D3.5 MUN, then turn LEFT heading 297° to GUPLA and hold at 5000'.						
Alt Set: hPa Rwy Elev: 1 hPa Trans level: FL140 Trans alt: 14000'						
1. DME required on an ILS/LOC approach. 2. Circling not authorized.						

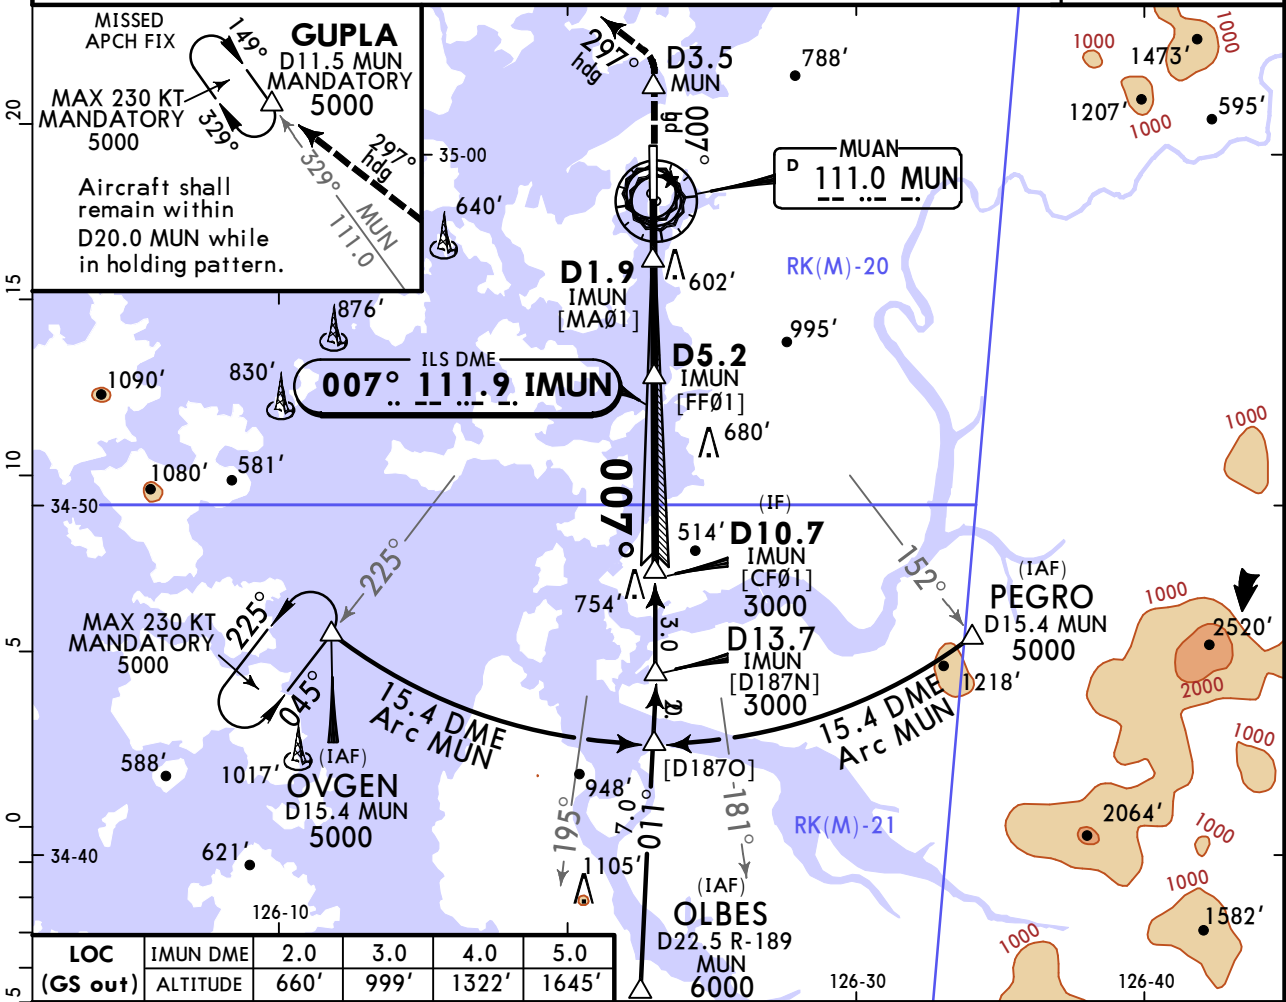

LOC (GS out)	IMUN DME	2.0	3.0	4.0	5.0
	ALTITUDE	660'	999'	1322'	1645'

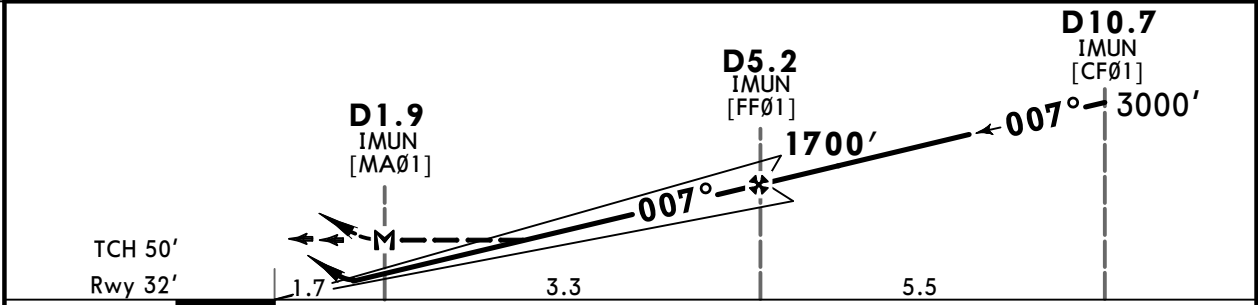

Gnd speed-Kts	70	90	100	120	140	160	ALSFI PAPI
---------------	----	----	-----	-----	-----	-----	---

A B C D	Std ILS STRAIGHT-IN LANDING			LOC (GS out) CDFA	
	DA(H) 232' (200')			DA/MDA(H) 660' (628')	
	TDZ or CL out		ALS out	ALS out	
	R550m	R550m	R1200m	R1500m	R2400m

1 R750m when a Flight Director or Autopilot or HUD to DA is not used.
2 VNAV DA(H) in lieu of MDA(H) depends on operator policy.

RKJB/MWX
MUAN INTL


25 OCT 24
Eff 30 Oct 1600Z

11-3


MUAN, KOREA
ILS Z or LOC Z Rwy 19

BRIEFING STRIP

ATIS 127.425		GWANGJU Approach 120.475 130.0		MUAN Tower 118.25 118.85		Ground 121.7
LOC IMAN 108.9	Final Apch Crs 187°	D5.1 IMAN 1700'(1649')	ILS DA(H) Refer to Minimums	Apt Elev 51' Rwy 51'	TAA 25 NM IAF	
MISSED APCH: Climb to 5000' on track of 187° to JB451, RIGHT turn on track of 277° to JB452, then RIGHT turn on track of 008° to GUPLA. Hold as published. Refer to minimums for missed approach climb gradient. Missed approach turns limited to MAX 230 KT.						
Alt Set: hPa		Rwy Elev: 2 hPa	Trans level: FL140			
RNAV 1 operation 1. GNSS required. 2. DME required on a LOC approach. 3. ATS surveillance service required. 4. Circling not authorized.						

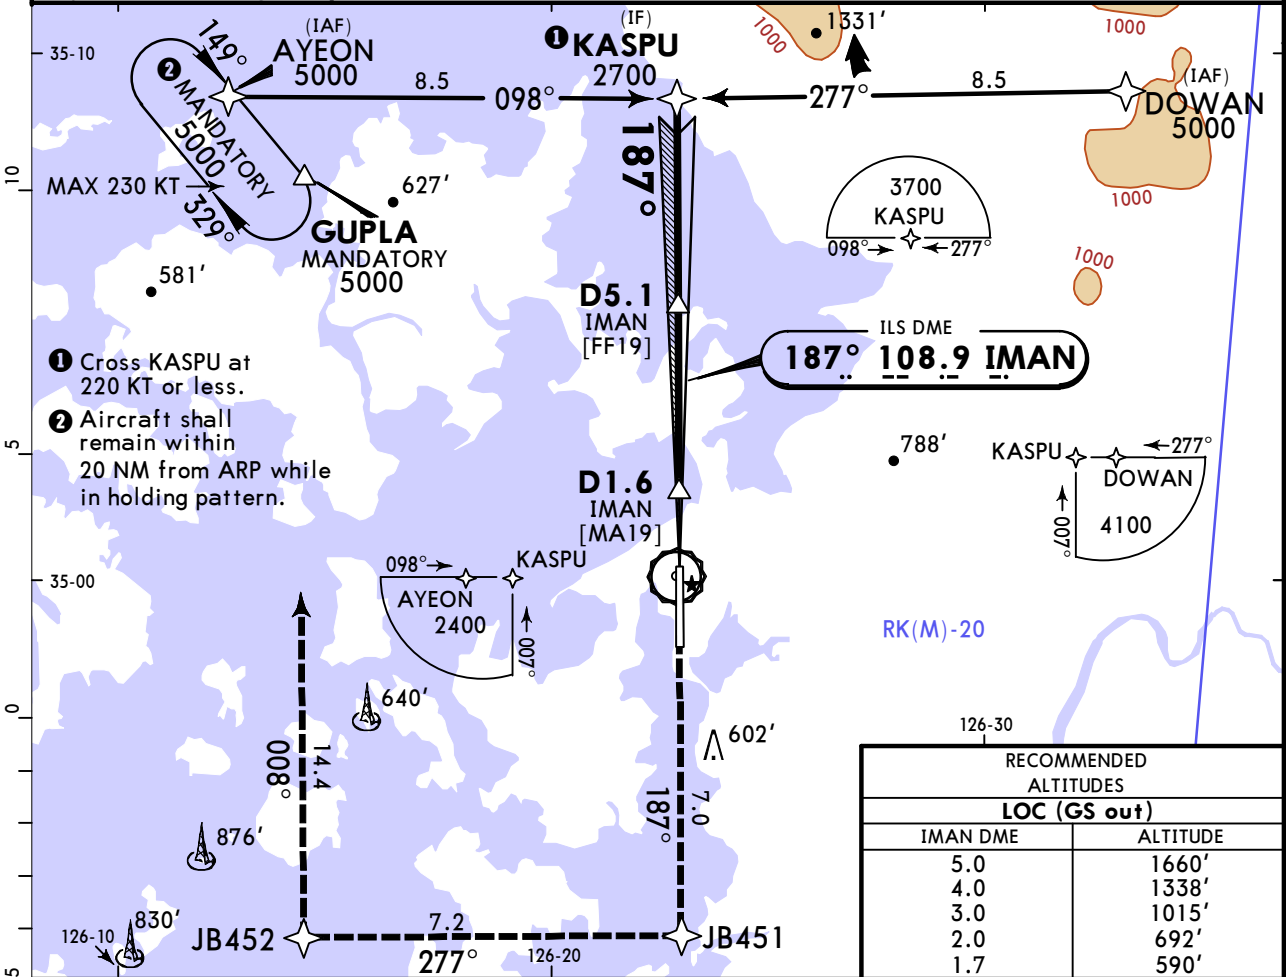

RECOMMENDED ALTITUDES	
LOC (GS out)	
IMAN DME	ALTITUDE
5.0	1660'
4.0	1338'
3.0	1015'
2.0	692'
1.7	590'

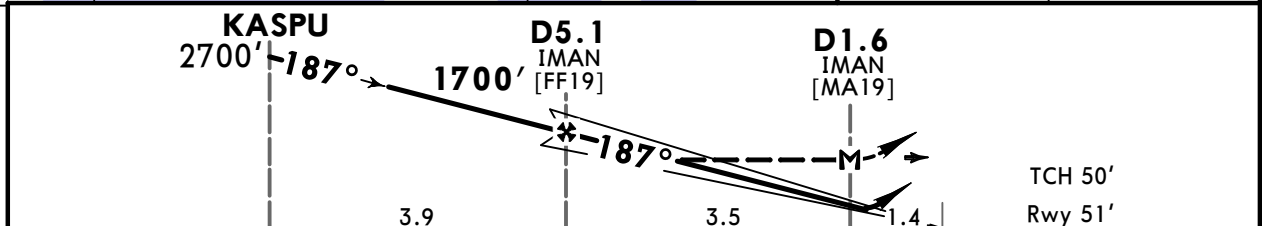

Gnd speed-Kts	70	90	100	120	140	160	ALS F-I PAPI
---------------	----	----	-----	-----	-----	-----	---


STRAIGHT-IN LANDING				LOC (GS out)			
Missed apch climb gradient minimum 5.0% (304'/NM)				Missed apch climb gradient minimum 2.5% (152'/NM)			
DA(H) 251' (200')				DA(H) 414' (363')			
TDZ or CL out				TDZ or CL out			
ALS out				ALS out			
R550m				R1500m			
R550m				R1500m			
R1200m				R1700m			
R1000m				R2400m			
R1000m							


1 R750m when a Flight Director or Autopilot or HUD to DA is not used.
2 VNAV DA(H) in lieu of MDA(H) depends on operator policy.

RKJB/MWX
MUAN INTL


JEPPESSEN
25 OCT 24
Eff 30 Oct 1600Z (11-4)

MUAN, KOREA
ILS Y or LOC Y Rwy 19

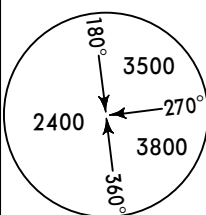ATIS 127.425		GWANGJU Approach 120.475 130.0		MUAN Tower 118.25 118.85		Ground 121.7
LOC IMAN 108.9	Final Apch Crs 187°	D5.1 IMAN 1700' (1649')	ILS DA(H) Refer to Minimums	Apt Elev 51' Rwy 51'		 MSA MUN VOR
MISSED APCH: Climb on heading 187° to D1.0 MUN, then turn RIGHT heading 015° to GUPLA and hold at 5000'. Refer to minimums for missed apch climb gradient.						
Alt Set: hPa Rwy Elev: 2 hPa Trans level: FL140 Trans alt: 14000'						
1. DME required on an ILS/LOC approach. 2. Circling not authorized.						

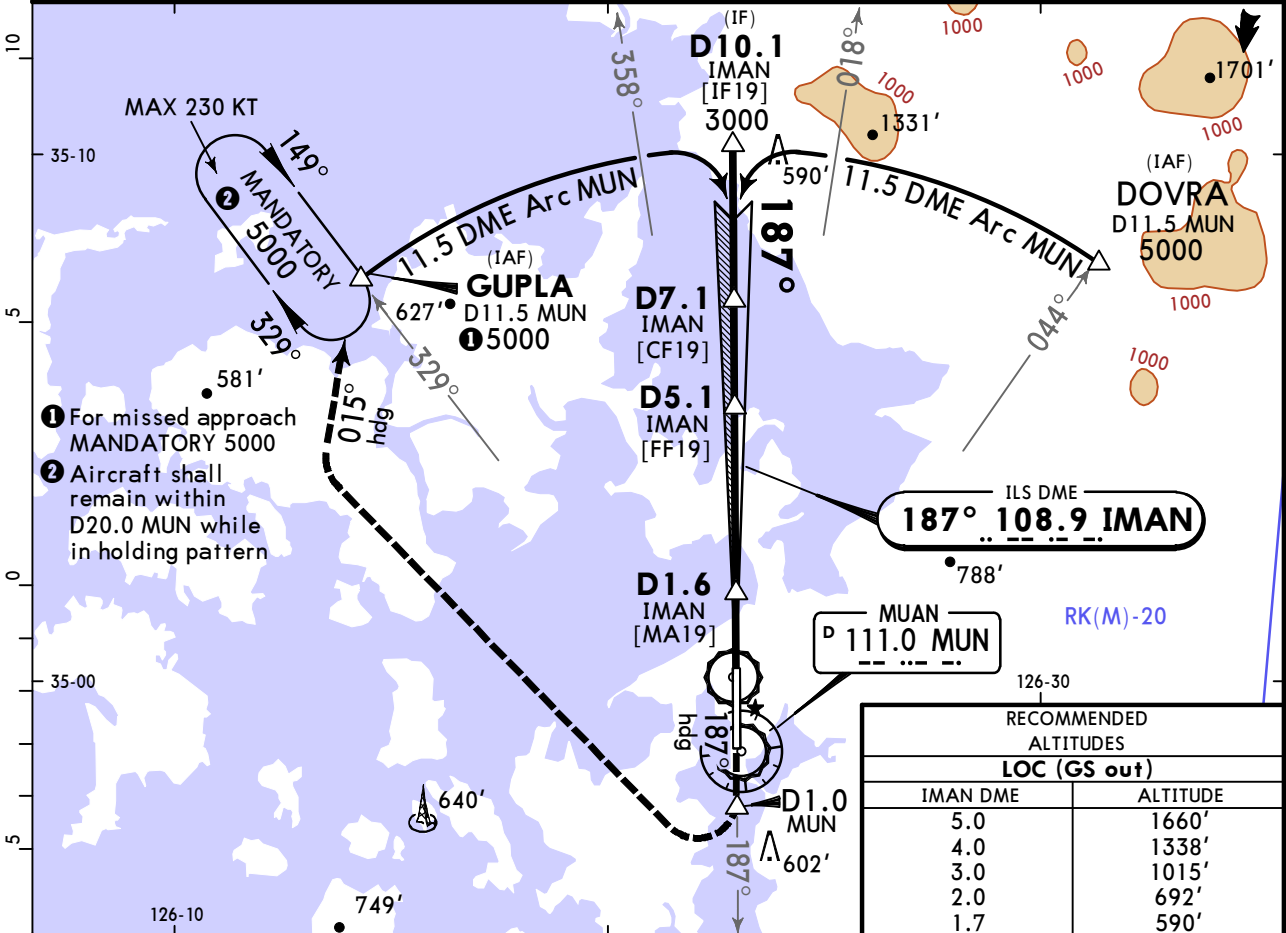

RECOMMENDED ALTITUDES	
LOC (GS out)	
IMAN DME	ALTITUDE
5.0	1660'
4.0	1338'
3.0	1015'
2.0	692'
1.7	590'

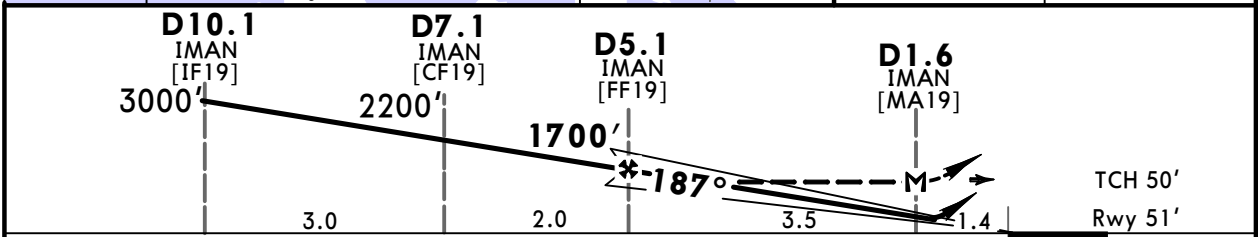

Gnd speed-Kts	70	90	100	120	140	160			on 187° hdg	D1.0 MUN
ILS GS 3.00°	372	478	531	637	743	849				
LOC Descent Angle 3.04°	376	484	538	645	753	861				
MAP at D1.6 IMAN										
Timing not authorized for defining the MAP.										

STRAIGHT-IN LANDING							
Missed apch climb gradient minimum 5.0% (304'/NM) DA(H) 251' (200')				Missed apch climb gradient minimum 2.5% (152'/NM) DA(H) 414' (363')		LOC (GS out) CDFA DA/MDA(H) 590' (539')	
TDZ or CL out		ALS out		TDZ or CL out		ALS out	
A							
B	R550m	R550m	R1200m	R1000m	R1000m	R1500m	R1500m
C						R1700m	R1700m
D							R2400m
PANS OPS							
1 R750m when a Flight Director or Autopilot or HUD to DA is not used. 2 VNAV DA(H) in lieu of MDA(H) depends on operator policy.							



© JEPPESEN, 2013, 2024. ALL RIGHTS RESERVED.

RKJB/MWX
MUAN INTL

JEPPESEN
25 OCT 24 (12-2) Eff 30 Oct 1600Z

MUAN, KOREA
RNP Rwy 19

ATIS 127.425		GWANGJU Approach 120.475 130.0		MUAN Tower 118.25 118.85		Ground 121.7	
RNAV	Final Apch Crs 187°	SAMAB 1700' (1651')		LNNAV/VNAV DA(H) 460' (411')	Apt Elev 51' Rwy 49'	TAA 25 NM IAF	
MISSED APCH: Climb to 5000' on track of 187° to JB451, RIGHT turn on track of 277° to JB452, then RIGHT turn on track of 008° to GUPLA. Missed approach turns limited to MAX 220 KT.							
Alt Set: hPa		Rwy Elev: 2 hPa		Trans level: FL140			Trans alt: 14000'
RNP Apch RNP 0.30 required.							
1. Baro-VNAV not authorized below -20°C or above 45°C. 2. Circling not authorized.							

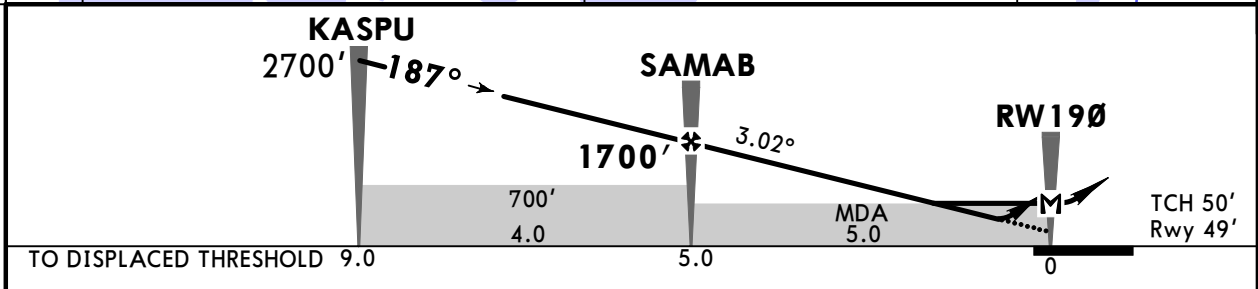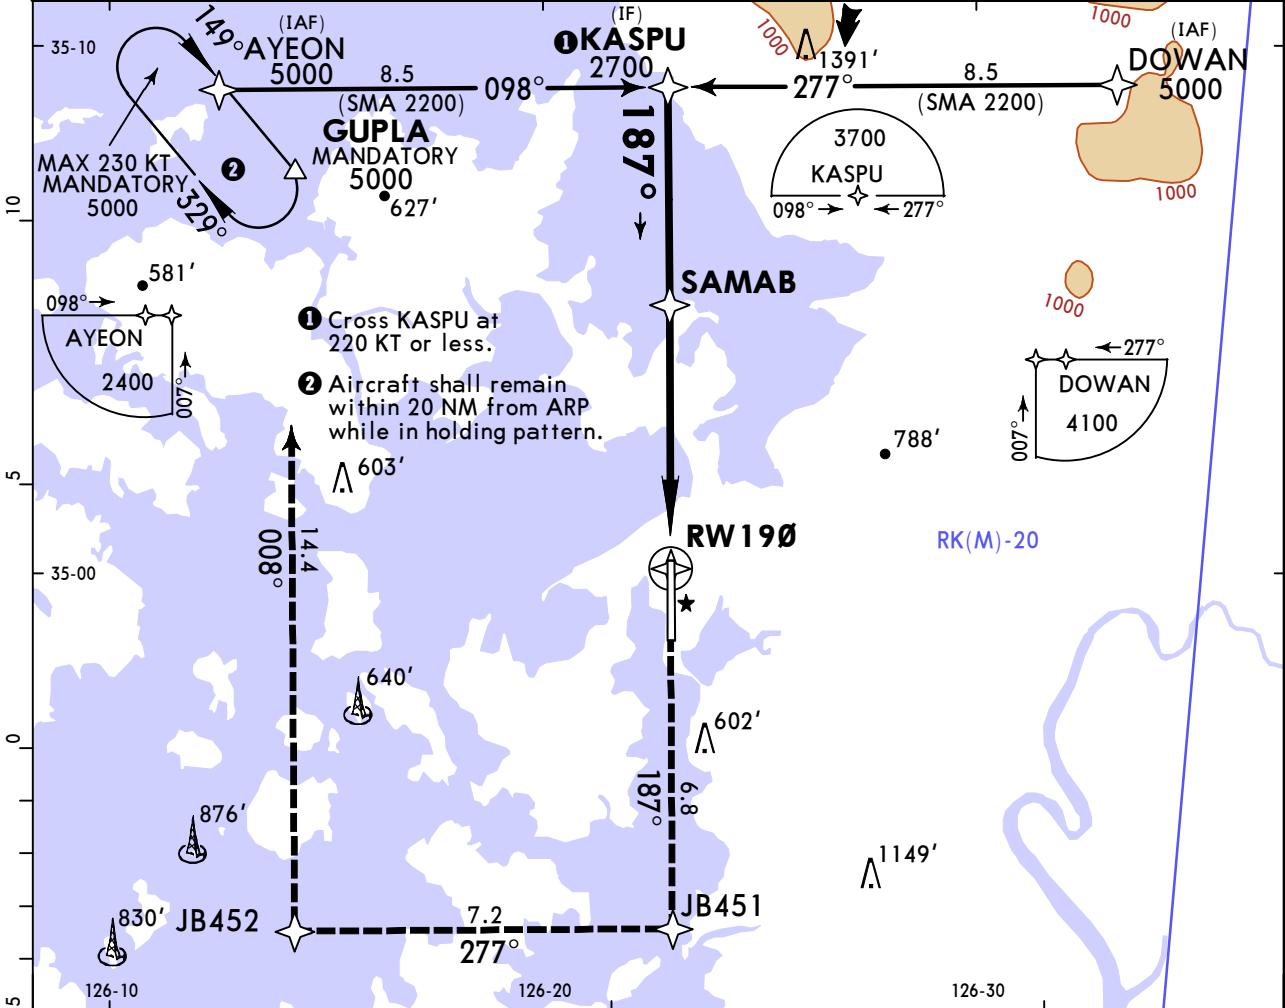

Gnd speed-Kts	70	90	100	120	140	160	ALSFI PAPI	5000' ↑ on 187°	JB451
Glide Path Angle 3.02°	374	481	534	641	748	855			
MAP at RW190									
Timing not authorized for defining the MAP.									

STRAIGHT-IN LANDING			
LNNAV/VNAV		LNNAV CDFA	
DA(H) 460' (411')		DA/MDA(H) 590' (541')	
ALS out		ALS out	
A	R1200m	R1500m	
B		R1500m	
C		R1800m	
D		R2400m	

LNNAV VNAV DA(H) in lieu of MDA(H) depends on operator policy.

RKJB/MWX
MUAN INTL

JEPPESSEN
25 OCT 24 (13-2) Eff 30 Oct 1600Z

MUAN, KOREA
VOR Rwy 19

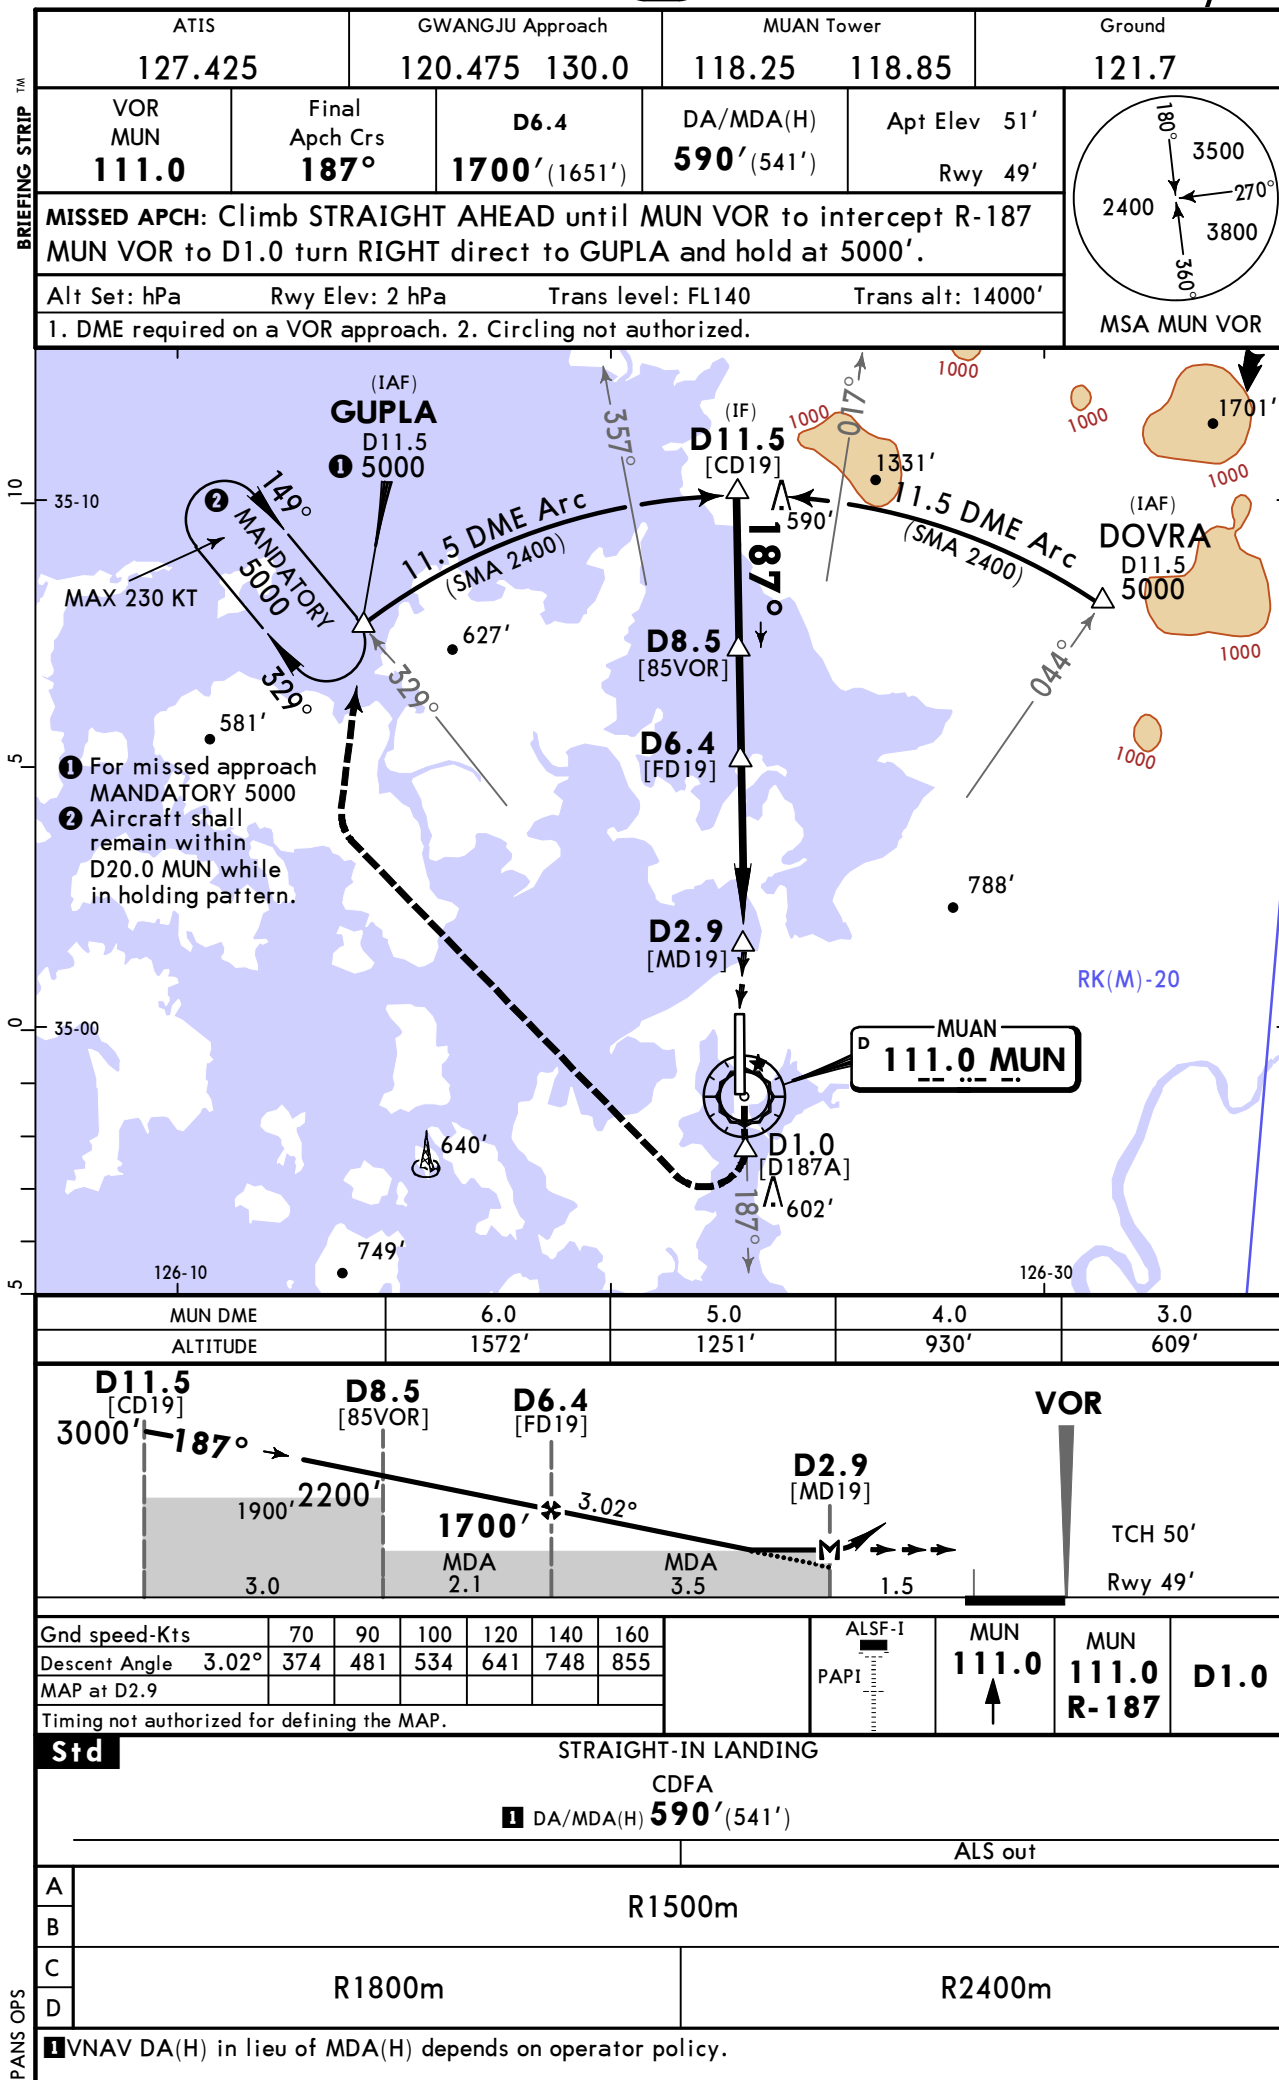


Chart changes since cycle 03-2025

ADD = added chart, REV = revised chart, DEL = deleted chart.

ACT	PROCEDURE IDENT	INDEX	REV DATE	EFF DATE
MUAN, (MUAN INTL - RKJB)				

TERMINAL CHART CHANGE NOTICES

Chart Change Notices for Airport RKJB

Type: Terminal
Effectivity: Temporary
Begin Date: 20240221
End Date: 20250720

(11-1) ILS Z or LOC Z Rwy 01 (11-2) ILS Y or LOC Y Rwy 01 will be U/S due to Rwy 01 LOC replacement works from 1600 UTC 21 FEB 2024 to 1500 UTC 20 JUL 2025. Refer also to the latest NOTAM.

Type: Terminal
Effectivity: Temporary
Begin Date: Immediately
End Date: 20250701

(10-1R) RADAR MINIMUM ALTITUDES: The primary surveillance radar at Muan INTL Airport will be unserviceable due to radar replacement work from 0000 UTC 16 MAR 2024 to 0000 UTC 30 JUN 2025. During replacement work, SSR (Secondary Surveillance Radar) service still available on transponder equipped aircraft only. Any change to the contents of this page will be notified by NOTAM.

Type: Terminal
Effectivity: Temporary
Begin Date: 20241030
End Date: 20250430

(11-3) ILS Z or LOC Z Rwy 19 and (11-4) ILS Y or LOC Y Rwy 19 will not be available due to unserviceability of ILS/DME for Rwy 19.

Type: Terminal
Effectivity: Temporary
Begin Date: 20240221
End Date: 20250720

ALS for Rwy 19 will be U/S due to replacement works from 1600 UTC 21 FEB 2024 to 1500 UTC 20 JUL 2025. Refer also to the latest NOTAM.