PRODUCT SPECIFICATION

LANGUAGE

ENGLISH

[1. SCOPE]

This specification covers the 0.8 mm PITCH BOARD TO BOARD CONNECTOR series

[2. PRODUCT NAME AND PART NUMBER]

Product Name	Part Number
Receptacle Housing Assembly	207419-0080
Embossed Tape Package for 207419-0080	207419-0081
Plug Housing Assembly	207420-0080
Embossed Tape Package for 207420-0080	207420-0081

REV. Α SHEET **REVISE ON PC ONLY** TITLE: 0.8 BB CONN. H=0.75 (ONLY POWER TERMINAL VER.) RELEASED '19 09/30 PRODUCT SPECIFICATION SYKO01 CONFIDENTIAL THIS DOCUMENT CONTAINS INFORMATION THAT IS PROPRIETARY TO DESCRIPTION MOLEX INC. AND SHOULD NOT BE USED WITHOUT WRITTEN PERMISSION REV. **STATUS DESIGN CONTROL** WRITTEN CHECKED APPROVED DATE: YR/MO/DAY BY: YSKIM01 BY: KSKIM BY: 2019/02/21 **KOR** SYKO01 **DOCUMENT NUMBER** SHEET **CUSTOMER** DOC. TYPE DOC. PART PS 001 **GENERAL** 2074190080 1 OF 11 EN-127(2015-12)

PRODUCT SPECIFICATION

LANGUAGE

ENGLISH

[3. RATINGS]

Item	Standard				
Rated Voltage (MAX.)	50	V			
Rated Current (MAX.)	For terminal	5.5A / PIN*3	[AC (rms) / DC]		
Ambient Temperature Range ^{*1}		-40°C ~	+ 85°C*²		
	Temperature		-5°C∼+50°C		
Storage condition after opening the Humidity	Hun	nidity	85%R.H. MAX. (No condensation)		
prevention package	Term		For 6 months after shipping (unopened package)		

- *1. Non-operating connectors after reflow must follow the operating temperature range condition.
- *2. Including the terminal temperature rise generated by conducting electricity.
 *3. When two circuits are constructed via PCB/FPC circuit, 11A of current per 2-circuit is applicable. But the circuit via fitting nail shall not be acceptable for excessive temperature increase.

FOR TON INFORMATION

			REVISE ON PC ONLY	TITLE:				
		Α	SEE SHEET 1 OF 11	0.8 BB CONN. H=0.75(ONLY POWER TERMINAL VER.) PRODUCT SPECIFICATION CONFIDENTIAL				
				THIS DOCUMENT CONTAINS INFORMATION THAT IS PROPRIETARY TO				
		REV.	DESCRIPTION	MOLEX INC. A	ND SHOULD NO	OT BE USED WITHOUT WRITTEN PER	MISSION	
	DOCUMENT NUMBER		DOC. TYPE	DOC. PART	CUSTOMER	SHEET		
	2074190080		PS	001	GENERAL	2 OF 11		
						EN-1:	27(2015-12)	

PRODUCT SPECIFICATION

LANGUAGE

ENGLISH

[4. PERFORMANCE]

4-1. Electrical Performance

Item		Test Condition	Requirement
4-1-1 Contact Resistance		Mate connectors and measured by dry circuit, 20mV MAX., 10mA MAX. (JIS C5402 5.4)	10 milliohm MAX. /PIN
4-1-2 Insulation Resistance		Mate connectors and apply 250V DC between adjacent terminal and ground. (JIS C5402 5.2/MIL-STD-202 Method 302)	100 Mega ohm MIN.
4-1-3	Dielectric Strength	No Breakdown on function	
4-1-4	Temperature Rise	Mate connectors and conduct the maximum rated current. (UL 498)	30 °C MAX.

4-2. Mechanical Performance

	Item	Test Condition		Requirement	
4-2-1	Insertion and Withdrawal Force	Insert and withdraw connectors at the speed rate of 5cycle per minute.	Insertion (MAX.) Withdrawal (MIN.)	MAX. 35.0 N(Initial) {3.06 kgf} MAX. 35.0 N(After 10 Times) MIN. 10.0 N(Initial) {1.02 kgf} MIN. 10.0 N(After 10 Times)	
4-2-2	Terminal / Housing Retention Force	Apply axial pull out force at the speed rate of 25±3 mm/minute on the terminal assembled in the housing.	-0 -1		

			REVISE ON PC ONLY	TITLE:			
		Α	SEE SHEET 1 OF 11	0.8 BB CC	5(ONLY POWER TERMINAL CT SPECIFICATION ONFIDENTIAL	. VER.)	
			THIS DOCUMENT CONTAINS INFORMATION THAT IS PROPRIETARY TO				
		REV.	DESCRIPTION	MOLEX INC. A	ND SHOULD NO	T BE USED WITHOUT WRITTEN PER	MISSION
	DOCUMENT NUMBER			DOC. TYPE	DOC. PART	CUSTOMER	SHEET
	2074190080		PS 001		GENERAL	3 OF 11	
EN-1				27(2015-12)			

PRODUCT SPECIFICATION

LANGUAGE

ENGLISH

4-3. Environmental Performance and Others

Item		Test Condition	F	Requirement
4-3-1	Repeated Insertion / Withdrawal	When mated up to 10 cycles repeatedly by the rate of 5 cycles per minute.	Contact Resistance	20milliohm MAX. /PIN
			Appearance	No Damage on function
4-3-2	Vibration	Amplitude: 1.5mm P-P Frequency: 10~55~10 Hz in 1 minute. Duration: 2 hours in each X.Y.Z.axes. (MIL-STD-202 Method 201)	Contact Resistance	20milliohm MAX./PIN
			Discontinuity	1.0 microsecond MAX.
	4-3-3 Mechanical 3 str Shock (JIS	490m/s ² { 50G } , 3 strokes in each X.Y.Z.axes. (JIS C60068-2-27/MIL-STD-202 Method 213)	Appearance	No Damage on function
4-3-3			Contact Resistance	20milliohm MAX./PIN
			Discontinuity	1.0 microsecond MAX.
4-3-4	Heat	85±2°C, 96 hours	Appearance	No Damage on function
4-3-4	Resistance	(JIS C60068-2-2/MIL-STD-202 Method 108)	Contact Resistance	20milliohm MAX./PIN
4-3-5	Cold Resistance	-40±3°C, 96 hours (JIS C60068-2-1)	MAppearance	No Damage on function

		REVISE ON PC ONLY		TITLE:				
		A	SEE SHEET 1 OF 11	0.8 BB CONN. H=0.75(ONLY POWER TERMINAL VER.) PRODUCT SPECIFICATION CONFIDENTIAL				
	_			THIS DOCUMENT CONTAINS INFORMATION THAT IS PROPRIETARY TO				
		REV.	DESCRIPTION	MOLEX INC. AND SHOULD NOT BE USED WITHOUT WRITTEN PERMISSION			MISSION	
	DOCUMENT NUMBER		DOC. TYPE	DOC. PART	CUSTOMER	SHEET		
	2074190080		PS 001		GENERAL	4 OF 11		
						EN-1:	27(2015-12)	

PRODUCT SPECIFICATION

LANGUAGE

ENGLISH

			Contact Resistance	20milliohm MAX./PIN
--	--	--	-----------------------	---------------------

Item		Test Condition		Requirement		
				No Damage on function		
4.2.6	Llumiditu	Temperature : 60±2°C Relative Humidity : 90~95% Duration : 96 hours	Contact Resistance	20milliohm MAX./PIN		
4-3-6	Humidity	(JIS C60068-2-3/MIL-STD-202 Method 103)	Dielectric Strength	Must meet 4-1-3		
			Insulation Resistance	50 Mega ohm MIN.		
4-3-7	Temperature	5 cycles of : a) – 55°C, 30 minutes	Appearance	No Damage on function		
4-3-7	Cycling	b) + 85°C, 30 minutes (JIS C0025)	Contact Resistance	20milliohm MAX./PIN		
4-3-8	Salt Spray	48±4 hours exposure to a salt spray from the 5±1% solution at 35±2°C.	Appearance	No Damage on function		
4-3-6	Salt Spray	(JIS C60068-2-11/MIL-STD-202 Method 101)	Contact Resistance	20milliohm MAX./PIN		
420	SQ. Coo	Density of SO ₂ gas : 50±5ppm	Appearance	No Damage on function		
4-3-9	SO ₂ Gas	Temperature : 40±2°C Duration : 24 hours	Contact Resistance	20milliohm MAX./PIN		
4-3-10	Solderability	Soldering Time : 3±0.5 sec. Solder Temperature : 245±5 °C	Solder Wetting	95% of immersed area must show no voids, pin holes.		
	Solderability Soldering Time : 3±0.5 sec. Solder Wetting was shown o voids, pin holes. Solder Temperature : 245±5 °C FOR Wetting was shown o voids, pin holes.					

REVISE ON PC ONLY 0.8 BB CONN. H=0.75(ONLY POWER TERMINAL VER.) PRODUCT SPECIFICATION Α SEE SHEET 1 OF 11 **CONFIDENTIAL** THIS DOCUMENT CONTAINS INFORMATION THAT IS PROPRIETARY TO MOLEX INC. AND SHOULD NOT BE USED WITHOUT WRITTEN PERMISSION REV. DESCRIPTION DOCUMENT NUMBER SHEET DOC. PART DOC. TYPE CUSTOMER 2074190080 PS 001 **GENERAL**

2074190080 PS 001 GENERAL 5 OF 11 EN-127(2015-12)

PRODUCT SPECIFICATION

LANGUAGE

ENGLISH

Item		Test Condition	Requirement	
4-3-11 Resistance to Soldering Heat (Soldering iron method)		0.2mm from terminal tip and fitting nail tip. Soldering time: 5 seconds MAX. Solder temperature: 350°C±10°C	Appearance No Damage on fun	
	_		():	Reference Standard

): Reference Standa }: Reference Unit

[5. PRODUCT SHAPE, DIMENSIONS AND MATERIALS]

Refer to the drawing.

FOR ATION
INFORMATION


A	SEE SHEET 1 OF 11	TITLE: 0.8 BB CONN. H=0.75(ONLY POWER TERMINAL VER.) PRODUCT SPECIFICATION CONFIDENTIAL			
REV.	DESCRIPTION		MENT CONTAINS INFORMATION THAT IS PROPRIETAF AND SHOULD NOT BE USED WITHOUT WRITTEN PERM		-
DOCUMENT NUMBER 2074190080		DOC. TYPE PS	DOC. PART 001	CUSTOMER GENERAL	SHEET 6 OF 11
EN-127(2015-12)					

PRODUCT SPECIFICATION

LANGUAGE

ENGLISH

[6. INFRARED REFLOW CONDITION]

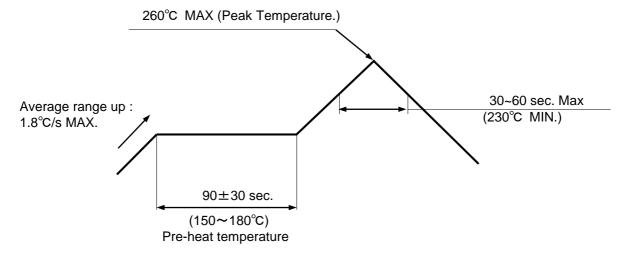

TEMPERATURE CONDITION GRAPH (TEMPERATURE ON BOARD PATTERN SIDE)

NOTE; Please check the reflow soldering condition by your own devices beforehand. Because the condition changes by the soldering devices, PWB, and so on. Also please check mount condition in case of Nitrogen atmosphere.

[7. INSTRUCTION UPON USAGE]

[Mating]

Please mate the connector with parallel manner. (Figure-1)

Please locate the inside wall of the rec housing and the plug after mating.

In the case of skew mating, please do not mate the connector at more than 10° lead in angle. (Figure-2)

Please do not mate the rec and plug at an angle as this way, because the housing is broken. (Figure-3)

[Un-mating]

Please extract the connector with parallel manner, (Figure-1) or swing them right to left slightly.(Figure-4)

(Please take care of excess twist extraction.) (Figure-5)



	REVISE ON PC ONLY		TITLE:				
	A	SEE SHEET 1 OF 11	0.8 BB CONN. H=0.75(ONLY POWER TERMINAL VER PRODUCT SPECIFICATION CONFIDENTIAL THIS DOCUMENT CONTAINS INFORMATION THAT IS PROPRIETARY TO MOLEX INC. AND SHOULD NOT BE USED WITHOUT WRITTEN PERMISSION				
	REV.	DESCRIPTION					
	KEV.	DESCRIPTION	WOLLSK WO. 7		The sold willion with left in		
DOCUMENT NUMBER		DOC. TYPE	DOC. PART	CUSTOMER	SHEET		
	2	2074190080	PS	001	GENERAL	7 OF 11	
	EN-127(2015-12						

LANGUAGE

ENGLISH

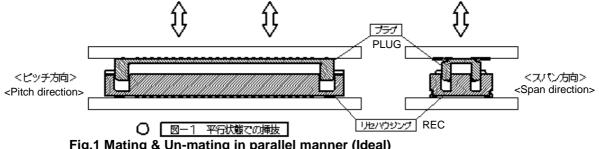
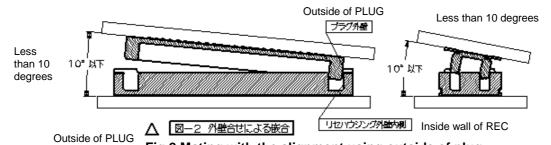


Fig.1 Mating & Un-mating in parallel manner (Ideal)



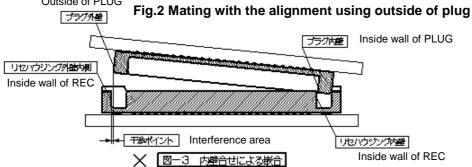


Fig.3 Mating with the alignment using inside of plug (Not preferred)

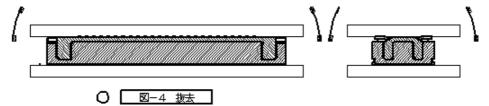


Fig.4 Un-mating by shaking back or force

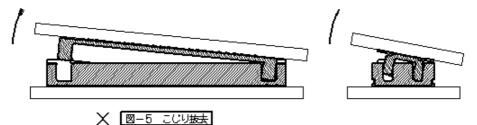


Fig.5 Un-mating with one strong rotation (can damage connector)

		A	SEE SHEET 1 OF 11	TITLE: 0.8 BB CC	. VER.)		
		REV.	DESCRIPTION	THIS DOCUMENT CONTAINS INFORMATION THAT IS PROPRIETARY MOLEX INC. AND SHOULD NOT BE USED WITHOUT WRITTEN PERMIS			
	DOCUMENT NUMBER		DOC. TYPE	DOC. PART	CUSTOMER	SHEET	
		2074190080		PS	001	GENERAL	8 OF 11
						EN-1:	27(2015-12)

PRODUCT SPECIFICATION

LANGUAGE

ENGLISH

[8. OTHERS]

- 1. Prohibit from applying an excessive load to the housing around terminals before mounting the connector onto PWB.
- 2. Please do not touch the terminals and fitting nails before or after mounting the connector onto PCB.
- 3. There may be slight differences in the housing coloring, but there will be no influence on the product's performance.
- 4. Specification is met although black spots, scratch on the housing, or a minim air bubble and so on may exist on mold resin.
 - As LCP is used as the mold material, the weld lines may be visible in some cases. However, they do not affect product performance.
- 5. Please ensure that the connector is fully mated. After setting the connector and cable assembly in the device, please ensure that the connector does not become unengaged due to vibration and shock conditions. There may be case of coming off if mating is insufficient and connectors get an inclines of 5 degrees.
- 6. There is instruction of design the following.
 - Please prepared without pattern area.
 - When an excessive mounting gap occurs, there may be contact area solder wicking.
- 7. The mounting specification for coplanarity does not include the influence of warpage of PCB.

 The warpage of PCB should be a maximum of 0.02mm if measuring from one connector edge to the other.
- 8. This connector performance was tested based on using rigid epoxy-glass PCB.
 - If you need to mount the connector on FPC, please make sure to conduct the reflow test in advance.
- 9. Recommend to place any stiffener board or film on the backside of FFC/FPC when you mount the connector to prevent deformation.
 - Due to the low profile design, please be cautious to set the reflow condition to prevent solder wicking.
- Fillet condition might be different depending on the mounting condition, please care of fillet condition of connectors.
- 11. There may be a case which changes housing color by depending on reflow conditions. However, it does not effect on connector performance.
- 12. There may be a case that the plated surface looks wavy by depending on reflow conditions. However, it does not effect on connector performance.
- 13. There is no influence in the product performance though discoloration might be seen in the soldering tail after the reflow. There is no solder on the top surface of tail in spec, and there is no influence in performance.
- 14. Because this product has a cutoff area on the tip of the terminal, the solderability performance in this area is not as good as compared to the side/back of the terminal. However, by building a good soldering fillet at the side/back of the terminal, there will be no issue on either the product function or the retention force of PCB.
- 15. If you leave any soldering area on this product open, there may be the possibility of a missing terminal short circuiting between pins, terminal buckling or the potential for the connector to come off of PCB. Therefore, please solder all of the terminals and fitting nails on PCB.
- 16. If there is accidental contact with the connector while it is going through the reflow machine, there may be deformation or damage caused to the connector. Please check to prevent this.
- 17. When conducting manual repairs using a soldering iron, please follow the soldering conditions shown in the product specification. If the conditions in the product spec are not followed, it may cause the terminals to fall off, a change in the contact gap, a deformation of the housing, melting of the housing, and damage the connector.

		REVISE ON PC ONLY		TITLE:				
		A SEE SHEET 1 OF 11		0.8 BB CONN. H=0.75(ONLY POWER TERMINAL VER.) PRODUCT SPECIFICATION CONFIDENTIAL				
						S INFORMATION THAT IS PROPRIETA	-	
		REV.	DESCRIPTION	MOLEX INC. A	ND SHOULD NO	OT BE USED WITHOUT WRITTEN PER	MISSION	
	DOCUMENT NUMBER		DOC. TYPE	DOC. PART	CUSTOMER	SHEET		
		4	2074190080	PS	001	GENERAL	9 OF 11	
						FN-1:	27(2015-12)	

PRODUCT SPECIFICATION

LANGUAGE

ENGLISH

- 18. When conducting manual repairs with a soldering iron, please do not use excessive solder or flux than needed. This may cause solder wicking or flux wicking issues, also it may eventually cause a contact defect and functional issues.
- 19. Please do not stack up PCB directly after mounted the connector on it.
- 20. If an alternative solder past is used (other than Sn-Ag-Cu 96.5%-3%-0.5%), please ensure in advance that the solder ability and PCB peeling force will not have any issues.
- 21. Please do not use the connector in a condition where the wire, PCB, or the contact area is experiencing a sympathetic vibration of wires and PCB, and constant movement of devices. This may cause a defect in the contact due to the contact area being worn down. Therefore, please fix wires and PCB on the chassis, and reduces sympathetic vibration.
- 22. Please do not conduct any "washing process" on the connector because it may damage the product's function.
- 23. Please investigate the mounting condition (reflow soldering condition) on your own devices beforehand. The mounting conditions may change due to the soldering temperature, soldering paste, air reflow machine, Nitrogen reflow machine, and the type of PCB. The different mounting conditions may have an influence on the product's performance.
- 24. Please do not use the connector alone to provide mechanical support for PCB. Please ensure that there is a fixed structure on the phone chassis or other component support for PCB.
- 25. There should not be more than one board to board connection between two separate PCB. When mounting several board to board connectors between parallel PCB, please ensure to separate each mated board to board connectors by using separate PCB.
- 26. Please keep enough clearance between connector and chassis of your application in order not to apply any pressure on the connector.
- 27. This product is not designed for the mating and un-mating of the connectors to be performed under the condition of an active electrical circuit. It may cause a spark and product defect if the connectors are mated and un-mated in this way.
- 28. After mated the connector, please do not allow PCB to apply pressure on the connector in either the pitch direction or the span direction. It may cause damage to the connector and may crack the soldering.
- 29. Due to the low profile design, there might be the flux going up to receptacle terminal beam part, anchor part and the other side of plug contacting part. However, it does not effect on connector performance.
- 30. To prevent excessive temperature increase, please make appropriate circuit design for PWB/FPC on which the connectors mount.
- 31. Notes of caution about wiring of power circuit
 - To prevent excessive temperature increase, please make appropriate circuit design PCB/FPC on which the connectors mount.
 - The heat capacity of micro connector is very lower than PCB, so the temperature rise by power distribution depends on the wiring condition of PCB mainly. Also the reasonable dimension of wiring section on PCB is 1.0mm width x35 μ m thickness in case of applying 1A.
 - It is possible to apply Max. 11A on this connector by shunting current to 2 power pins on PCB wiring. But the circuit via fitting nail shall not be acceptable for excessive temperature increase. In addition, the fitting nail in this product can't be acceptable for the electrical circuit.

FOR FORMATION INFORMATION

		A	SEE SHEET 1 OF 11	TITLE: 0.8 BB CONN. H=0.75(ONLY POWER TERMINAL VER.) PRODUCT SPECIFICATION CONFIDENTIAL				
		REV.	DESCRIPTION			S INFORMATION THAT IS PROPRIETA OT BE USED WITHOUT WRITTEN PER		
	DOCUMENT NUMBER		DOC. TYPE DOC. PART CUSTOMER GENERAL			SHEET		
		2074190080			GENERAL	10 OF 11		
1						EN-1:	27(2015-12)	

PRODUCT SPECIFICATION

LANGUAGE

ENGLISH

REV.	REV. RECORD	DATE	ECN NO.	WRITTEN BY :	CHECKED BY:
0	PROPOSED	'19/02/21	-	SYKO01	KSKIM
А	RELEASED	'19/09/30	-	SYKO01	KSKIM
			-OR	ON	
			FOR INFORMA	417 ₁	
			INTUSEO	<u> </u>	

			TITLE:				
	Α	SEE SHEET 1 OF 11	0.8 BB CONN. H=0.75(ONLY POWER TERMINAL VER.) PRODUCT SPECIFICATION CONFIDENTIAL				
	551	D = 0 OD ID = 1 OU	THIS DOCUMENT CONTAINS INFORMATION THAT IS PROPRIETARY TO MOLEX INC. AND SHOULD NOT BE USED WITHOUT WRITTEN PERMISSION				
	REV.	DESCRIPTION	WOLEX INC. A	IND SHOOLD INC	THE USED WITHOUT WRITTEN PER	IVIIOSION	
DOCUMENT NUMBER		DOC. TYPE	DOC. PART	CUSTOMER	SHEET		
	2	2074190080	PS	001	GENERAL	11 OF 11	
					EN-12	27(2015-12)	