TOL. GRADE	TOLERANCE		
R	f	m	c
0 < L ≤ 4	±0.1	±0.2	±0.3
4 < L ≤ 16	±0.2		
16 < L ≤ 63	±0.3	±0.3	±0.5
63 < L ≤ 250	±0.5	±0.5	±0.8
250 < L ≤ 1000	±0.8	±0.8	±1.2
1000 < L	±1.5	±1.5	±2.3

CHANGED CONTENTS	SYM	DATE	DES	CHE	APP

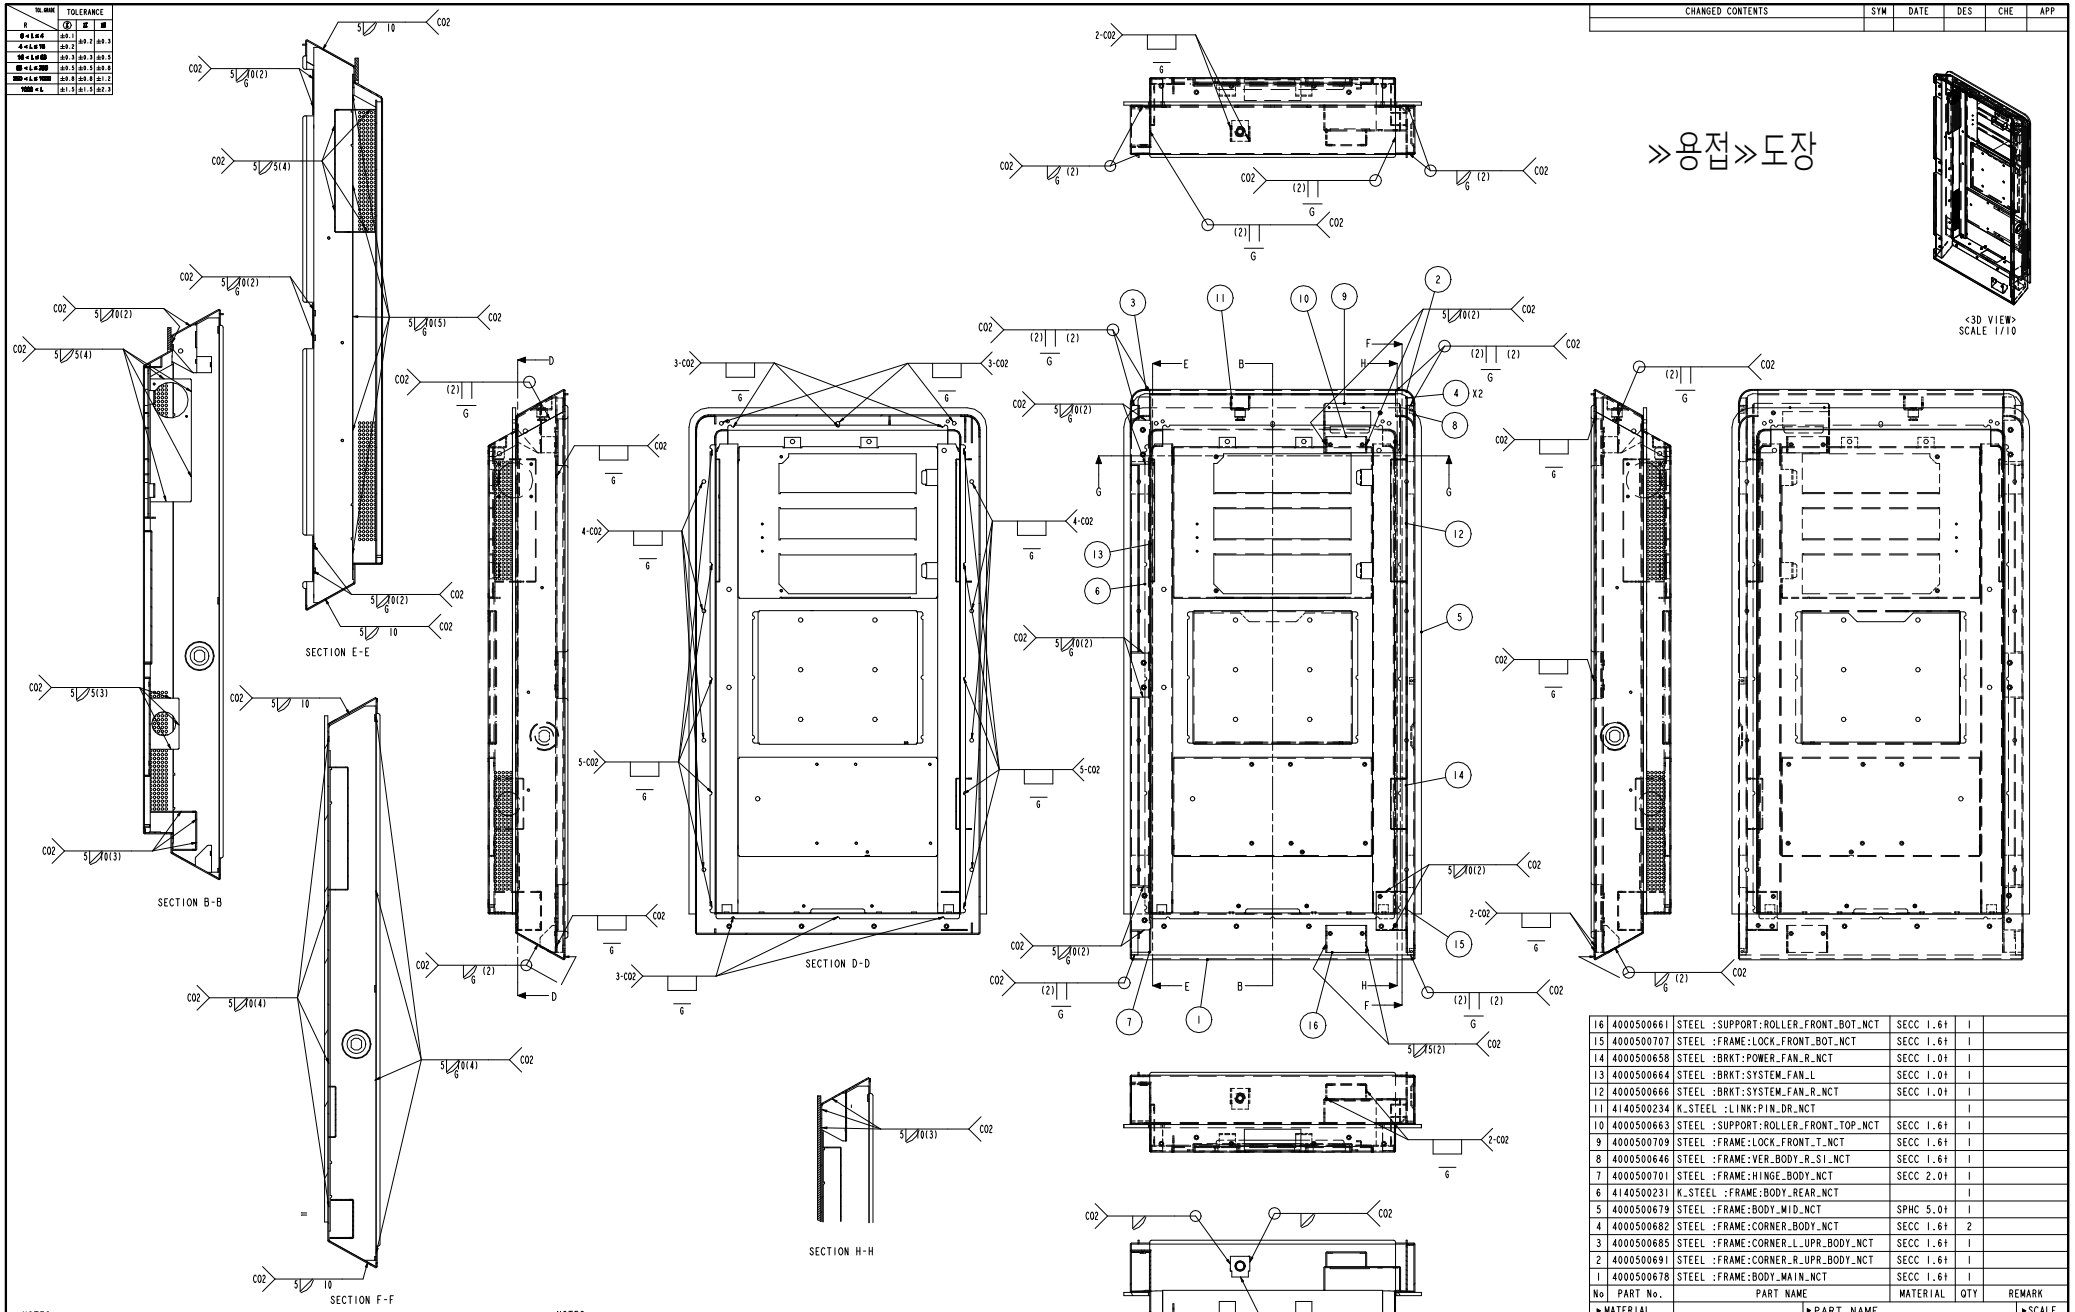

»용접»도장

No	PART No.	PART NAME	MATERIAL	QTY	REMARK
16	4000500661	STEEL :SUPPORT:ROLLER_FRONT_BOT_NCT	SECC 1.6t	1	
15	4000500707	STEEL :FRAME:LOCK_FRONT_BOT_NCT	SECC 1.6t	1	
14	4000500658	STEEL :BRKT:POWER_FAN_R_NCT	SECC 1.0t	1	
13	4000500664	STEEL :BRKT:SYSTEM_FAN_L	SECC 1.0t	1	
12	4000500666	STEEL :BRKT:SYSTEM_FAN_R_NCT	SECC 1.0t	1	
11	4140500234	K_STEEL :LINK:PIN_DR_NCT		1	
10	4000500663	STEEL :SUPPORT:ROLLER_FRONT_TOP_NCT	SECC 1.6t	1	
9	4000500709	STEEL :FRAME:LOCK_FRONT_T_NCT	SECC 1.6t	1	
8	4000500646	STEEL :FRAME:VER_BODY_R_SI_NCT	SECC 1.6t	1	
7	4000500701	STEEL :FRAME:HINGE_BODY_NCT	SECC 2.0t	1	
6	4140500231	K_STEEL :FRAME:BODY_REAR_NCT		1	
5	4000500679	STEEL :FRAME:BODY_MID_NCT	SPHC 5.0t	1	
4	4000500682	STEEL :FRAME:CORNER_BODY_NCT	SECC 1.6t	2	
3	4000500685	STEEL :FRAME:CORNER_L_UPR_BODY_NCT	SECC 1.6t	1	
2	4000500691	STEEL :FRAME:CORNER_R_UPR_BODY_NCT	SECC 1.6t	1	
1	4000500678	STEEL :FRAME:BODY_MAIN_NCT	SECC 1.6t	1	

▶MATERIAL		▶PART NAME	▶SCALE
▶SURFACE	SPRAY	K_STEEL; FRAME:BODY_NCT	1/4
▶DESIGNED	▶CHECKED / ▶APPROVED		▶SHEET
2026.03.24 김동현	2026.03.24 남영준 / 2026.03.24 문창환		1/3
HYOSUNG TNS		▶PART No. 4140500230	▶SYM 00

본 도면은 효성TNS 자산으로 영업비밀로 엄격히 관리되며 무단 배포 및 불법적인 사용을 금합니다.
This drawing is property of Hyosung TNS INC. and strictly treated as a trade secret.
Therefore unauthorized distribution and illegal use are prohibited.

NOTES.
1. This is a drawing for welding and painting.
2. Painting Specifications
   - Hammertone powder coating (MN327K / AKZONOBEL) or our approved material
3. Paint Thickness
   - The whole: Make sure to maintain an average of 60 or more and 100 microns or less.
4. Apply Heat Treatment after painting .
5. Make sure there is no unpainted surface.
6. PEM Nut,Caulking screw,Pin & TAP should be masked when painting.
7. Hatching section in the drawing should be masked.
8. Consult with the designer and instruct welding for welds other than instructed ones.
9. The flatness and perpendicularity should be maintained after welding.
10. Make sure there is no warpage after welding.
11. The fitting holes of the parts must be blocked after welding.
12. ◯: This mark means the dimension to be inspected.

NOTES.
1. 본 도면은 용접 및 도장 도면 임.
2. 도장 사양
   - 함마톤 분체 도장 (MN327K / 악조노벨) 또는 당사 승인 제질
3. 도장 두께
   - 전체 : 평균 60 이상 100 마크론 이하 유지 할 것.
4. 도장후 열처리 할 것
5. 미도장이 없도록 할 것.
6. 도장시 PEM Nut,Caulking screw,Pin & TAP부는 마스킹 처리 할 것.
7. 도면내 해칭부 지시 영역 마스킹 처리 할 것.
8. 용접지시 이외의 용접부는 용접지도 및 상의하여 진행 할 것.
9. 용접 후 평탄도, 직각도가 유지 될 것.
10. 용접 후 휨이 없을 것.
11. 부품의 맞춤홀은 용접 후 막음 처리 할 것.
12. ◯ 표시부는 수검 관리 치수임.

SAMPLE

<WELDING>
P/N : 4140500230