

West Bengal State Electricity Distribution Co. Ltd.

(A Government of West Bengal Enterprise)

Order No. 3

Date: 23.09.2010

WBSEDCL has around 1,30,000 Distribution Transformers (DTRs) in the system and the annual failure rate is around 10%. The annual cash outflow for repair of the same is approximately Rs 25 Cr. It has been decided to map the total asset life cycle of each and every DTR from procurement to scrap. The capacity building consultants M/s PwC have developed a web based software namely Transformer Transaction Management System to capture all relevant details of a DTR including each and every transaction of the same. To start this putting unique DTR index numbers is essential. Hence, it is decided that all DTRs and Sub-stations shall be indexed and the data shall be uploaded into TTMS for master data creation on a priority basis. The guideline for the same is given below:

1. All existing DTRs of WBSEDCL shall be indexed. These DTRs may be currently located in any of the following locations:
 - a. In fields on double pole sub-stations
 - b. In stores awaiting utilization (healthy DTRs)
 - c. In stores awaiting repair (damaged DTRs)
 - d. At repairer's work shop (under repair)

✓ 2. For writing index numbers on DTRs an area measuring 8" x 4" shall be painted at the mid portion of the main tank of the DTR near the reinforcement bar, by applying two coats of weather proof black synthetic emulsion paint after thoroughly cleaning the surface. Letterings shall be done with weather proof white synthetic emulsion paint. Letters shall be at least 1.5" in height and 0.25" in width. The numbers shall be written by professional Sign Writers only.

3. The DTR numbering format shall be as follows:

DX-YY-ZZZZZZ

Where DX denotes the alpha code for DTRs depending on KVA rating of the DTR as given in **Annexure: 1**; YY denotes the division accounting code developed by the Finance wing as shown in **Annexure: 2**; ZZZZZZ denotes the 6 digit running serial number of the DTR in the division, irrespective of the KVA rating. If the DTR is in field this should start from 000001 and if the same is in division stores the numbering should start from 900001. In both cases the numbers must be unique in the division.

Example:

- I. One 25 KVA DTR in field under Suri Division shall be indexed as follows:

DG-28-000001

W.B.S. Electricity Distribution Co. Ltd.
Receipt No. 1065 Date 4.10.10
AM(P&A) / AM(P&A) * E DCC
P.A. to B.M. / M(S.O.F.)

10. For writing index numbers on Sub-station structures an area measuring 6" x 4" shall be painted at the mid portion of the double pole structure, by applying two coats of weather proof black synthetic emulsion paint after thoroughly cleaning the surface. Letterings shall be done with weather proof white synthetic emulsion paint. Letters shall be at least 1.5" in height and 0.25" in width. The numbers shall be written by professional Sign Writers only.
11. It has been decided that all DTRs those move through divisional stores with effect from 1st October 2010 (new, repaired or defective) shall be indexed as per instruction given in Sl. No. 3 of this order if the same is not already indexed. If any DTR bears index number starting with "T" the same shall be wiped out and the new index number with "D" shall be written along with new division code as per Annexure 2.
12. Any such re-indexing of DTR/ Sub-station shall be meticulously captured by the respective division. The same will be essential to link health check up data of the same DTR done under the old index number.
- ✓ 13. Newly procured DTRs come with pre-generated index numbers. All newly procured DTRs shall bear the accounting code "90". The unique index numbers are engraved on the body of the main tank. In some cases the same may be written on the tank by paints. In some other cases the numbers may be embossed on the name plate of the DTR. If the number is written on the name plate or the quality of painting is not good then the same number shall be re-written at Central/ Regional/ Divisional stores before sending the same to the field @ Rs 20/- per DTR.
14. If the Central Store/ Regional Store receive/ already have some new DTR which is not indexed, the same shall be indexed before sending it to the next Store/ field following the new accounting code developed for Central/ Regional Stores. The same is attached as **Annexure: 3**.
15. New Accounting code shall be generated by Finance wing of WBSEDCL whenever any new division is created and the same shall be communicated to the field.
- ✓ 16. The cost of writing DTR index numbers at Central/ Regional/ Divisional stores shall be done @ Rs 20/- per DTR by professional sign writer.
17. All papers relating to DTR movement/ repair (STN, SIRN, LOI, WO/DI etc) must contain this number wef 1st October, 2010. DTR repair shops must mention this number in all their communications. The Division Manager shall not process any bill/ release payments unless the invoice mentions the index number wef this date. The survey, inspection and test. reports must contain the index numbers.
18. Our consultants M/s PwC have already developed web based software named "Transformer Transaction Management System" (TTMS) and the same can be accessed using the URL: **http://59.90.254.50/tms**. Once the DTRs are

Where DG is Alpha Code for 25 KVA DTR as per Annexure 1 and New Division Code of Suri Division is 28 as per Annexure 2.

II. A DTR of 25 KVA rating at Suri Divisional store will be indexed as follows:
DG-28-900001

4. Each DTR shall be indexed only once in its entire life cycle. Index number once generated shall never change when the DTR moves from one location to the other.
5. It is observed that DTR health check up activity is getting delayed due to several constraints. While all possible measures are being adopted to expedite the activity, DTR indexing for in-service DTRs in fields and Sub-station structures need to be completed by 31st December 2010. To enable this DTR indexing work can be done, as explained above, as an independent activity @ Rs 40/- per urban DTR and Sub-station and @ Rs 60/- per rural DTR and Sub-station as per the Central Rate Contract issued by the Material Controller vide P&S/P-30/2008-09 (P-IV).
6. If some of the DTRs are already indexed in the field with "T" the same shall be wiped off and new index number starting with "D" shall be written along with new division code as per Annexure 2. Any old accounting code for divisions is hereby dispensed with.
7. Index number for Sub-station structure shall start with "S" and shall be of the following format:

S-XX-YYYY-Z

Where S denotes Sub-station structure; XX denotes the division accounting code developed by the Finance wing as shown in Annexure: B; YYYY denotes the 4 digit running serial number of the sub-station in the division; Z will normally be 0. If any new Sub-station comes up in future between two already indexed Sub-stations, this number shall be 1,2 etc. (If one substation comes up in between S-XX-0001-0 and S-XX-0002-0 will be indexed as S-XX-0001-1 and so on)

Example

One Substation structure in Suri Division shall be indexed as follows:

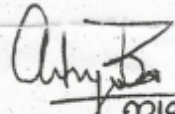
S-28-0001-0

Please note New Division Code of Suri Division is 28 as per Annexure 2.

8. If some Sub-stations are already indexed with old division code, the new division code shall be written in the Sub-station.
9. Payment for writing of re-writing of index numbers in the field on DTR and Sub-station shall be as per clause no. 5 of this order.

indexed the same shall be uploaded into the system from the store/ division itself and all subsequent transactions shall be captured in the TTMS. From 1st October 2010 all DTR movement through Central/ Regional/ Divisional stores shall be only through the TTMS. For this Chief Engineer (Dist) had already issued an order **Annexure: 4** empowering all Divisional Managers to procure Computers with Broadband connectivity for divisional stores. All divisional stores should have this facility in place by 30th September 2010.

19. Unique User Id and Password for each user viz. Division Manager/ Division store/Regional store/Central store has been created. Respective user needs to get in touch with SE (Tech) in Distribution Head Quarter to get the same for the first time and is responsible for change the password to ensure data security.
20. The Chief Engineer (Dist) and Material Controller shall ensure Computers with Broadband connectivity at regional/ central stores by 30th September, 2010. These stores shall be instructed to start writing index numbers on DTRs as mentioned in the foregoing sections.
21. Zonal Managers shall personally ensure the compliance of this order with due priority and shall keep the undersigned informed on a regular basis.
22. For any help/ queries Mr S.N.Das, S.E.-Technical of Distribution Head Quarter (Land line No 033-23197559 & Cell No 9475852653) may be contacted.
23. This order supersedes all previous orders in this regard.


23/9/10
(Abhijit Bose)
Executive Director (Distribution)