# Alsin AW

\*Also fits BMW 6F21WA & VW/Audi 09G, 09K, 09M units

15741-29K



**Lockup Clutch Control Valve Kit** 

### Helps cure:

- RPM surging on coast/light acceleration
- Harsh downshifts

Note: Requires tool kits F-15741-TL29, F-15741-TL29PL & the VB-FIX reaming fixture.

(2) 15741-01K





**Main Pressure Regulator** & Boost Assembly Kit

### Helps cure:

- Excess pressure in reverse
- Fluid & converter lining overheat

Note: Requires tool kit F-15741-TL & the VB-FIX reaming fixture.

15741-11K





# **Secondary Regulator** Valve Kit


## Helps cure:

- Overheating fluid, bushing & converter
- Harsh reverse engagement

Note: Requires tool kit F-15741-TL11 & the VB-FIX reaming fixture.

15741-18K





Fits either of 2 locations

### Helps cure:

- DTC's for excess shift time/engine RPM
- Slippage or shock on kickdown

Note: Requires tool kit F-15741-TL18 & the VB-FIX reaming fixture.

15741-41



# **Oversized Manual Valve**

### Helps cure:


- Reduced line pressure
- Delayed drive/reverse engagement


Note: Requires tool kit F-15741-TL41 & the VB-FIX reaming fixture.



1 Automatic Drive • P.O. Box 440 • Bellows Falls, VT 05101-0440 USA (800) 843-2600 • (802) 463-9722 • F: (802) 463-4059 • www.sonnax.com



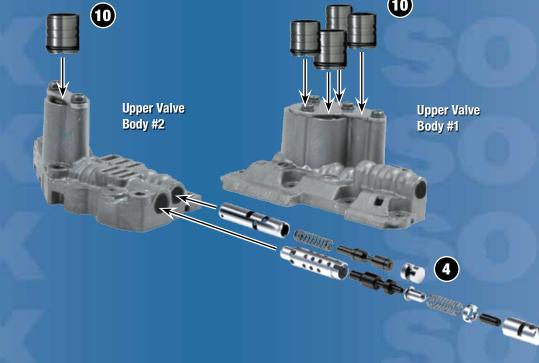

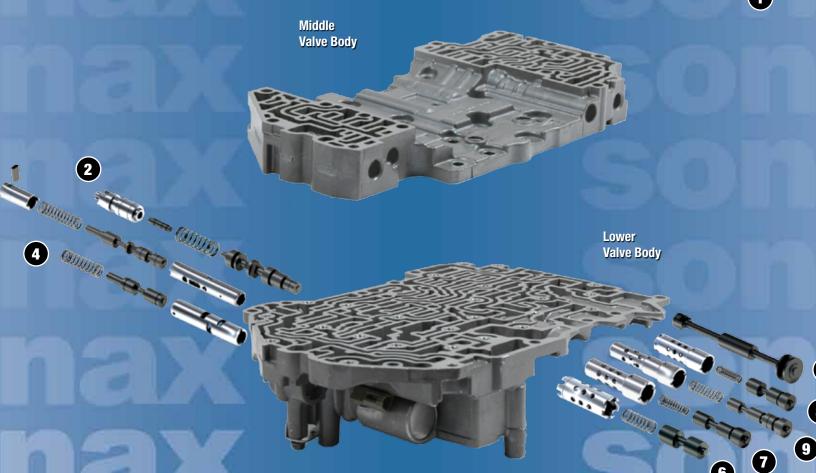

©2011 Sonnax Industries. Inc





# K1 Clutch Control Valve Kit FIXTUR

### Helps cure:

- Flare upshifts or downshift bind-ups
- Excess clutch overlap & distress

Note: Requires tool kit F-15741-TL25 & the VB-FIX reaming fixture.







# Helps cure:

- Flare upshifts or downshift bind-ups
- Excess clutch overlap & distress

Note: Requires tool kit F-15741-TL5 & the VB-FIX reaming fixture.





# K3 Clutch Control Valve Kit FIXTURE

### Helps cure:

- Flare upshifts or downshift bind-ups
- Excess clutch overlap & distress

Note: Requires tool kit F-15741-TL8 & the VB-FIX reaming fixture.

(9) 15741-22K



**B1 Brake Control Valve Kit** 

### Helps cure:

- Harsh downshifts
- Flare on 1-2, 2-3 & 5-6 upshift

Note: Requires tool kit F-15741-TL22 & the VB-FIX reaming fixture.

(10) 15741-14K

# **Accumulator Piston Kit**

# Helps cure:

- Delayed engagements
- Slipping in forward gears

(11) 15741-35K

5 small, 9mm

(12) 15741-36K

5 large, 11mm

# **O-Ringed End Plug Kits**

### Helps cure:

6

• Shift complaints associated with circuit pressure loss