で記 ちれるも N

sonnax

TIME TESTED ullet INDUSTRY $\mathsf{TRUSTED}^@$

1 Automatic Drive • P.O. Box 440 • Bellows Falls, VT 05101-0440 USA (800) 843-2600 • (802) 463-9722 • F: (802) 463-4059 • www.sonnax.com

(1) 56947J-05K*

Oversized TCC Control Valve Kit



Helps cure:

- Excess TCC slip, Code 741
- TCC lining comes off

Note: Requires tool kit F-56947J-TL2, & the VB-FIX reaming fixture.

(2) 56947J-15K*

TCC Modulator Valve & Sleeve Kit



Helps cure:

- Excess TCC slip, Codes 741 & 1783
- Transmission over temperature

Note: Requires tool kit F-56947J-TL15 & the VB-FIX reaming fixture.

*Also fits 5R55W/S units






TCC Modulator Sleeve & Plunger Valve Kit

Helps cure:

- High TCC slip RPM at increasing load
- Slip codes, Elevated fluid temperature
- (4) 56947J-63K






Helps cure:

- Converter burn-up or apply complaints
- Delayed engagements

Note: Requires tool kit **F-56947J-TL63** & the **VB-FIX** reaming fixture.

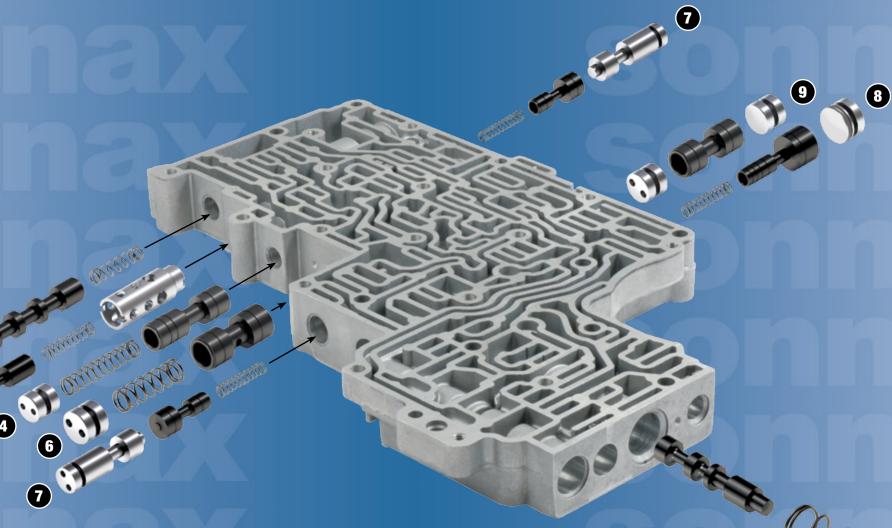





Pressure Regulator Valve Kit

Helps cure:

- Delayed engagements, Soft shifts
- High line pressure in reverse

Note: Requires tool kit **F-56947J-TL39** & the **VB-FIX** reaming fixture.

(6) 56947J-56K



Forward Engagement Valve Kit



- Slipping or loss of forward gears
- Burned forward clutch

Note: Requires tool kit F-27741-TL13 & the VB-FIX reaming fixture.

(7) 56947J-49K



PCA/PCB Modulator
Valve Kit Fits either of 2 locations.

Helps cure:

- Line pressure concerns
- Delayed engagements in forward/reverse

Note: Requires tool kit F-56947J-TL49 & the VB-FIX reaming fixture.

8 56947J-53K



Reverse Modulator Valve Kit



- Delayed reverse engagement
- Loss of 4th or 5th gear

Note: Requires tool kit F-56947J-TL53 & the VB-FIX reaming fixture.





Reverse Engagement Valve Kit



- Delay or loss of reverse
- Burned direct clutch

Note: Requires tool kit F-27741-TL13 & the VB-FIX reaming fixture.



