Toyota U151E/F, U250E



(800) 843-2600 • (802) 463-9722 • F: (802) 463-4059 • www.sonnax.com



Oversized Secondary Pressure Regulator Valve Kit



Helps cure:

- Harsh lockup
- Converter apply/release complaints

Note: Requires tool kit F-57917E-TL16 & the VB-FIX reaming fixture.

(2) 57917E-03K*

Lockup Control Plunger Valve & Sleeve Kit

Helps cure:

- TCC apply/release problems
- Converter codes

(3) 27741-01K

Boost Valve Kit

Helps cure:

- Insufficient line rise in drive ranges
- Soft shifts

(4) 27741-08K



Oversized Pressure Regulator & Boost Valve Kit

Helps cure:

- Low/High line pressure
- Soft and/or harsh shifts

Note: Requires tool kit 57917E-TL8.


(5) 27741-13K **Solenoid Modulator**



Valve Kit Helps cure:

- Harsh/Flare upshifts
- TCC slip
- RPM cycling

Note: Requires tool kit F-27741-TL13 & the VB-FIX reaming fixture.

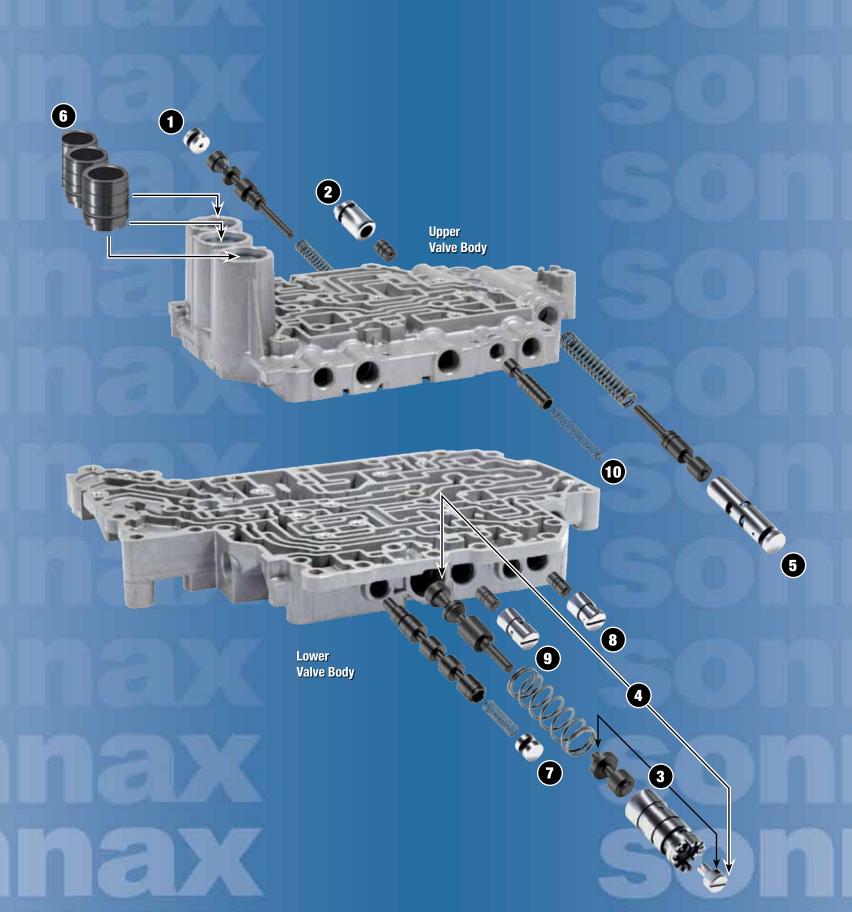




Accumulator Piston Kit

Can be used in any of 3 locations

Helps cure:

- Delayed engagements
- Slips/Flares in forward gears
- Burnt clutches
- (7) 27741-18K





Helps cure:

• Shift flares/bind-ups

- Burned forward/C1 clutch
- Direct/C0 clutch
- 2nd/B1 brake

Note: Requires tool kit F-27741-TL18 & the VB-FIX reaming fixture.

(8) 27741-06K

B2 Apply Control Plunger Kit


Helps cure:

- Burned B2 brake/clutch
- Delayed reverse
- (9) 27741-04K

B1 Apply Control Plunger Kit

Helps cure:

- Burned B1 brake/clutch
- 2-3 or 4-3 bind-up
- (10) 27741-16K





- Burned UD/B3 brake
- Shift complaints

Note: Requires tool kit F-15741-TL18 & the VB-FIX reaming fixture.

