Mercedes

1 Automatic Drive • P.O. Box 440 • Bellows Falls, VT 05101-0440 USA (800) 843-2600 • (802) 463-9722 • F: (802) 463-4059 • www.sonnax.com





TC Lockup Clutch Regulator Valve Kit

Helps cure:

- Converter apply & release complaints
- Converter codes, Lube failures

Note: Requires tool kit F-68942-TL10 & the VB-FIX reaming fixture.

(2) 68942-23K

TCC Damper Valve & Sleeve Kit

Helps cure:

• Harsh lockup

(3) 68942-16



Helps cure:

- Reduced line pressure
- Delayed engagement

Note: Requires tool kit F-68942-TL16 & the VB-FIX reaming fixture.

(4) 68942-07K



Helps cure:

- Loss of 2-3, 4-3 neutral
- Soft shifts under acceleration

Note: Requires tool kit F-68942-TL7 & the VB-FIX reaming fixture.

(5) 68942-06



Repairs outer bore only

Sleeve Helps cure:


- Loss of 2-3, 4-3 neutral
- Soft shifts under acceleration

Note: Requires tool kit F-68942-TL6 & the VB-FIX reaming fixture.









Early & Late Units

Helps cure:

Delayed engagements

11

(3)

• Upshift/Downshift flares

Note: Requires tool kit F-68942-TL14 & the VB-FIX reaming fixture.





Helps cure:

- Delayed engagements
- Poor performance/higher stall speeds

FIXTURE

Note: Requires tool kit F-68942-TL14 & the VB-FIX reaming fixture.





1-2, 4-5 Overlap **Control Valve Kit**

Helps cure:

- Harsh/Flare/Cycling of 1-2/4-5 shifts
- Slipping Gears

Note: Requires tool kit F-68942-TL19 & the VB-FIX reaming fixture.

68942-27K



2-3 Overlap Control Valve Kit



Helps cure:

- Harsh/Bumpy/Flare 2-3 shifts
- Slipping gears

Note: Requires tool kit F-68942-TL27 & the VB-FIX reaming fixture.

(10) 68942-31K



3-4 Overlap Control Valve Kit



Helps cure:

- Harsh/Bumpy/Flare 3-4 shifts
- Slipping gears

Note: Requires tool kit F-68942-TL31 & the VB-FIX reaming fixture.



Overlap Control Valve Sleeve Kit

This kit fits 3 locations! (Parts also sold separately)

Helps cure:

- Harsh/Bumpy/Flare shifts
- Slipping gears




Solenoid Pressure Regulator Spring

'99-Earlier Units

Helps cure:

- Delayed engagements
- Flare 2-3, 3-4 or 4-5 shifts

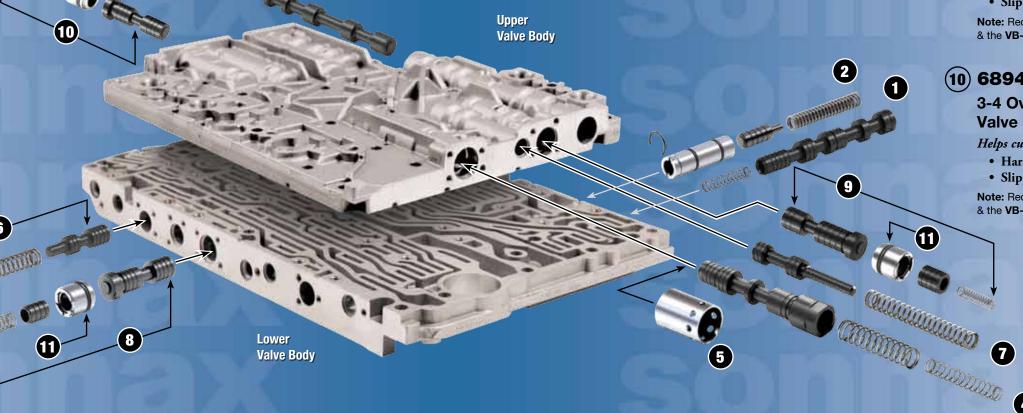

©2011 Sonnax Industries, Inc.