PART NUMBERS 59947-12K, F-59947-TL12

Oversized Pressure Regulator Valve & Boost Valve Kit

59947-12K

- 1 Pressure Regulator Valve
- 1 Pressure Regulator Spring
- 1 Boost Sleeve
- 1 Boost Valve




F-59947-TL12

- 1 Reamer
- 1 Guide Pin
- 1 Reamer Jig

Notes: Also fits AW55-51SN, AF 23/33 and RE5F22A units.

Instructions for verifying the secondary regulator valve prior to reaming the main regulator valve bore.

Wear reduces cooler & converter flow and results in excess converter pressure

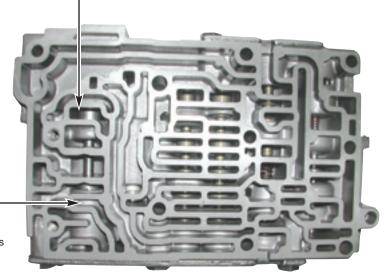

Wear causes:

- Slip/flare shift
- Low SLT psi
- Delayed engagements

Rear Control Valve Body

Both ends of the secondary regulator valve can be Wet Air Tested or vacuum tested. If performing a WAT, there should be minimal leakage. A vacuum test should reach at least 16" of vacuum.

