# **AW55-50SN**


PART NUMBER 59947-01K

## **Lockup Relay Control Valve & Sleeve Kit**

### 59947-01K

Lockup Relay Control Valve
Lockup Relay Control Sleeve

**Note:** Also fits AW55-51SN, AF 23/33 and RE5F22A units.

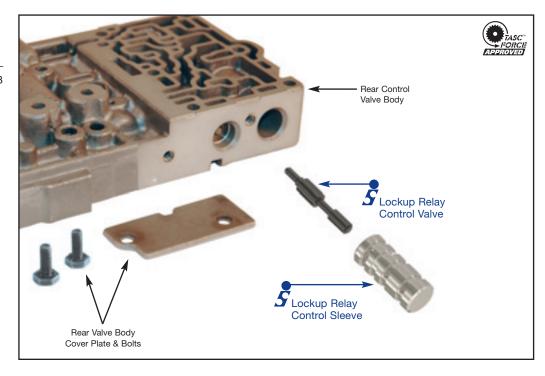

#### **Instructions:**

- 1. Remove and discard the OEM sleeve and valve.
- 2. Install the Sonnax sleeve and valve assembly as pictured. No rotational clocking of the replacement sleeve is necessary.

### **Verification:**

Perform a Wet Air Test or vacuum test of the sleeve assembly while in the bore at the outboard converter feed port indicated. A vacuum test should reach at least 18" of vacuum. If performing a WAT, no leakage should occur at the neighboring exhaust port on the opposite side of the casting.

For more information on valve body testing procedures, go to www.sonnax.com.

