
41651

1 Automatic Drive • P.O. Box 440 • Bellows Falls, VT 05101-0440 USA (800) 843-2600 • (802) 463-9722 • F: (802) 463-4059 • www.sonnax.com



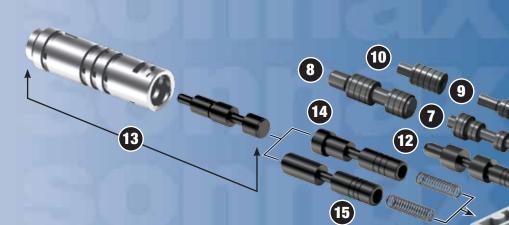

TCC Regulated Apply Valve Kit

Helps cure:

- TCC slip
- Code 741
- Ratio Codes

Note: Requires tool kit 84754-TL3

(2) 84754-43K **TCC Apply Valve Kit**







- Code 741
- No lockup
- Falling out of lockup hot
- Converter shudder
- High-slip RPM

Note: 84754-50K requires tool kit F-84754-TL50 & the VB-FIX reaming fixture





Oversized Pressure Regulator Valve Kit

Helps cure:

- High/Unstable line pressure
- Slide/Rotor failures
- Lube/Overheated converter issues

Note: Requires tool kit 84754-TL46





Helps cure:

• Code 1811

& Sleeve Kit

- Maximum adaptive/long shift
- TCC slippage/piston failure

Note: Requires tool kit F-84596-TL & the VB-FIX reaming fixture





Oversized Torque Signal Valve

Helps cure:

- Code 1811
- Poor/Intermittent line rise
- Slip/Shudder condition
- TCC codes 741, 742


Note: Requires tool kit 84754-TL44

(6) 84754-30K

Boost Valve & Sleeve Kit

Helps cure:

- Harsh reverse engagement
- Soft shifts, especially 1-2
- Low line rise forward/reverse

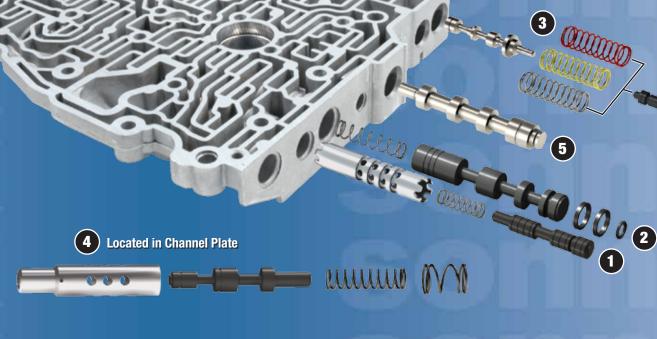

Valve Body



(8) 84754-37K

3-2 Downshift Valve

(9) 84754-38K 3-4 Shift Valve

(10) 84754-39K

4-3 Downshift Valve


Helps cure:

• Erratic/Temperature sensitive shifts

(11)

- Wrong gear starts
- Worn shift valves

(11) 84754-40K



Helps cure:

- Delayed engaements
- Flared 1-2
- Low reverse pressure
- Burned 1-2 band

Note: Requires tool kit 84754-TL2

(12) 84754-57K



Oversized 1-2 **Accumulator** Valve Kit

Helps cure:

- 1-2 Shift complaints
- Soft shifts
- Poor line rise

Note: Requires tool kit F-84754-TL57 & the VB-FIX reaming fixture



(13) 84754-53K

2-3 Accumulator Valve Kit

Helps cure:

- 2-3 Shift complaints
- Soft shifts
- Poor line rise

84754-55K GM

(15) 84754-58K Volvo

Oversized 3-4 Accumulator Valve Kits





Helps cure:

- 3-4 Shift complaints
- Soft shifts
- Poor line rise

Note: Requires tool kit F-84754-TL55 & the VB-FIX reaming fixture

