F4EAT, G4A-HL, -EL, -FEL

PART NUMBER 71812-01

COMPLAINT

Stator support sleeve wears at the interface of the converter bushing journal

CAUSE

The cast-iron surface is not durable.


Correction

This steel sleeve can be pressed onto a machined-down stator support bushing journal and will fit all variations.

Stator Support Sleeve

71812-011 Stator Support Sleeve



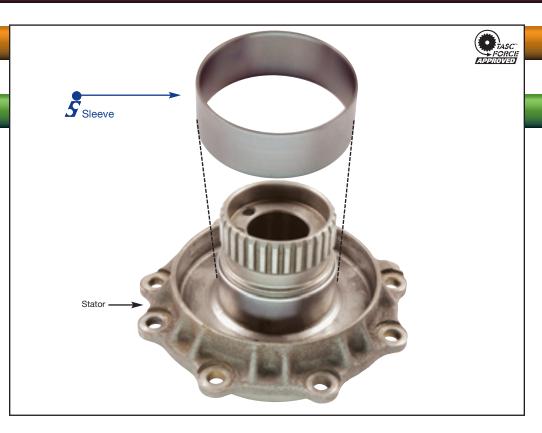

Sonnax Part Summary

The converter bushing journal in Mazda/Ford F4EAT, G4A-HL, -EL and -FEL units is often excessively worn. A worn bushing journal contributes to converter seal leaks, vibration, converter drain-back and loss of converter oil. There are many variations in bolt pattern and other stator features in these units that make it difficult to locate the correct replacement stator support, but the converter bushing journals are the same diameter. The Sonnax stator support sleeve **71812-01** allows any stator with a 2.084" diameter converter bushing journal to be repaired by machining the original journal down to accept the press-on steel sleeve.

Features & Benefits

- Allows salvage of stators with worn converter bushing journals.
- Steel sleeve is harder and more durable than original cast-iron surface.
- Allows original support to be repaired and prevents having to find a replacement with correct bolt pattern.

