10 Kits from Sonnax for 722.6 Mercedes

1. 68942-05K

Overlap Control Valve Sleeve Kit

Helps cure:
- Harsh, bumpy or flare shifts
- Slipping gears

Note: Kit includes (1A) **68942-04**, (1B) **68942-03**, (1C) **68942-02**, which are also available separately.

2. 68942-16

Oversized Manual Valve

Helps cure:
- Reduced line pressure
- Delayed drive/reverse engagement
- Loss of valve body core

Note: Requires tool kit **F-68942-TL16** & the **VB-FIX** reaming fixture.

3. 68942-23K

TCC Damper Valve & Sleeve Kit

Helps cure:
- Harsh lockup

4. 68942-10K

TC Lockup Clutch Regulator Valve Kit

Helps cure:
- Converter apply/release complaints
- Converter codes & lube failures
- Bore wear

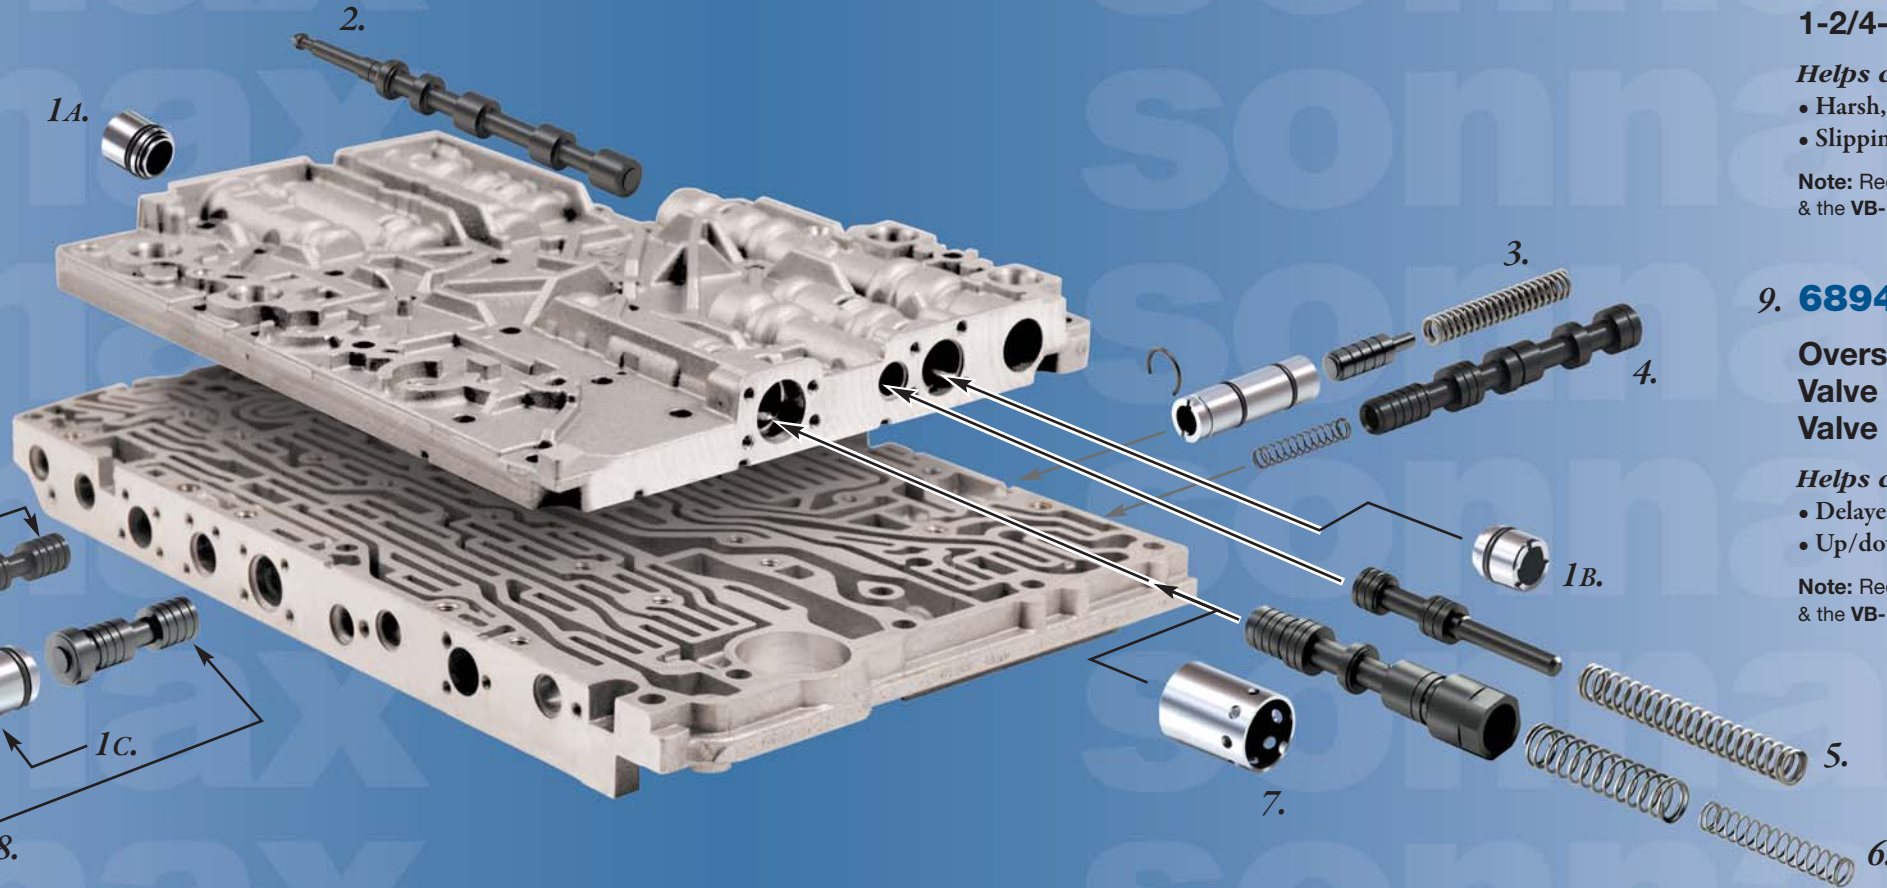**Note:** Requires tool kit **F-68942-TL10** & the **VB-FIX** reaming fixture.

5. 68942-14K

Lubricating Pressure Control Valve

Helps cure:
- Delayed engagements
- Poor performance/higher stall speeds
- Converter overheat

Note: Requires tool kit **F-68942-TL14** & the **VB-FIX** reaming fixture.

6. 68942-07K

Pressure Regulator Valve Kit

Helps cure:
- Loss of 2-3 shift
- 4-3 neutral on downshift

Note: Requires tool kit **F-68942-TL7** & the **VB-FIX** reaming fixture.

7. 68942-06

Outer Pressure Regulator Sleeve

Helps cure:
- Loss of 2-3 shift
- 4-3 neutral on downshift

Note: Requires tool kit **F-68942-TL6** & the **VB-FIX** reaming fixture.

8. 68942-19K

1-2/4-5 Overlap Valve Kit

Helps cure:
- Harsh, bumpy or flare 1-2/4-5 shifts
- Slipping gears

Note: Requires tool kit **F-68942-TL19** & the **VB-FIX** reaming fixture.

9. 68942-17K

Oversized Regulating Valve Pressure Control Valve Kit (Early & Late)

Helps cure:
- Delayed engagement
- Up/down shift flare

Note: Requires tool kit **F-68942-TL14** & the **VB-FIX** reaming fixture.

10. 68942-01

Regulating Valve Pressure Control Valve Spring ('99 & Earlier Units)

Helps cure:
- Delayed engagements
- Flared 2-3, 3-4 or 4-5 shifts

More information is available at **www.sonnax.com**

sonnax
TIME TESTED • INDUSTRY TRUSTED®