
VW 01M, 01N, 01P

PART NUMBER 119940-01K

TCC Boost Valve Kit

119940-01K

1 TCC Boost Valve & Sleeve 1 TCC Spring

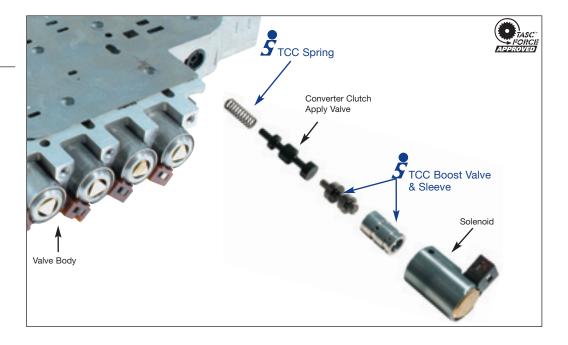

Instructions:

- 1. If significant wear/leakage is noticed, replace the worn OEM valve and sleeve with the new Sonnax kit.
- 2. The TCC spring provided in this kit is a direct replacement spring in case the OEM spring is broken or fatigued.

Wear Test:

The aluminum sleeve is often visibly worn. Bellow are instructions for a WAT (Wet Air Test) procedure to determine wear:



- , 1. Place a small amount of oil into this orifice. Block one of the two orifices with a finger. Follow with low air pressure.
- 2. There should be no/minimal oil leakage out of the other two orifices or past your thumb.

