TF-80/81SC, TF-60SN

PART NUMBER 15741-35K, 15741-36K

COMPLAINT

Shift complaints associated with circuit pressure loss

CAUSE

Valves, springs and fluid pressure push on the end plugs, eventually causing distortion and excessive clearance between the end plug and bore.

CORRECTION

These Sonnax end plugs with o-rings restore hydraulic circuit integrity.

O-Ringed End Plug Kits

15741-35K

5 Small End Plugs 9mm 7 Small O-Rings

15741-36K

5 Large End Plugs 11mm 7 Large O-Rings

Note: Fits Opel (AF40); Volvo (AM6); Peugeot (TF80) Saab (AF40/6); Land Rover (TF80); Mazda (AW6A-EL); Ford (AF21); BMW (6F21WA); VW/Audi (09G, 09K, 09M).


Also Available

OR-59947A-25

25 Small O-Rings 9mm

OR-59947B-25

25 Large O-Rings 11mm

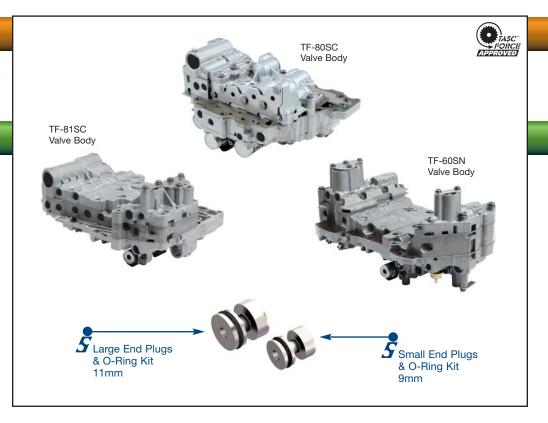

Sonnax Part Summary

These Sonnax end plugs with o-rings will fit many of the 9mm or 11mm diameter bores in the above listed applications that have OEM end plugs of similar configuration. The Sonnax end plugs feature an additional groove for the o-ring but otherwise are similar to the OEM end plugs in design and retention method. Compare your OEM end plug to the photo above to see if the design is similar.

Features & Benefits

- No special tools are required.
- Prevents loss of critical pressure.
- Two sizes fit many bores in these applications.
- 25 pack o-ring replacement kits sold separately.

You need 15741-35K or 15741-36K if...

A vacuum test at the retainer cavity will not hold at least 17" of vacuum.

