SATURN TAAT (TYPE 2 VB ONLY)

PART NUMBER 95200-03K

Boost Valve & Sleeve

Saturn TAAT Type 2 valve bodies only


95200-03K

- 1 Boost Valve
- 1 Boost Sleeve
- 2 O-Rings

Additional Items

95200-01


1 Pressure Regulator Valve Cushion Spring

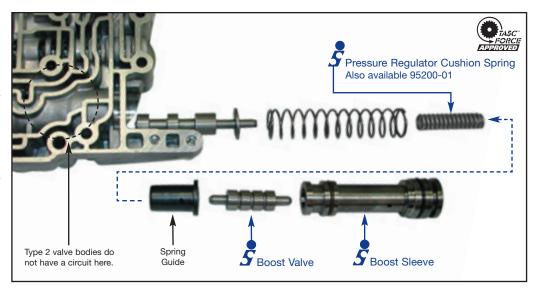



Wear Test:

Note: There are a number of methods for checking excessive wear in this bore line-up.

To Wet Air Test the boost valve assembly, place a small amount of oil into the bottom of the boost sleeve while plugging one of the cross holes with your thumb. Reinstall the boost valve and hold down into the sleeve securely. Force low air pressure into the second sleeve cross-hole. There should be little or no leakage past the boost valve out the end of the sleeve.



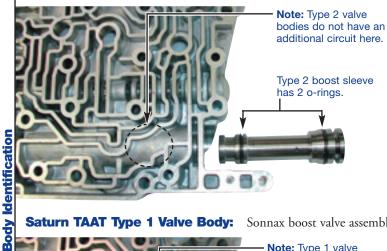

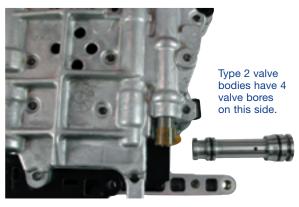

TAAT Type 1 Valve Body: Sonnax boost valve assembly does not work in type 1 valve bodies.

