AW55-50SN

PART NUMBER 59947-07K


Main Boost Valve & Sleeve Kit

59947-07K

- 1 Main Boost Valve
- 1 Main Boost Sleeve

Notes: Also fits AW55-51SN, AF 23/33 and RE5F22A units.

The **59947-07K** should not be used with Sonnax oversized pressure regulator valve **59947-12K**.

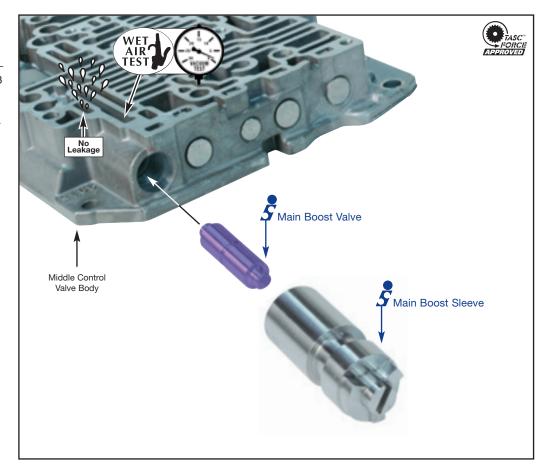

Instructions:

- 1. Note step location of retainer on the OEM sleeve end prior to removal.
- 2. Remove and discard the OEM sleeve and valve.
- 3. Install the Sonnax sleeve and valve assembly as pictured.
- 4. Ensure retainer is set at the same step location on the replacement sleeve.

Verification:

Perform a Wet Air Test or vacuum test of the sleeve assembly while in the bore at the outboard reverse feed port indicated. A vacuum test should reach at least 18" of vacuum. If performing a WAT, no leakage should occur at the neighboring exhaust port. For more information on valve body testing procedures, go to **www.sonnax.com.**

IMPORTANT NOTE: The pressure regulator valve bore is also subject to extreme wear, and should be checked. If it is worn severely, it must be repaired to re-establish proper pressures using kit **59947-12K**.

Pressure Regulator Valve Test Locations

