PART NUMBERS 56947J-01K, -03K

TCC Modulator Sleeve & Plunger Assemblies

56947J-03K

Increased Ratio

56947J-01K

OEM Ratio

Each kit includes the following

1 Sleeve

1 Valve

Valve Body

Increased Ratio Valve & Sleeve

56947J-03K

Identification Groove

Retaining Clip


OEM Ratio Valve & Sleeve

56947J-01K

Wet Air Test:

Visual wear can often be detected in the sleeve.

Place a small amount of oil into the PWM port, and follow with low air pressure. There should be no leakage past the plunger valve and out the neighboring exhaust port, or the exhaust port on the opposite side of the valve body.

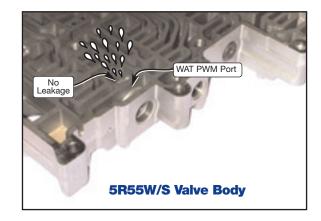

Installation Instructions

- 1. Remove OEM clip, sleeve and valve. Save the clip.
- 2. Remove and inspect the OEM modulator valve and spring.

Note: The valve bore inward of this TCC modulator sleeve wears rapidly. Always inspect for bore wear at the largest spool of the inner valve.

3. Install the OEM valve and spring, Sonnax modulator sleeve, valve and OEM retainer.

