
HONDA "BAXA" CIVICS & ACCORDS (196-UP)

PART NUMBER 88950-T

Solenoid Adjustment Tool

88950-T 1 Solenoid Adjustment Tool

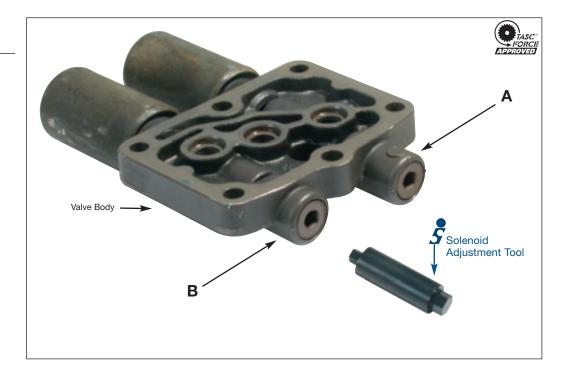

Instructions

Place the pentagon-shaped tip of the solenoid adjustment tool into the recess of the clutch pressure control solenoids "A" and "B". Turn the solenoid end for 1/2 to 1/4 turn clockwise to increase pressure.

Caution: Exceeding ¼ turn can result in a downshift clunk, and will require readjustment.

Adjusting solenoid "A" will affect:

- Reverse servo control and reverse engagement
- 1st clutch forward engagement
- 3rd clutch feed and 2-3 upshift
- TCC lockup RPM slip rate in 3rd only

Adjusting solenoid "B" will affect:

- 2nd clutch and 1-2 upshift
- 4th clutch and 3-4 upshift
- TCC slip rate in 4th

