AW55-50SN


PART NUMBERS 59947-05K

Solenoid Relay Valve & Sleeve Kit

59947-05K

1 Solenoid Relay Valve 1 Solenoid Relay Sleeve

Note: Also fits AW55-51SN, AF 23/33 and RE5F22A units.

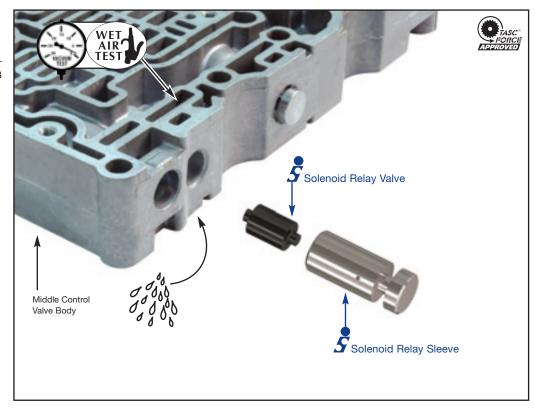

Instructions:

Remove and discard the OEM sleeve and valve. Install Sonnax sleeve and valve assembly as pictured.

Verification:

Perform a Wet Air Test or vacuum test of the sleeve assembly while in the bore at the outboard solenoid modulator feed port indicated. A vacuum test should reach at least 18" of vacuum. If performing a WAT, no leakage should occur at the neighboring exhaust port on the opposite side of the casting.

For more information on valve body testing procedures, go to www.sonnax.com.

