
AX4S, AX4N

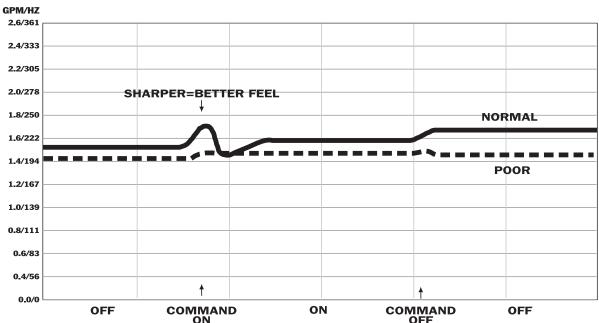

Condition: Good (normal) vs. poor TCC apply.

Correction: TCC solenoid check, Sonnax Bypass Control Valve & Sleeve 96206-01K (AXODE & AX4S) and 96203-03K or 96206-BK (AX4N).

Notes: Poor TCC apply is seen as no blip or ramp. Inspect bypass valve bore for wear.