

Raspberry Pi 5 Camera Not Detected – Fixed (IMX219 / Third-Party Cameras)

Problem

Raspberry Pi camera module was not being detected on Raspberry Pi OS.

Running commands like:

```
rpicam-hello
```

returned:

```
ERROR: no cameras available
```

The camera option was not available in raspi-config, and the system did not automatically detect the connected third-party camera module imx219.

Additional symptoms:

- No **Camera** option inside `raspi-config`
- The system did **not auto-detect** the camera
- The issue occurred even with proper ribbon cable connection
- Only **Camera Port 1** worked, while **Port 0 did not**


Cause

Raspberry Pi 5 uses a **new camera subsystem**, and **camera auto-detection is disabled for many third-party modules**.

Since this was a **third-party IMX219 camera module** (not an official Raspberry Pi camera), the OS did **not automatically load the required device tree overlay**, causing the Pi to ignore the sensor on boot.

Solution

Connect the camera module:

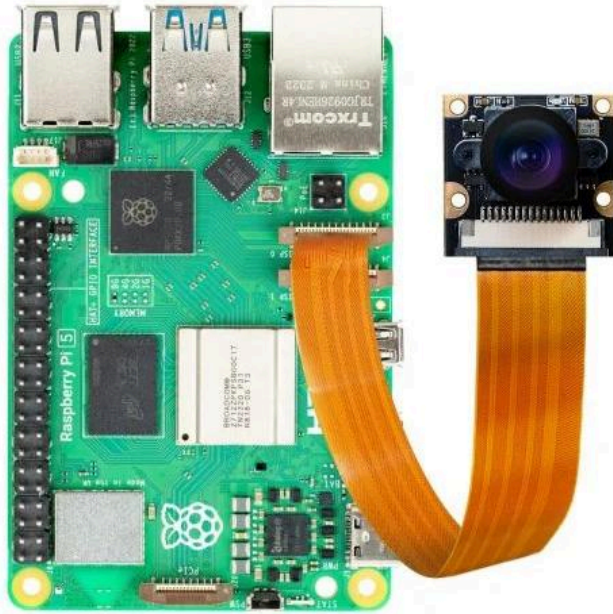

1. Open the configuration file:

```
sudo nano /boot/firmware/config.txt
```

2. Disable camera auto-detection:

Add (or change) this line:

```
camera_auto_detect=0
```

This forces manual overlay loading.

3. Add this line at the bottom:

```
dtoverlay=imx219,cam0  
dtoverlay=imx219,cam1
```

4. Save the file and reboot the system:

```
sudo reboot
```

After rebooting, the camera was successfully detected and worked normally.