SOIL CONSERVATION DEPARTMENT, GOVERNMENT OF ASSAM

Soil Erosion Monitoring Report · Dibrugarh District

Report date: 26-10-2026


Satellite images compared: 28-06-2020 – 26-10-2020 and 28-06-2026 – 26-10-2026

Summary

Between the 28-06-2020 – 26-10-2020 and 28-06-2026 – 26-10-2026 windows, 823.8 ha of stable land along the river turned into water and 4,959.3 ha of chars or sandbars were lost, while 7,619.6 ha of new land formed. 17 sites need immediate bank protection, and about 23,710 people live within 500 m of them. 19 more sites should be checked in the field before the monsoon. Away from the river, 6,627 ha lost vegetation cover and 1,037 ha became bare soil.

823.8 ha Bank erosion	**4,959.3 ha** Char or sandbar lost	**17** Sites for immediate action	**23,710** People within 500 m of immediate-action sites
7,619.6 ha New land (accretion)	**19** Sites to check before the monsoon	**6,627 ha** Vegetation loss	**1,037 ha** New bare soil

Priority sites

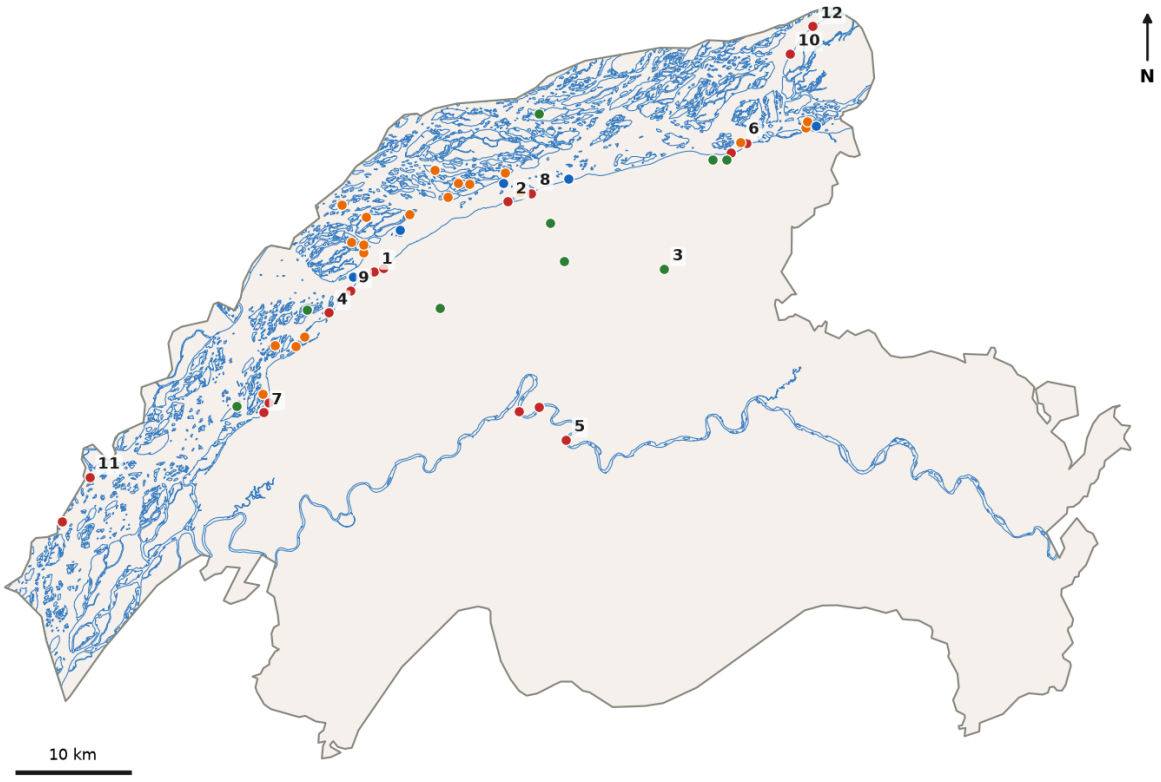

Immediate · Before monsoon · Routine · Monitor

Numbers are the site ranks in the table. Blue lines: river bank today (SWiFT-Bank). Grey line: district boundary.

Change since the last report

Compared with the report of 10-10-2026: bank erosion +144.3 ha, char loss -5,262.0 ha, sites for immediate action +8.

Priority sites for field verification (top 12 of 50)

Rank	Site	Type	Urgency	Lead agency	Area (ha)	Bank retreat (m/yr)	People within 500 m	Nearest place	Location
1	S2610-01	Bank erosion	Immediate	Water Resources	58.1	–	3,388	Dibrugarh	27.4631 94.8664
2	S2610-02	Bank erosion	Immediate	Water Resources	16.6	40	2,019	Naguli Ghat	27.5160 94.9837
3	S2610-03	Vegetation loss	Routine	Soil Conservation	98.8	–	3,690	Bhatiu	27.4621 95.1187
4	S2610-04	Bank erosion	Immediate	Water Resources	39.5	89	1,090	Changamari Habi	27.4322 94.8270
5	S2610-05	Bank erosion	Immediate	Water Resources	16.0	39	3,174	Lengeri Gaon	27.3309 95.0310
6	S2610-06	Bank erosion	Before monsoon	Water Resources	75.8	33	487	Nakapur	27.5591 95.1864
7	S2610-07	Bank erosion	Immediate	Water Resources	23.4	44	895	Changamari Habi	27.3554 94.7690
8	S2610-08	Bank erosion	Immediate	Water Resources	12.1	32	1,252	Naguli Ghat	27.5223 95.0045
9	S2610-09	Bank erosion	Immediate	Water Resources	13.0	31	2,262	Changamari Habi	27.4489 94.8459
10	S2610-10	Bank erosion	Immediate	Water Resources	72.2	84	242	Nakapur	27.6268 95.2308
11	S2610-11	Bank erosion	Immediate	Water Resources	13.6	40	996	Dhemaji	27.3074 94.6177
12	S2610-12	Bank erosion	Immediate	Water Resources	55.3	88	47	Borghuli	27.6477 95.2510

What to do

Bank erosion. Inform the Water Resources Department for emergency bank protection (geobags, porcupines) before the monsoon. Alert the circle office and the district disaster management authority.

Likely bank erosion (AI). Predicted by the AI model, not yet seen. Check in the field before the monsoon; if bank cutting is seen, treat it as active bank erosion.

Char or sandbar lost. Loss inside the river channel. No structural work; keep watch. If people live on the char, inform them and the circle office.

Vegetation loss. Check the cause (harvest, tea pruning, clearing). If a slope or bank was cleared, restore cover with grass, cover crops or trees.

About this report

This report is made automatically every two weeks from Sentinel-2 satellite images. River bank erosion is mapped with SWiFT-Bank, a tested sub-pixel method at 10 m; vegetation loss, bare soil and soil-loss risk use 20 m layers. Areas of bank erosion and char loss are land lost to the river. People within 500 m are counted from WorldPop 2020 and are an upper estimate. All sites must be confirmed in the field before works are planned.

Full maps, data downloads and the field form: https://sites.google.com/dibru.ac.in/dibrugarhsoil/dibrugarh-district