

Soil Erosion Monitoring Report · Dibrugarh District

Report date: 10-10-2026

Satellite images compared: 31-10-2019 – 28-02-2020 and 31-10-2025 – 28-02-2026

Summary

Between the 31-10-2019 – 28-02-2020 and 31-10-2025 – 28-02-2026 windows, 679.5 ha of stable land along the river turned into water and 10,221.3 ha of chars or sandbars were lost, while 16,799.2 ha of new land formed. 9 sites need immediate bank protection, and about 13,731 people live within 500 m of them. 15 more sites should be checked in the field before the monsoon. Away from the river, 21,118 ha lost vegetation cover and 17,565 ha became bare soil.

679.5 ha

Bank erosion

10,221.3 ha

Char or sandbar lost

9

Sites for immediate action

13,731

People within 500 m of immediate-action sites

16,799.2 ha

New land (accretion)

15

Sites to check before the monsoon


21,118 ha

Vegetation loss

17,565 ha

New bare soil

Priority sites

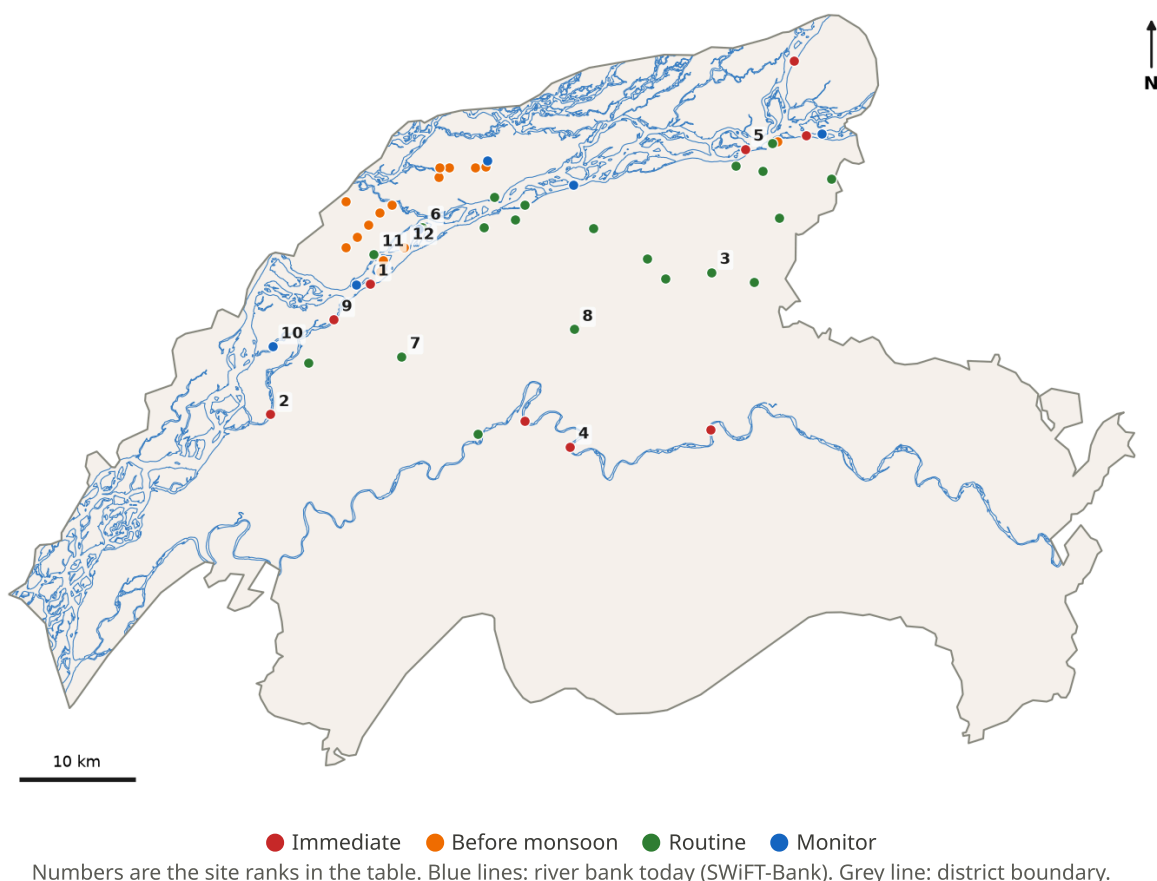

Change since the last report

This is the first report in the series.

Priority sites for field verification (top 12 of 50)

Rank	Site	Type	Urgency	Lead agency	Area (ha)	Bank retreat (m/yr)	People within 500 m	Nearest place	Location
1	S2602-01	Bank erosion	Immediate	Water Resources	53.9	94	3,079	Dibrugarh	27.4595 94.8595
2	S2602-02	Bank erosion	Immediate	Water Resources	23.7	164	1,337	Changamari Habi	27.3595 94.7719
3	S2602-03	Vegetation loss	Routine	Soil Conservation	89.7	–	1,933	Bhatiu	27.4642 95.1562
4	S2602-04	Bank erosion	Immediate	Water Resources	14.7	40	3,393	Lengeri Gaon	27.3308 95.0311
5	S2602-05	Bank erosion	Immediate	Water Resources	69.0	170	517	Nakapur	27.5591 95.1871
6	S2602-06	Vegetation loss	Routine	Soil Conservation	516.2	–	7,153	Dibrugarh	27.5022 94.9057
7	S2602-07	Vegetation loss	Routine	Soil Conservation	39.8	–	4,484	Changamari Habi	27.4027 94.8863
8	S2602-08	Vegetation loss	Routine	Soil Conservation	49.0	–	2,158	Lāhoāl Pātra	27.4218 95.0361
9	S2602-09	Bank erosion	Immediate	Water Resources	23.7	214	1,025	Changamari Habi	27.4323 94.8276
10	S2602-10	New land (accretion)	Monitor	Revenue / Soil Conservation	1,261.4	–	7,666	Changamari Habi	27.4120 94.7746
11	S2602-11	Vegetation loss	Routine	Soil Conservation	129.0	–	2,336	Dibrugarh	27.4823 94.8634
12	S2602-12	Likely bank erosion (AI)	Before monsoon	Soil Conservation	41.7	–	2,336	Dibrugarh	27.4873 94.8899

What to do

Bank erosion. Inform the Water Resources Department for emergency bank protection (geobags, porcupines) before the monsoon. Alert the circle office and the district disaster management authority.

Char or sandbar lost. Loss inside the river channel. No structural work; keep watch. If people live on the char, inform them and the circle office.

New bare soil. Check for earth cutting, brick kilns or construction. Use mulching or cover crops, and control runoff with bunds or silt traps.

Likely bank erosion (AI). Predicted by the AI model, not yet seen. Check in the field before the monsoon; if bank cutting is seen, treat it as active bank erosion.

Vegetation loss. Check the cause (harvest, tea pruning, clearing). If a slope or bank was cleared, restore cover with grass, cover crops or trees.

New land (accretion). New land from river deposits. Keep watch and avoid permanent settlement.

About this report

This report is made automatically every two weeks from Sentinel-2 satellite images. River bank erosion is mapped with SWIFT-Bank, a tested sub-pixel method at 10 m; vegetation loss, bare soil and soil-loss risk use 20 m layers. Areas of bank erosion and char loss are land lost to the river. People within 500 m are counted from WorldPop 2020 and are an upper estimate. All sites must be confirmed in the field before works are planned.

Full maps, data downloads and the field form: <https://sites.google.com/dibru.ac.in/dibrugarhsoil/dibrugarh-district>