SOIL CONSERVATION DEPARTMENT, GOVERNMENT OF ASSAM

Soil Erosion Monitoring Report · Majuli District

Report date: 26-10-2026


Satellite images compared: 28-06-2020 – 26-10-2020 and 28-06-2026 – 26-10-2026

Summary

Between the 28-06-2020 – 26-10-2020 and 28-06-2026 – 26-10-2026 windows, 209.2 ha of stable land along the river turned into water and 2,069.5 ha of chars or sandbars were lost, while 2,571.2 ha of new land formed. 7 sites need immediate bank protection, and about 5,859 people live within 500 m of them. 14 more sites should be checked in the field before the monsoon. Away from the river, 3,318 ha lost vegetation cover and 528 ha became bare soil.

209.2 ha Bank erosion	**2,069.5 ha** Char or sandbar lost	**7** Sites for immediate action	**5,859** People within 500 m of immediate-action sites
2,571.2 ha New land (accretion)	**14** Sites to check before the monsoon	**3,318 ha** Vegetation loss	**528 ha** New bare soil

Priority sites

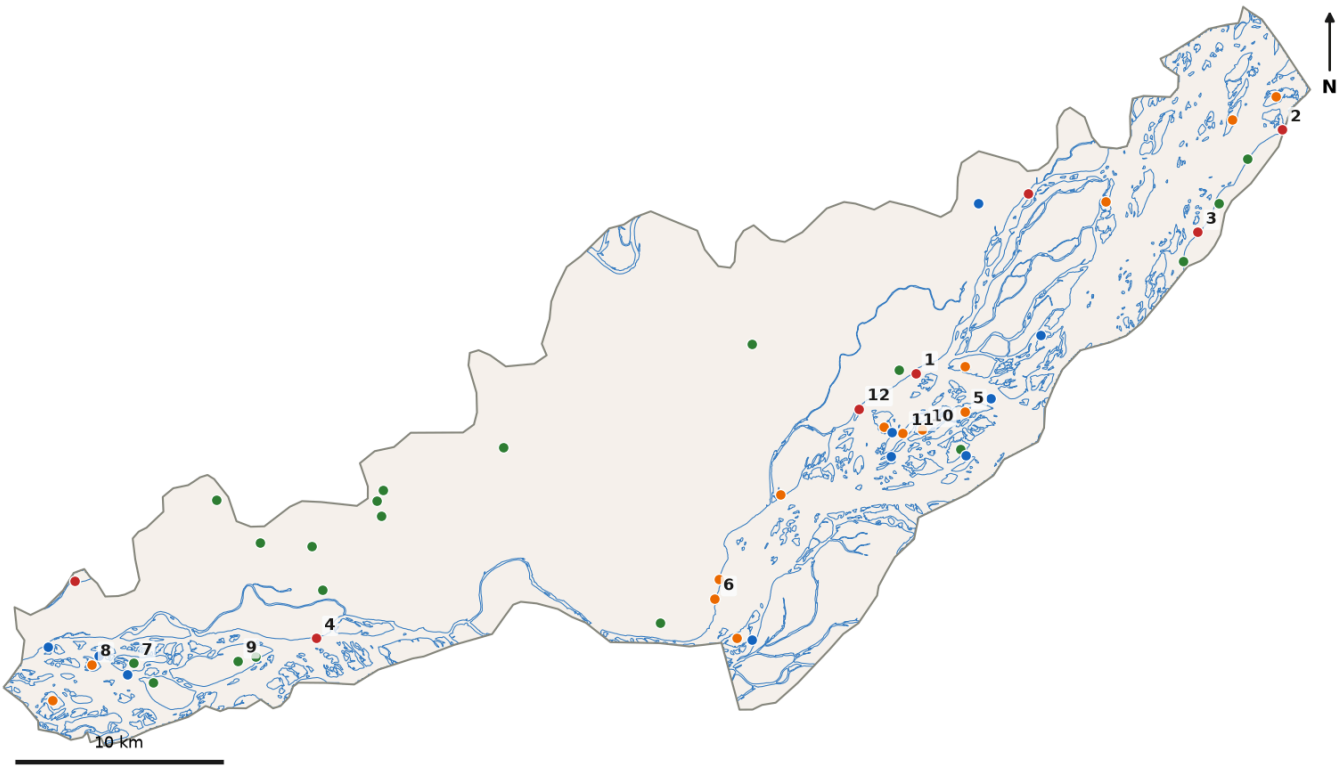

● Immediate ● Before monsoon ● Routine ● Monitor

Numbers are the site ranks in the table. Blue lines: river bank today (SWiFT-Bank). Grey line: district boundary.

Change since the last report

Compared with the report of 10-10-2026: bank erosion +61.0 ha, char loss -2,979.6 ha, sites for immediate action +3.

Priority sites for field verification (top 12 of 50)

Rank	Site	Type	Urgency	Lead agency	Area (ha)	Bank retreat (m/yr)	People within 500 m	Nearest place	Location
1	SMJ2610-01	Bank erosion	Immediate	Water Resources	52.4	69	1,122	Jangraimukh	27.0246 94.4000
2	SMJ2610-02	Bank erosion	Immediate	Water Resources	32.6	67	934	Gaurisagar Tiniali	27.1286 94.5789
3	SMJ2610-03	Bank erosion	Immediate	Water Resources	32.0	69	729	Gaurisagar Tiniali	27.0846 94.5373
4	SMJ2610-04	Bank erosion	Immediate	Water Resources	27.5	59	363	Kakarikata	26.9122 94.1081
5	SMJ2610-05	Likely bank erosion (AI)	Before monsoon	Soil Conservation	68.1	–	780	Hati Ghuli	27.0078 94.4234
6	SMJ2610-06	Likely bank erosion (AI)	Before monsoon	Soil Conservation	16.5	–	1,545	Dakhinpat	26.9279 94.3014
7	SMJ2610-07	Likely bank erosion (AI)	Routine	Soil Conservation	66.8	–	423	Birinabari	26.9021 94.0195
8	SMJ2610-08	Likely bank erosion (AI)	Before monsoon	Soil Conservation	41.4	–	872	Birinabari	26.9017 93.9994
9	SMJ2610-09	Likely bank erosion (AI)	Routine	Soil Conservation	93.2	–	132	Birinabari	26.9027 94.0700
10	SMJ2610-10	Likely bank erosion (AI)	Before monsoon	Soil Conservation	54.6	–	647	Hati Ghuli	27.0003 94.4029
11	SMJ2610-11	Likely bank erosion (AI)	Before monsoon	Soil Conservation	39.9	–	693	Hati Ghuli	26.9987 94.3934
12	SMJ2610-12	Bank erosion	Immediate	Water Resources	14.7	24	939	Jangraimukh	27.0097 94.3723

What to do

Bank erosion. Inform the Water Resources Department for emergency bank protection (geobags, porcupines) before the monsoon. Alert the circle office and the district disaster management authority.

Char or sandbar lost. Loss inside the river channel. No structural work; keep watch. If people live on the char, inform them and the circle office.

New land (accretion). New land from river deposits. Keep watch and avoid permanent settlement.

Likely bank erosion (AI). Predicted by the AI model, not yet seen. Check in the field before the monsoon; if bank cutting is seen, treat it as active bank erosion.

Vegetation loss. Check the cause (harvest, tea pruning, clearing). If a slope or bank was cleared, restore cover with grass, cover crops or trees.

About this report

This report is made automatically every two weeks from Sentinel-2 satellite images. River bank erosion is mapped with SWiFT-Bank, a tested sub-pixel method at 10 m; vegetation loss, bare soil and soil-loss risk use 20 m layers. Areas of bank erosion and char loss are land lost to the river. People within 500 m are counted from WorldPop 2020 and are an upper estimate. All sites must be confirmed in the field before works are planned.

Full maps, data downloads and the field form: https://sites.google.com/dibru.ac.in/dibrugarhsoil/majuli-district