SOIL CONSERVATION DEPARTMENT, GOVERNMENT OF ASSAM

Soil Erosion Monitoring Report · Majuli District

Report date: 10-10-2026


Satellite images compared: 31-10-2019 – 28-02-2020 and 31-10-2025 – 28-02-2026

Summary

Between the 31-10-2019 – 28-02-2020 and 31-10-2025 – 28-02-2026 windows, 148.2 ha of stable land along the river turned into water and 5,049.1 ha of chars or sandbars were lost, while 5,307.9 ha of new land formed. 4 sites need immediate bank protection, and about 2,903 people live within 500 m of them. 11 more sites should be checked in the field before the monsoon. Away from the river, 4,864 ha lost vegetation cover and 3,985 ha became bare soil.

148.2 ha Bank erosion	**5,049.1 ha** Char or sandbar lost	**4** Sites for immediate action	**2,903** People within 500 m of immediate-action sites
5,307.9 ha New land (accretion)	**11** Sites to check before the monsoon	**4,864 ha** Vegetation loss	**3,985 ha** New bare soil

Priority sites

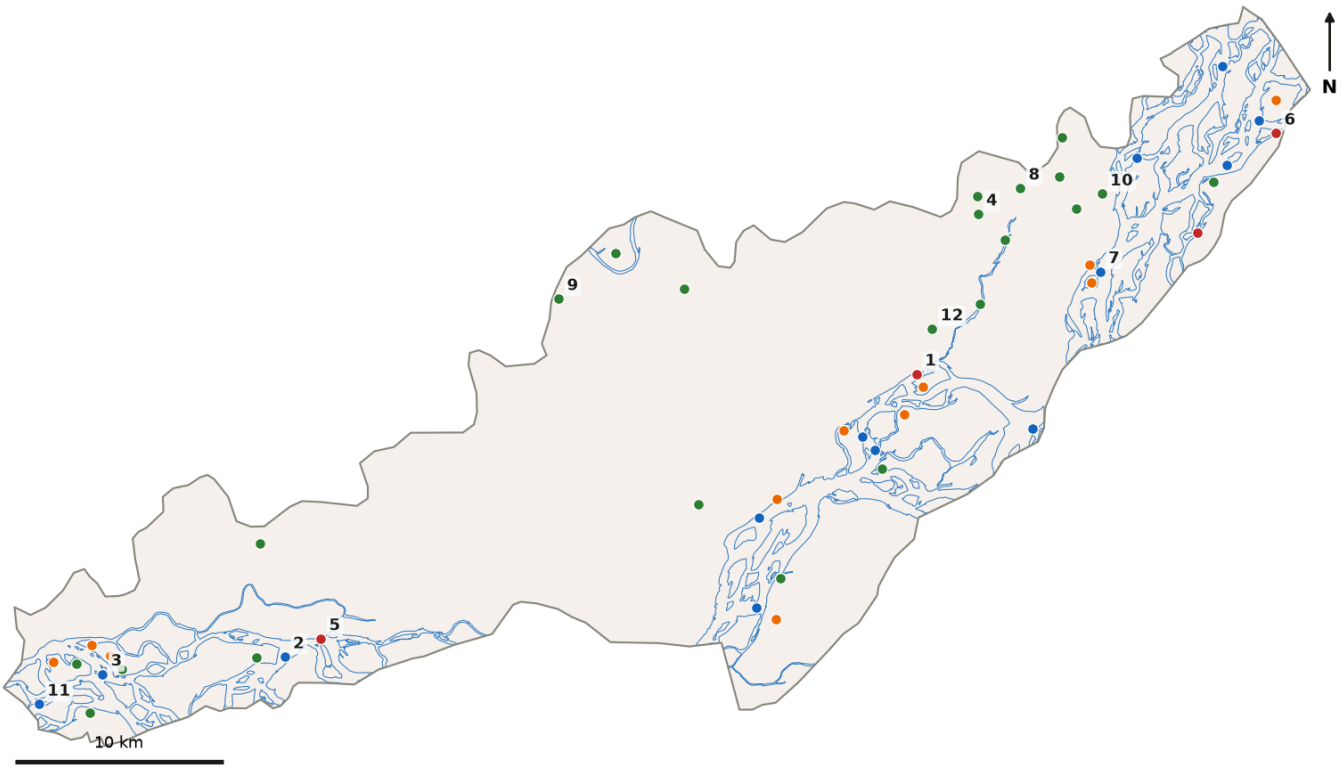

Immediate · Before monsoon · Routine · Monitor

Numbers are the site ranks in the table. Blue lines: river bank today (SWiFT-Bank). Grey line: district boundary.

Change since the last report

This is the first report in the series.

Priority sites for field verification (top 12 of 50)

Rank	Site	Type	Urgency	Lead agency	Area (ha)	Bank retreat (m/yr)	People within 500 m	Nearest place	Location
1	SMJ2602-01	Bank erosion	Immediate	Water Resources	38.4	149	1,063	Jangraimukh	27.0245 94.4004
2	SMJ2602-02	Char or sandbar lost	Monitor	Water Resources	543.6	340	5,282	Birinabari	26.9044 94.0929
3	SMJ2602-03	Char or sandbar lost	Monitor	Water Resources	517.6	153	4,996	Birinabari	26.8975 94.0046
4	SMJ2602-04	Vegetation loss	Routine	Soil Conservation	49.9	–	1,739	Jangraimukh	27.0937 94.4309
5	SMJ2602-05	Bank erosion	Immediate	Water Resources	23.3	108	338	Kakarikata	26.9121 94.1104
6	SMJ2602-06	Bank erosion	Immediate	Water Resources	21.5	50	812	Gaurisagar Tiniali	27.1272 94.5760
7	SMJ2602-07	Char or sandbar lost	Monitor	Water Resources	396.6	196	3,554	Gaurisagar Tiniali	27.0680 94.4899
8	SMJ2602-08	New bare soil	Routine	Soil Conservation	57.4	–	1,871	Jangraimukh	27.1047 94.4516
9	SMJ2602-09	New bare soil	Routine	Soil Conservation	32.3	–	1,849	Jangraimukh	27.0588 94.2272
10	SMJ2602-10	Vegetation loss	Routine	Soil Conservation	70.7	–	1,422	Gaurisagar Tiniali	27.1017 94.4912
11	SMJ2602-11	Char or sandbar lost	Monitor	Water Resources	272.4	286	2,067	Birinabari	26.8847 93.9738
12	SMJ2602-12	Vegetation loss	Routine	Soil Conservation	71.9	–	1,248	Jangraimukh	27.0440 94.4082

What to do

Bank erosion. Inform the Water Resources Department for emergency bank protection (geobags, porcupines) before the monsoon. Alert the circle office and the district disaster management authority.

Char or sandbar lost. Loss inside the river channel. No structural work; keep watch. If people live on the char, inform them and the circle office.

New bare soil. Check for earth cutting, brick kilns or construction. Use mulching or cover crops, and control runoff with bunds or silt traps.

Likely bank erosion (AI). Predicted by the AI model, not yet seen. Check in the field before the monsoon; if bank cutting is seen, treat it as active bank erosion.

Vegetation loss. Check the cause (harvest, tea pruning, clearing). If a slope or bank was cleared, restore cover with grass, cover crops or trees.

About this report

This report is made automatically every two weeks from Sentinel-2 satellite images. River bank erosion is mapped with SWiFT-Bank, a tested sub-pixel method at 10 m; vegetation loss, bare soil and soil-loss risk use 20 m layers. Areas of bank erosion and char loss are land lost to the river. People within 500 m are counted from WorldPop 2020 and are an upper estimate. All sites must be confirmed in the field before works are planned.

Full maps, data downloads and the field form: https://sites.google.com/dibru.ac.in/dibrugarhsoil/majuli-district