

Some article numbers may have changed. If this isn't what you're looking for, try searching all articles. [Search articles](#)

# Connectrix B-Series: How to Interpret the Brocade porterrshow output, and what do the counters mean. Self-Help

Summary: Explanation of the counters in the porterrshow command

Detailed Article

Symptoms

Cause

Resolution

Additional Info

Affected Products

Provide Feedback

Please select a product to check article relevancy



Identify Your Product ▼

## Symptoms

How to Interpret the Brocade porterrshow output  
What do the porterrshow counters mean?  
Interprets and explains the porterrshow output (port errors) of Brocade SAN switches and the possible causes of the errors.

For action to be taken when counters increase, see the copy of the KB article.  
[Connectrix: How to troubleshoot Fibre Channel node to switch port or SFP communication problems by means of elimination?](#)  
Below in the notes section of this KB.

/fabos/cliexec/porterrshow:

| frames |        | enc  | crc | crc   | too  | too  | bad | enc | disc | link | loss | loss | frjt | fbsy | c3timeout | pcs | uncor |     |
|--------|--------|------|-----|-------|------|------|-----|-----|------|------|------|------|------|------|-----------|-----|-------|-----|
| tx     | rx     | in   | err | g_eof | shrt | long | eof | out | c3   | fail | sync | sig  |      |      | tx        | rx  | err   | err |
| 0:     | 575.2m | 2.1g | 0   | 0     | 0    | 0    | 0   | 0   | 1    | 0    | 0    | 0    | 0    | 0    | 0         | 0   | 0     | 0   |
| 1:     | 576.7m | 2.1g | 0   | 0     | 0    | 0    | 0   | 0   | 1    | 0    | 0    | 0    | 0    | 0    | 0         | 0   | 0     | 0   |
| 2:     | 611.3m | 2.1g | 0   | 0     | 0    | 0    | 0   | 0   | 1    | 0    | 0    | 0    | 0    | 0    | 0         | 0   | 0     | 0   |
| 3:     | 613.6m | 2.1g | 0   | 0     | 0    | 0    | 0   | 0   | 1    | 0    | 0    | 0    | 0    | 0    | 0         | 0   | 0     | 0   |

This command displays an error summary for all ports.

One output line is displayed per port, and shows error counters in ones, thousands (the number is followed by k), or millions (the number is followed by m)..

Cause

N/A

Resolution

Frames tx

Frames transmitted: The number of frames transmitted by the port. This number is a statistic that provides a baseline for the error counters.

Frames rx

Frames received: The number of frames transmitted by the port. This number is a statistic that provides a baseline for the error counters.

Enc in

Encoding errors inside frames: (RX). The number of 8b/10b encoding errors that have occurred inside frame boundaries. This counter is generally a zero value, although occasional errors may occur on a normal link and give a nonzero result. Minimum compliance with the link-bit error rate specification on a link continuously receiving frames would allow approximately one error every 20 minutes for 1 Gb/s. Reinitialization and reboots of associated Nx-port can also cause these errors. These errors are in the sum for the LLI errors.

Crc err

Frames with Cyclic Redundancy Check errors: (RX) The number of frames that have failed a Cyclic Redundancy Check. The Cyclic Redundancy Check (CRC) is a four-byte field that shall immediately follow the Data Field and shall be used to verify the data integrity of the frame header and Data Field. SOF (= Start-Of-Frame) and EOF (= End-Of-Frame) delimiters shall not be in the CRC verification. The CRC field shall be calculated on the Frame header and Data Field prior to encoding for transmission and after decoding upon reception. The CRC field shall be aligned on a word boundary. For CRC computation, the bit of the word-aligned four-byte field that corresponds to the first bit transmitted is the highest order bit. Frames that fail a CRC are noted but not modified and the destination device is responsible for rejecting and or re-requesting the frame. Statistically, enc out errors alone imply cable problems, the enc out and crc err in combination implies GBIC or SFP problems. These errors are in the sum for the LLI errors

crc g\_eof

CRC with good EOF (End Of Frame) received. (Rx). When a CRC with a good EOF is detected the switch increments the crc g\_eof counter, it tags the frame so no other port counts this CRC frame and forward the frame on. This allows CRC frames with good EOF to be quickly traced to the originating port.

Too short

The "too short" counter is an error statistics counter which is incremented whenever a frame, bounded by an SOF (Start of Frame) and EOF (End of Frame), is received and the number of words between the SOF and EOF is fewer than 7 words (6 words header plus 1 word CRC), that is, 38 bytes (not 48) including the SOF and EOF. This could be caused by the transmitter, or an unreliable link. Data frame size is a variable from 0 to 2112. These errors are in the sum for the LLI errors

Too long

Frames longer than maximum: The number of frames that are longer than the maximum frame size (36 bytes + data frame size). Data frame size is a variable from 0 to 2112. These errors are in the sum for the LLI errors. FC frames are 2148 byes maximum. If an EOF is corrupted or data generation is incorrect a too long error is generated.

Bad eof

Frames with bad end-of-frame delimiters: The end-of-frame (EOF) delimiter is an ordered set that immediately follows the CRC. After a loss-of-synchronization error continuous-mode alignment allows the receiver to reestablish word alignment at any point in the incoming bit stream while the receiver is Operational. Such realignment is likely (but not guaranteed) to result in Code Violations and subsequent loss of

Synchronization. Under certain conditions, it may be possible to realign an incoming bit stream without loss of Synchronization. If such a realignment occurs within a received frame, detection of the resulting error condition is dependent upon higher-level function (for example, invalid CRC, missing EOF Delimiter).

The EOF delimiter shall designate the end of the frame content and shall be followed by idles. There are three categories of EOF delimiters. One category of delimiter shall indicate that the frame is valid from the senders perspective and potentially valid from the receivers perspective. The second category shall indicate that the frame content is valid. This category shall only be used by an F-Port which receives a complete frame and decodes it before forwarding that frame on to another destination. The third category shall indicate the frame content is corrupted, and the frame was truncated during transmission. The third category shall be used by both N-Ports and F-Ports to indicate an internal malfunction, such as a transmitter failure, which does not allow the entire frame to be transmitted normally. These errors are in the sum for the LLI errors.

**enc out**

8bit/10bit encoding errors occurred in words (ordered sets) outside the FC frame. Words outside of frames are encoded, if this encoding is corrupted or an error is detected an enc out is generated.

Encoding error outside of frames: The number of 8b/10b encoding errors that have occurred outside frame boundaries. This counter may become a nonzero value during link initialization but indicates a problem if it increments faster than the link-bit error rate allows (once every 20 minutes for 1 Gb/s). This is caused by corrupted primitive sequences, that is: LIP f7,f7.

**NOTE:** Loss sig, loss sync and enc out errors are expected every time a user brings the port down and up by rebooting a host, power cycles a storage sub-system, disconnects and or reconnects a cable or invoke the portDisable/portEnable command. Also important is the fact, that these errors are also increasing, while a 2GBit switch negotiates the connection speed to its connected device - keep this in mind. Statistically, enc out errors alone imply cable problems, the enc out and crc err in combination implies SFP problems. These errors are in the sum for the LLI errors.

**Disc c3**

Number of Class 3 discarded frames (Rx). The counter includes the sum of the following C3 discard counters reported by portstatshow command:

er\_rx\_c3\_timeout, er\_tx\_c2\_timeout, er\_c2\_dest\_unreach, and er\_other\_disc

Discard class 3 errors could be generated by switch when devices send frames without FLOGI'ing first or with an invalid destination. This error is reporting that such a discard occurred.

Class 3 frames can be discarded due to timeouts or invalid or unreachable destinations. This counter increment during normal operation. It can also be used to show the effect of port congestion, means good frames from consecutive S-ID's and D-ID's not being directly routed port to port, but instead an exception frame is routed through the internal port (that normally should not happen with a port to port routing on the ASIC, but it does when the D-ID port suffers a buffer full condition and cannot accept any more frames). Also, if the destination is blocked due to high ISL workload (means that is: a long time with BB Credit Buffer = 0), that can cause buffer full conditions, therefore the S-ID port may (in extreme circumstances) meet a timeout condition and therefore the disc c3 counter will increase. These errors are in the sum for the LLI errors.

Some further information: A port can only receive one frame at a time (outside of xWDM connections it is not possible to shine 2 light pulses down an optical cable simultaneously). Therefore if two light sources try to share a port they have to use an arbitration algorithm where one light source goes through and the second waits for it is turn. When the first source has completed, the second source is allowed to go. This means that the sources can only run at 50% utilization (or equal busy and ready times). If the source is capable of streaming data at the speed of the D-ID (which a lot of HBA's are these days) any attempt by another similarly fast HBA results in a 50% performance decrease.

er\_unreachable are discards logged because the destination could not be reached or due to offline and or online of devices on the destination.

er\_other\_disc are actual discards which do not fall into either of the other defined discard frame categories. According Brocade they are insignificant and have no impact on performance.

**Link fail**

Link failures (LF1 or LF2 states): The number of times the port achieved Link fail1 and or Link fail 2 states. Received (Rx). If a Port remains in the LR Receive State for time greater than a timeout period (R\_T\_TOV), a Link Reset Protocol Timeout shall be detected which results in a Link Failure condition (enter the NOS Transmit State).

The link failure also indicates that loss of signal or loss of sync lasting longer than the R\_T\_TOV value was detected while not in the Offline state

**Loss sync**

Loss of synchronization: The number of times synchronization was lost. Synchronization failures on either bit or Transmission-Word boundaries are not separately identifiable and cause loss-of synchronization errors.

**NOTE:** "loss sig", "loss sync" and "enc out" errors are expected every time a user brings the port down and up (by rebooting a host, power cycles a storage sub-system, disconnects and or reconnects a cable or invoke the portDisable or portEnable command) loss sig = Loss of signal: The number of times the signal was lost. When a loss-of-signal condition is recognized by an operational receiver, the Loss-Of-Synchronization state shall be entered (if the receiver is not presently in that state). The receiver shall remain in this state until one of the following conditions occur: The loss-of-signal condition is corrected, and synchronization is regained - or - the receiver is reset.

The number of times a Loss of Signal was received, occurs when a signal is transmitted but none is being received on the same port.

frjt

Frames rejected with F\_RJT: The number of Fabric Port Reject Frames. These indicate that the delivery of a frame is being denied. Some reasons for issuing an F\_RJT include: Class not supported; invalid header field(s); and N-Port unavailable.

fbsy

If fabric cannot deliver a class 2 frame within the E\_D\_TOV frame will be discarded and a F\_BSY returned. (Tx) Frames busied with F\_BSY: Fabric Port Busy Frame. This frame is issued by the Fabric to indicate that a particular cannot be delivered because the Fabric or the destination N is busy.

c3-timeout tx

The number of transmit class 3 frames discarded at the transmission port due to timeout (platform- and port-specific).

c3-timeout rx

The number of receive class 3 frames received at this port and discarded at the transmission port due to timeout (platform- and port-specific).

pcs err


The number of Physical Coding Sublayer (PCS) block errors. This counter records encoding violations on 10 Gbps or 16 Gbps ports. In the porterrshow ER\_PCS\_BLK counter, this is applicable only on platforms that support 10 Gbps or 16 Gbps ports (6505/6510/6520/DCX-8510) and it was introduced with Condor3 ASIC, the GEN5 Platform. This counter is equivalent with enc\_out for 8 GB and or 4GB link and it is used only for 10 GB and 16 GB speed. The 10 GB and 16 GB links use 64 B or 66 B encoding instead of 8 B or 10 B for data transmission and "pcs err" (=er\_pcs\_blk) counter records encoding violations on 10 Gbps or 16 Gbps ports detected during decoding.

uncor err

The number of uncorrectable forward error corrections (FEC).

Additional Information

Please refer to this video:

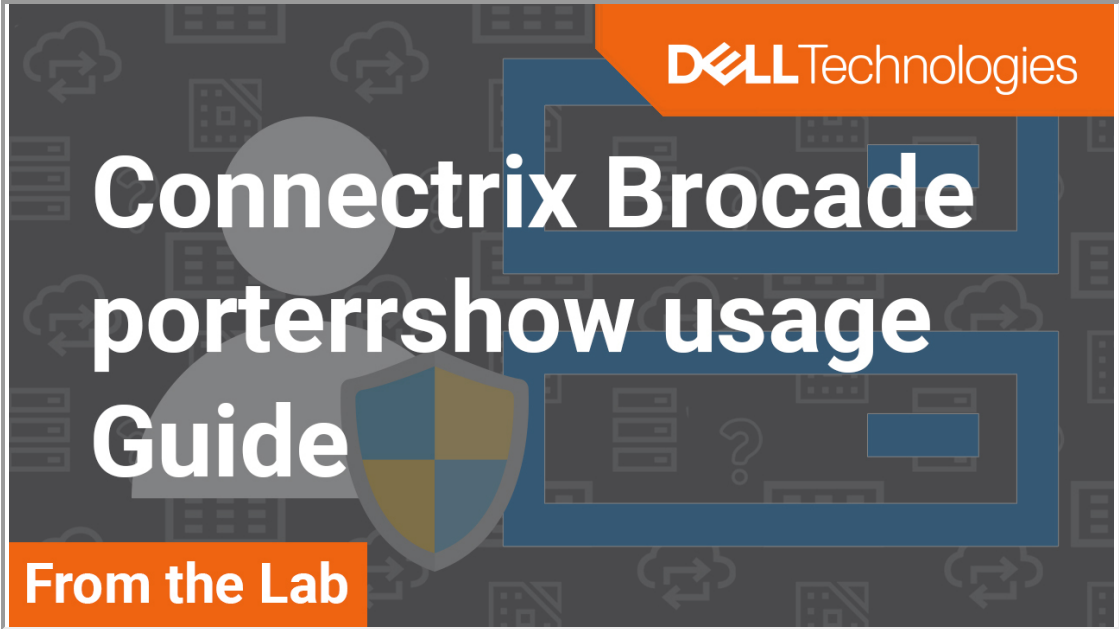

BROCADE EXAMPLES of the most common counters.

Example 1 ENC OUT with LINK FAIL and LOSS SYNC:

```
porterrshow :
CURRENT CONTEXT -- 3 , 111
frames enc crc crc too too bad enc disc link loss loss frjt fbsy c3timeout pcs
tx rx in err g_eof shrt long eof out c3 fail sync sig tx rx err
xx: 849.1k 493.2k 0 0 0 0 0 0 2.3m 0 4 6 0 0 0 0 0
```

General Reason:

Only valid, if port statistics have been cleared within the last 24 hours. Otherwise classify these counters as historical. Clear port statistics (<https://support.emc.com/kb/304525>) and retake data after 4-6 hours.

From the errors, we can see the link fail and loss of sync PLUS enc out errors, these can also include loss sig error. These combinations of errors generally indicate a host reboot or a link reset external to the switch. The enc out errors are caused during the

speed negotiation as part of a link initialization.

Expected Actions:

Verify that the device attached to the port had a legitimate reason to go offline/ online that is host reboot. If not, raise a SR.

Example 2 ENC OUT:

|                 |        |            |     |       |      |      |     |      |      |      |      |      |      |      |           |     |     |   |
|-----------------|--------|------------|-----|-------|------|------|-----|------|------|------|------|------|------|------|-----------|-----|-----|---|
| porterrshow     |        | :          |     |       |      |      |     |      |      |      |      |      |      |      |           |     |     |   |
| CURRENT CONTEXT |        | -- 3 , 111 |     |       |      |      |     |      |      |      |      |      |      |      |           |     |     |   |
| frames          |        | enc        | crc | crc   | too  | too  | bad | enc  | disc | link | loss | loss | frjt | fbsy | c3timeout | pcs |     |   |
| tx              | rx     | in         | err | g_eof | shrt | long | eof | out  | c3   | fail | sync | sig  |      |      | tx        | rx  | err |   |
| xx:             | 849.1k | 493.2k     | 0   | 0     | 0    | 0    | 0   | 2.3m | 0    | 0    | 0    | 0    | 0    | 0    | 0         | 0   | 0   | 0 |

General Reason:

Only valid, if port statistics have been cleared within the last 24 hours. Otherwise classify these counters as historical. Clear port statistics (<https://support.emc.com/kb/304525>) and retake data after 4-6 hours.

Enc out errors without any associated errors indicate dirty cable.

Expected Actions:

Inspect and clean all optic faces on cable and SFP connected to this port and attached devices.

Example 3 CRC and CRC G\_EOF:

|                 |        |            |     |       |      |      |     |     |      |      |      |      |      |      |           |     |     |   |
|-----------------|--------|------------|-----|-------|------|------|-----|-----|------|------|------|------|------|------|-----------|-----|-----|---|
| porterrshow     |        | :          |     |       |      |      |     |     |      |      |      |      |      |      |           |     |     |   |
| CURRENT CONTEXT |        | -- 3 , 111 |     |       |      |      |     |     |      |      |      |      |      |      |           |     |     |   |
| frames          |        | enc        | crc | crc   | too  | too  | bad | enc | disc | link | loss | loss | frjt | fbsy | c3timeout | pcs |     |   |
| tx              | rx     | in         | err | g_eof | shrt | long | eof | out | c3   | fail | sync | sig  |      |      | tx        | rx  | err |   |
| xx:             | 849.1k | 493.2k     | 0   | 1.2k  | 1.2k | 0    | 0   | 0   | 0    | 0    | 0    | 0    | 0    | 0    | 0         | 0   | 0   | 0 |

General Reason:

Only valid, if port statistics have been cleared within the last 24 hours. Otherwise classify these counters as historical. Clear port statistics (<https://support.emc.com/kb/304525>) and retake data after 4-6 hours.

The frame is entering the switch port with a bad CRC but with the end of the frame still marked as good. This is an indication that this is the first port to register the bad frame so the issue is either the SFP / Cable / Attached device interface on this specific port.

Expected Actions:

See default action in the resolution.

For an ISL port, clear stats with *statsclear* and *slotstatsclear* commands, wait 4-6 hours, and collect *supportsaves* from both switches and open SR for normal troubleshooting.

Example 4 CRC:

|                 |        |            |     |       |      |      |     |     |      |      |      |      |      |      |           |     |     |   |
|-----------------|--------|------------|-----|-------|------|------|-----|-----|------|------|------|------|------|------|-----------|-----|-----|---|
| porterrshow     |        | :          |     |       |      |      |     |     |      |      |      |      |      |      |           |     |     |   |
| CURRENT CONTEXT |        | -- 3 , 111 |     |       |      |      |     |     |      |      |      |      |      |      |           |     |     |   |
| frames          |        | enc        | crc | crc   | too  | too  | bad | enc | disc | link | loss | loss | frjt | fbsy | c3timeout | pcs |     |   |
| tx              | rx     | in         | err | g_eof | shrt | long | eof | out | c3   | fail | sync | sig  |      |      | tx        | rx  | err |   |
| xx:             | 849.1k | 493.2k     | 0   | 1.2k  | 0    | 0    | 0   | 0   | 0    | 0    | 0    | 0    | 0    | 0    | 0         | 0   | 0   | 0 |

General Reason:

Only valid, if port statistics have been cleared within the last 24 hours. Otherwise classify these counters as historical. Clear port statistics (<https://support.emc.com/kb/304525>) and retake data after 4-6 hours.

The port is recording a frame entering the switch with a bad CRC frame, but with the frame already marked as bad. Normally see this on an ISL and NPIV F-ports.

Expected Actions:

If CRC errors are logging on NPIV port, have the device investigated by maintaining vendor !  
For an ISL port, check all ports in the fabric for any port logging crc g\_oef and action as in Example 3.

Example 5 PCS ERR with LINK FAIL and LOSS SYNC:

|                 |        |            |     |       |      |      |     |     |      |      |      |      |      |      |           |     |    |     |
|-----------------|--------|------------|-----|-------|------|------|-----|-----|------|------|------|------|------|------|-----------|-----|----|-----|
| porterrshow     |        | :          |     |       |      |      |     |     |      |      |      |      |      |      |           |     |    |     |
| CURRENT CONTEXT |        | -- 3 , 111 |     |       |      |      |     |     |      |      |      |      |      |      |           |     |    |     |
| frames          |        | enc        | crc | crc   | too  | too  | bad | enc | disc | link | loss | loss | frjt | fbsy | c3timeout | pcs |    |     |
| tx              | rx     | in         | err | g_oef | shrt | long | eof | out | c3   | fail | sync | sig  |      |      |           | tx  | rx | err |
| xx:             | 849.1k | 493.2k     | 0   | 0     | 0    | 0    | 0   | 0   | 0    | 4    | 4    | 0    | 0    | 0    | 0         | 0   | 0  | 466 |

General Reason:

Only valid, if port statistics have been cleared within the last 24 hours. Otherwise classify these counters as historical. Clear port statistics (<https://support.emc.com/kb/304525>) and retake data after 4-6 hours.

This is applicable only on platforms that support 10 Gbps or 16 Gbps ports (6505/6510/6520/DCX-8510) and it was introduced with Condor3 ASIC, the GEN5 Platform. ER\_PCS\_BLK shows the number of Physical Coding Sublayer (PCS) block errors. This counter is equivalent with enc\_out for 8 GB or 4 GB link and it is used only for 10 GB and 16 GB speed.  
From the errors, we can see link fail and loss of sync plus pcs err errors, these can also include loss sig error.  
These combinations of errors generally indicate a host reboot or link reset external to the switch.  
The pcs err errors are caused during the speed negotiation as part of link initialization.

Expected Actions:

Verify that the device attached to the port had a legitimate reason to go offline/online that is host reboot. If not, raise SR.

Example 6 PCS ERR:

|                 |        |            |     |       |      |      |     |     |      |      |      |      |      |      |           |     |    |     |
|-----------------|--------|------------|-----|-------|------|------|-----|-----|------|------|------|------|------|------|-----------|-----|----|-----|
| porterrshow     |        | :          |     |       |      |      |     |     |      |      |      |      |      |      |           |     |    |     |
| CURRENT CONTEXT |        | -- 3 , 111 |     |       |      |      |     |     |      |      |      |      |      |      |           |     |    |     |
| frames          |        | enc        | crc | crc   | too  | too  | bad | enc | disc | link | loss | loss | frjt | fbsy | c3timeout | pcs |    |     |
| tx              | rx     | in         | err | g_oef | shrt | long | eof | out | c3   | fail | sync | sig  |      |      |           | tx  | rx | err |
| xx:             | 849.1k | 493.2k     | 0   | 0     | 0    | 0    | 0   | 0   | 0    | 0    | 0    | 0    | 0    | 0    | 0         | 0   | 0  | 466 |

General Reason:

Only valid, if port statistics have been cleared within the last 24 hours. Otherwise classify these counters as historical. Clear port statistics (<https://support.emc.com/kb/304525>) and retake data after 4-6 hours.

PCS ERR errors without any associated errors indicate dirty cable.

Expected Actions:

Inspect and clean all optic faces on cable and SFP connected to this port and attached devices.

Example 7 C3timout PLUS Disc c3:

|                 |        |            |     |       |      |      |     |     |      |      |      |      |      |      |           |     |    |     |
|-----------------|--------|------------|-----|-------|------|------|-----|-----|------|------|------|------|------|------|-----------|-----|----|-----|
| porterrshow     |        | :          |     |       |      |      |     |     |      |      |      |      |      |      |           |     |    |     |
| CURRENT CONTEXT |        | -- 3 , 111 |     |       |      |      |     |     |      |      |      |      |      |      |           |     |    |     |
| frames          |        | enc        | crc | crc   | too  | too  | bad | enc | disc | link | loss | loss | frjt | fbsy | c3timeout | pcs |    |     |
| tx              | rx     | in         | err | g_oef | shrt | long | eof | out | c3   | fail | sync | sig  |      |      |           | tx  | rx | err |
| xx:             | 849.1k | 493.2k     | 0   | 0     | 0    | 0    | 0   | 0   | 2.4k | 0    | 0    | 0    | 0    | 0    | 2.4k      | 0   | 0  | 0   |

General Reason:

Only valid, if port statistics have been cleared within the last 24 hours. Otherwise classify these counters as historical. Clear port statistics (<https://support.emc.com/kb/304525>) and retake data after 4-6 hours.

C3TIMEOUT discards showing that frames are discarded at this port at default timeout of 500 ms.  
TX - Frames are not able to be send out of this switch port.  
RX - Frames are not accepted by the switch port and discarded at default timeout of 500 ms.

Expected Actions:

These errors indicate a potential performance issue in the fabric or attached device, see KB articles :  
464206: [Performance issues in a SAN. \(Slow drain, congestion, oversubscription.\)](#)  
and  
464027 : [Connectrix: Congestion Spreading Knowledge Map](#)  
as a starting point of your investigation.

Example 8 Disc c3:

|                 |        |            |     |       |      |      |     |     |      |      |      |      |      |      |           |     |    |     |
|-----------------|--------|------------|-----|-------|------|------|-----|-----|------|------|------|------|------|------|-----------|-----|----|-----|
| porterrshow     |        | :          |     |       |      |      |     |     |      |      |      |      |      |      |           |     |    |     |
| CURRENT CONTEXT |        | -- 3 , 111 |     |       |      |      |     |     |      |      |      |      |      |      |           |     |    |     |
| frames          |        | enc        | crc | crc   | too  | too  | bad | enc | disc | link | loss | loss | frjt | fbsy | c3timeout | pcs |    |     |
| tx              | rx     | in         | err | g_eof | shrt | long | eof | out | c3   | fail | sync | sig  |      |      |           | tx  | rx | err |
| xx:             | 849.1k | 493.2k     | 0   | 0     | 0    | 0    | 0   | 0   | 2.4k | 0    | 0    | 0    | 0    | 0    | 0         | 0   | 0  | 0   |

General Reason:

Only valid, if port statistics have been cleared within the last 24 hours. Otherwise classify these counters as historical. Clear port statistics (<https://support.emc.com/kb/304525>) and retake data after 4-6 hours.

Accumulation of "unreachable," "other" or "unroutable" frames which are discarded. (See command portstatsshow output for details of the discards.)

Expected Actions:

Discards C3 on their own, in general no impact on the SAN.

Example 9 Uncorr err:

|                 |      |            |     |       |      |      |     |     |      |      |      |      |      |      |           |     |       |     |    |
|-----------------|------|------------|-----|-------|------|------|-----|-----|------|------|------|------|------|------|-----------|-----|-------|-----|----|
| porterrshow     |      | :          |     |       |      |      |     |     |      |      |      |      |      |      |           |     |       |     |    |
| CURRENT CONTEXT |      | -- 3 , 111 |     |       |      |      |     |     |      |      |      |      |      |      |           |     |       |     |    |
| frames          |      | enc        | crc | crc   | too  | too  | bad | enc | disc | link | loss | loss | frjt | fbsy | c3timeout | pcs | uncor |     |    |
| tx              | rx   | in         | err | g_eof | shrt | long | eof | out | c3   | fail | sync | sig  |      |      | tx        | rx  | err   | err |    |
| xx:             | 1.1g | 468.4m     |     | 0     | 0    | 0    | 0   | 0   | 0    | 0    | 0    | 0    | 0    | 0    | 0         | 0   | 0     | 0   | 48 |

Count of blocks that were left uncorrected by FEC

If any accompanying CRC, enc\_out, bad eof (pcs err) errors, which could impact data frames and ordered sets respectively (so r\_rdy could be lost, causing credit depletion). Follow the activity advised for these errors.  
If neither of these is incrementing, the uncorrected errors are having minimal effect, but are a sign that the link is not error free, so there could be a cable or SFP issue developing.  
If only uncorr err then the cable should be tested and the connectors cleaned as a first step.

Affected Products

Connectrix

Products

Connectrix, Connectrix DS-300B, Connectrix DS-5100B, Connectrix DS-5300B, Connectrix DS-6505B, Connectrix DS-6510B, Connectrix DS-6620B, Connectrix ED-DCX6-4B, Connectrix ED-DCX6-8B, Connectrix ED-DCX8510-4B, Connectrix ED-DCX8510-8B ... [View More](#)

Article Properties

Article Number: 000037925

Article Type: Solution

Last Modified: 17 Apr 2026

Version: 8

Find answers to your questions from other Dell users

Visit Community

Support Services

Check if your device is covered by Support Services.

Check Support Status

Contact Support

Provide Feedback

Accurate

Useful

Easy to Understand

Was this article helpful?

Yes

No

Additional Information (optional)

0/3000 characters

Letters, numbers and any special characters except < > ( ) \

Submit Feedback