


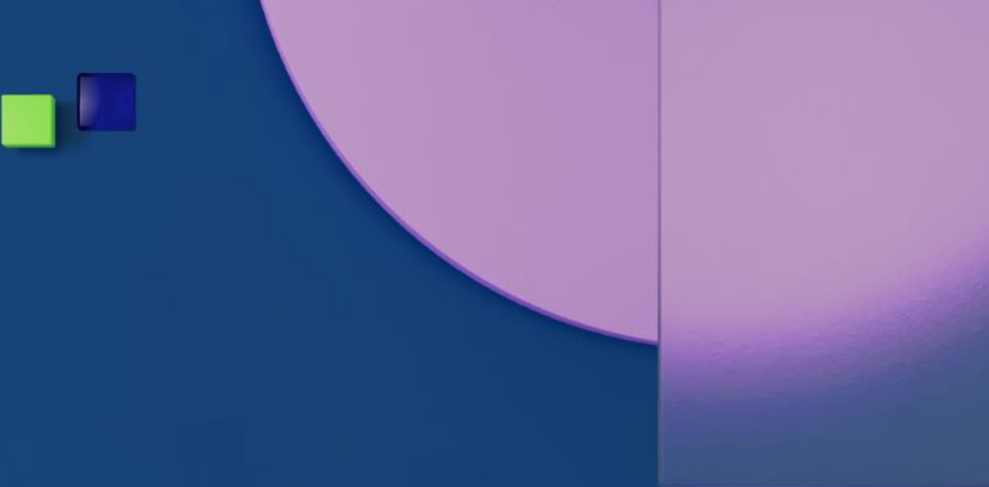

G270ZAN01.5 EDID EC notice

GDBU

2023/05/17

ECN Notice

Proposal:

The V-back porch of Current EDID setting is negative value. It can't interoperate with specific GPU.

```
00 FF FF FF FF FF FF 00 04 AF
00 00 01 01 01 01 32 0D 01 03
81 00 00 FF 0A 01 01 01 01 01
01 01 01 01 01 00 00 00 01 01
01 01 01 01 01 01 01 01 01 01
01 01 01 01 34 D0 00 A0 F0 70
14 80 64 32 80 01 DC 84 53 00
00 18 00 00 00 10 00 00 00 00
00 00 00 00 00 00 00 00 00 00
00 00 00 10 00 00 00 00 00 00
00 00 00 00 00 00 00 00 00 00
00 10 00 00 00 00 00 00 00 00
00 00 00 00 00 00 00 BE
```




```
00 FF FF FF FF FF FF 00 04 AF
00 00 01 01 01 01 32 0D 01 03
81 00 00 FF 0A 01 01 01 01 01
01 01 01 01 01 00 00 00 01 01
01 01 01 01 01 01 01 01 01 01
01 01 01 01 24 DB 00 E0 F0 70
8C 80 64 38 08 04 80 D8 10 00
00 18 24 DB 00 E0 F0 70 8C 80
64 38 08 04 80 D8 10 00 00 18
00 00 00 10 00 00 00 00 00 00
00 00 00 00 00 00 00 00 00 00
00 10 00 00 00 00 00 00 00 00
00 00 00 00 00 00 00 62
```


	H_front porch	H_sync	H_back porch	V_front porch	V_sync	V_back porch
Before	100	50	10	8	16	-4
After	100	56	68	16	8	116

ECN Notice

Implement Schedule :

Due to ADP EDID is not used for customer, we plan running changing for this case.

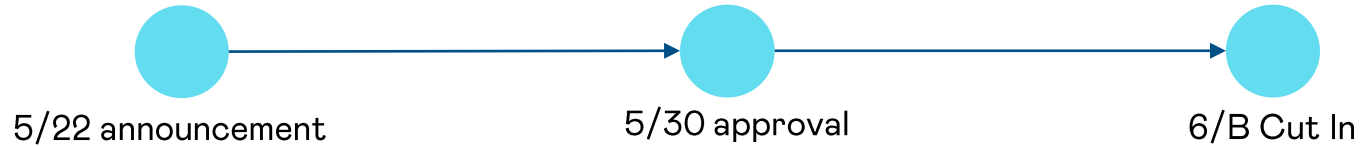

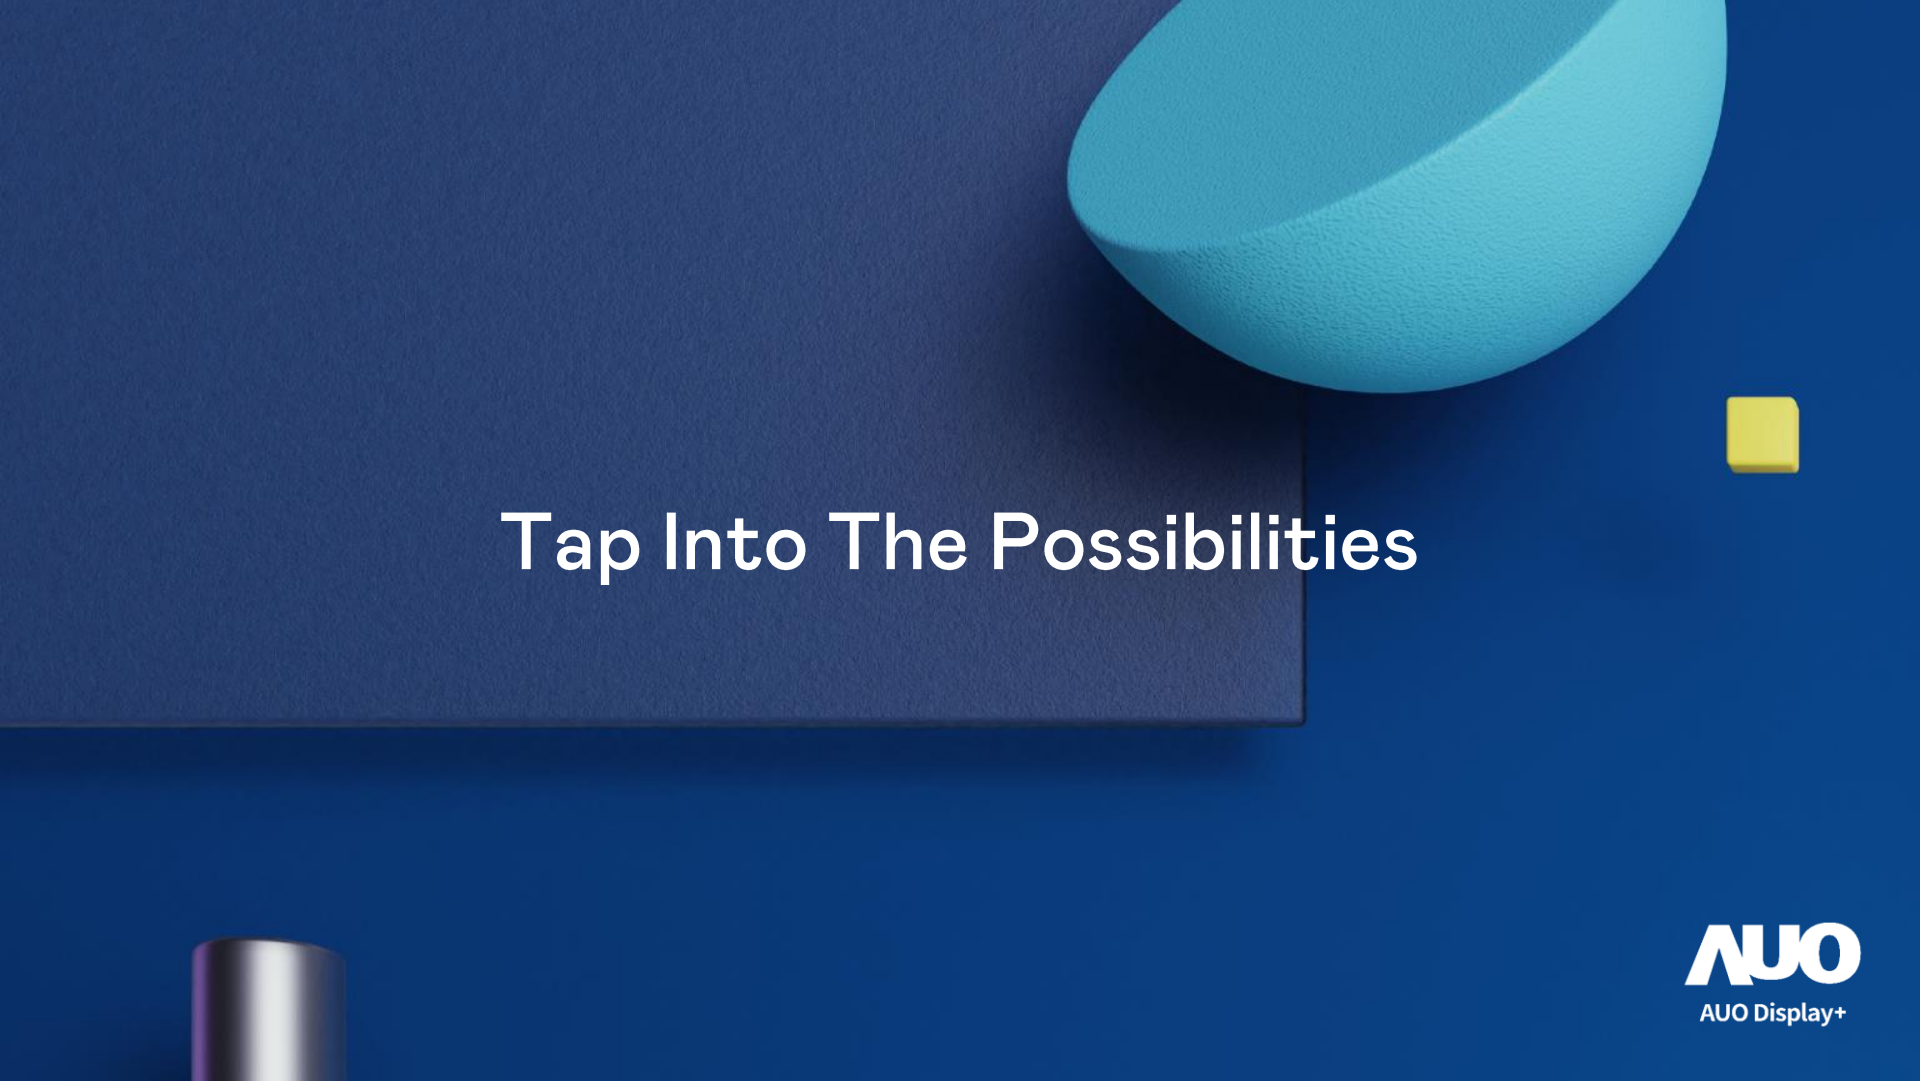

Tap Into The Possibilities