

A blue triangle graphic pointing to the right, located to the left of the main title.

FA report of V Block issue(NDF)

JUNGLIM G140HAB01.2

Problem Statement



- General Information

Brand/Project	JUNGLIM				Defect Phenomenon	NDF	
ES	YH Chuang				Defect Rate or Q' ty	1pcs	
AUO Model	G140HAB01.2				Defect Station	FIELD RETURN	
AUO S/N	D3553792VUZZZS0100				RMA No.	702610101420	
Beol/Module	ARRAY_FAB_ID	FEOL_FAB_ID	CF_FAB_ID	BEOL_FAB_ID	LCM_BEOL_FAB_ID	JI_FAB_ID	MODULE_FAB_ID
	L5B	L5B		L5B	S01		S01
Week Code	25/19				Issue Date	2026.05.13	

- Defect Panel S/N Picture



Problem Statement



- Describe the phenomenon at customer side

Customer Complaint:

V-block defect is observed at customer side, while the inspection is reported as normal at AUO.

- Defect Phenomenon

No abnormality is observed under dot/on-screen pattern verification.

Display appears normal across inspection patterns.

Observation:

1. No visible line or mura under standard pattern check.
2. The defect is not reproducible during internal display verification.
3. Phenomenon is identified as **V-block reported by customer**, but not confirmed under current test conditions.




Display normal

Root Cause Analysis


Step 1: Bonding and Routing Inspection

Findings:

1. Conductive particle distribution at the IC bonding area is normal and uniform.
2. No abnormality is observed in bonding quality.
3. Signal routing/traces are confirmed to be intact and continuous.

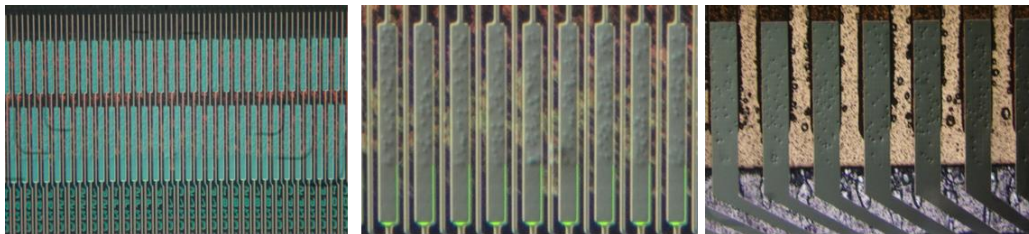

Conductive particle(IC Bonding) normal

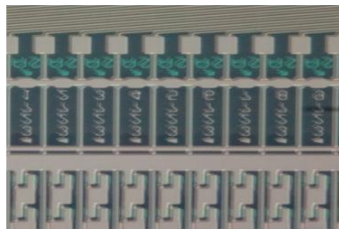


Signal routing/traces normal

Root Cause Analysis

Step 2: Mechanical Pressing Test

Findings:

1. No abnormality is observed during the pressing test.
2. The display remains stable without any V-block or image distortion under applied pressure.

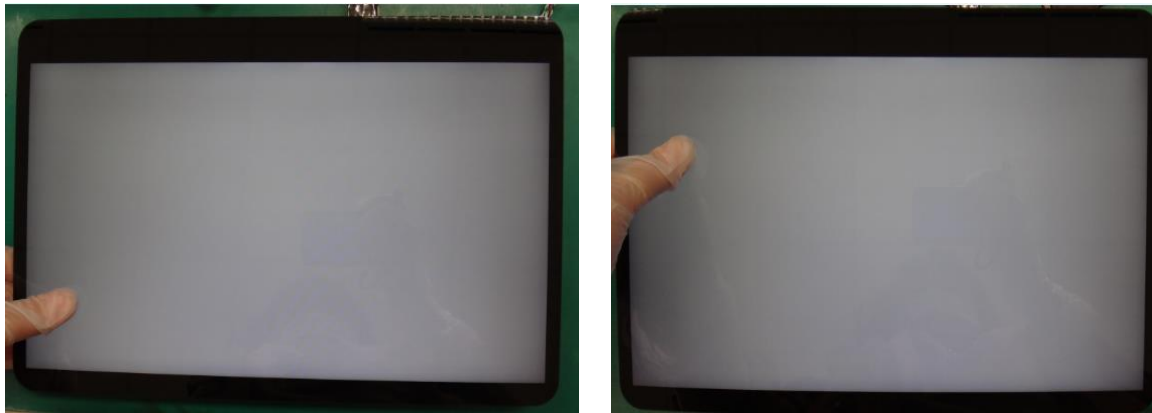


No abnormality is observed during the pressing test

Root Cause Analysis

Step 3: Appearance Inspection

Findings:

1. No abnormality is observed in the external appearance.
2. No visible damage, contamination, or mechanical defect is found.

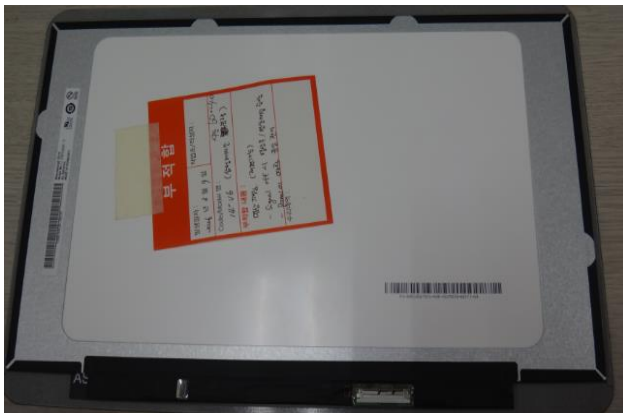


Appearance normal

Root Cause Analysis



Step 4: Aging Test Verification

Findings:

1. After 2-hour aging test, no abnormality is observed.
2. Display performance remains stable under multiple test patterns (white, RGB, checkerboard).
3. No V-block or image defect is reproduced during the test. °

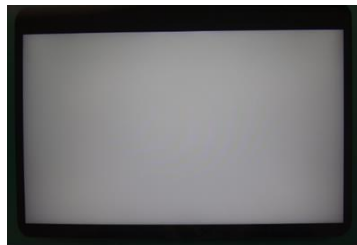

Aging 2h Display normal

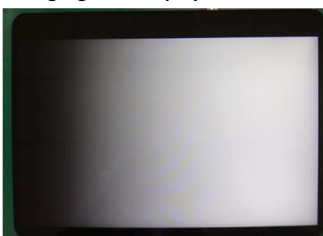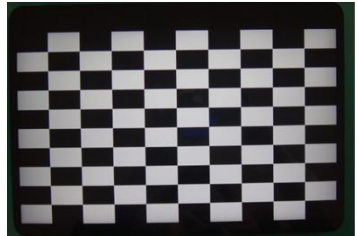

Conclusion



1. No abnormality is observed during display verification.
 2. IC bonding condition and signal routing are confirmed to be normal.
 3. No abnormality is observed under mechanical pressing test.
 4. After 2-hour aging test, the display performance remains stable with no defect observed.
- The panel is confirmed to have **normal functionality**, and no panel-related defect is identified.

亮麗創新  曼妙生活

Bright Innovation · Amazing Life



AUO

Innovating Life